ASBESTOS SURVEY REPORTS

for the

DEPARTMENT OF TRANSPORTATION DISTRICT 11, SAN DIEGO

JUNE 1999



Prepared By:

Department Of General Services Real Estate Services Division 1300 I Street, Suite 700 Sacramento, CA 95814

> Document #: DOTADS.046 DOTADS.045

These Asbestos Survey Reports document exposed asbestos containing materials in state-owned buildings constructed prior to 1989 which were surveyed by private asbestos consultants under contract with the Real Estate Services Division, Professional Services Branch (PSB) of the Department of General Services (DGS). The reports are printed output of the Structures Information System (SIS), Asbestos Data System (ADS) which provides automated tracking and electronic access to asbestos data for reporting, notifications, reinspections and other uses. These reports have been prepared in accordance with the PSB Asbestos Surveys Standard Procedures Manual (Survey Manual) and have undergone an extensive review and approval process. Departments are expected to maintain this data as an element of their Operations and Maintenance Program and in accordance with requirements as set forth in the Survey Manual.

It is recommended that each department distribute these reports to building users in accordance with asbestos notification law and the department's Asbestos Management Plan. Users who need further information to clarify the data may find interpretive reports in the first ten tabs of this document, written by the consultants who provided the survey data. Survey firms can be identified by the consultant's three letter Firm Code, shown in either the upper left or the upper right corner, and as referenced in the Personnel and Company Qualifications Reports. PSB has compiled past data into these reports so that prior PSB reports may be archived.

A major change in the ADS, as compared to prior PSB surveys, is the requirement to survey a specified list of reportable materials. In response to changing regulations and industry standards, certain materials have been assumed as asbestos-containing materials in lieu of performing sampling and lab analysis. If this presents an Operations and Maintenance problem for you, additional samples can be entered into the system as necessary to rebut an "Assumed Positive" status. Other reportable materials which are not suspect as asbestos-containing materials have been reported as "Assumed Negative". Consultant surveyor's responsibilities are described in detail in the Survey Manual that is available to all Departmental Asbestos Coordinators and Facility Managers.

Reports and other forms necessary to make changes to the published data may be printed through the ADS, available on the Internet. Refer to the ADS User's Manual at the back of this report for further instructions. PSB periodically conducts training seminars on the use and requirements of the ADS and the Survey Manual which are open to all state employees. Prior to undertaking the management of the ADS for your department or facility, it is recommended that you obtain this training.

Rev. 09/98

Real Estate Services Division

Asbestos Program Rev. 01/06/99

SIS BIdg # Priority	Building Name Specification Name [M#]	Material Description	Survey Date/Firm	ACM Status
3617	DISTRICT OFFICE			
	ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	1996 NWE	NONE DETECTED
S	ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	1996 NWE	ASSUMED POSITIVE
တ	ACOUSTICAL (PANELS) [M54]	2 FT X 4 FT WHITE, COARSE DIVOT PATTERN.	1996 NWE	ASSUMED POSITIVE
တ	ACOUSTICAL (SPRAYED) [M78]	WHITE FIBROUS INSULATION.	1996 NWE	ASSUMED POSITIVE
S	ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	1996 NWE	ASSUMED POSITIVE
တ	ACOUSTICAL (TILES) [M29]	1 FT X 1 FT WHITE, COARSE TEXTURE WIMASTIC.	1996 NWE	ASSUMED POSITIVE
Ø	ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	1996 NWE	ASSUMED POSITIVE
Ø	ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMAIL FISSURES & RANDOM PERFORATIONS W/MASTIC.	1996 NWE	ASSUMED POSITIVE
_	BUILDING INSULATION (ACOUSTIC) [M26]	4 FT X 10 FT BROWN CELLULOSE PANELS W/MASTIC.	1996 NWE	ASSUMED POSITIVE
٠ -	BUILDING INSULATION (ACOUSTIC) [M64]	4 FT X 10 FT BROWN CELLULOSE WOOD FIBER PANELS W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	BUILDING INSULATION (THERMAL) [M14]	ROLLED YELLOW FIBERGLASS W/BLACK PAPER BACKING.	1996 NWE	NONE DETECTED
_	BUILTUP ROOFING [M81]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 1.	1996 NWE	ASSUMED POSITIVE
<u> </u>	BUILTUP ROOFING [M82]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 2.	1996 NWE	ASSUMED POSITIVE
_	BUILTUP ROOFING [M83]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 3.	1996 NWE	ASSUMED POSITIVE
	DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	1996 NWE	NONE DETECTED
	DUCT INSULATION [M34]	8 IN DIA YELLOW FIBERGLASS W/GRAY VINYL JACKĘT.	1996 NWE	ASSUMED NEGATIVE
	DUCT INSULATION [M68]	6 IN DIA YELLOW FIBERGLASS W/GRAY VINYL JACKET FLEX DUCT.	1996 NWE	ASSUMED NEGATIVE

LEGEND:

IMMEDIATE - ABATE WITHIN 1 YEAR SHORT TERM - OBSERVE AND REINSPECT LONG TERM - O&M PROGRAM RECOMMENDED CONCEALED NOT ASSESSED

DISTRICT 11 OFFICE

Real Estate Services Division Asbestos Program Rev. 01/06/99

SIS Bidg #	Building Name		Survey	
Priority	Specification Name [M#]	Material Description	Date/Firm	ACM Status
	DUCT INSULATION [M69]	6 IN X 18 IN YELLOW FIBERGLASS W/SILVER FOIL JACKET FIRM DUCT.	1996 NWE	ASSUMED NEGATIVE
	EQUIPMENT INSULATION (HIGH TEMP) [M79]	YELLOW FIBERGLASS W/VINYL JACKET.	1996 NWE	ASSUMED NEGATIVE
O	FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	1996 NWE	NONE DETECTED
O	FINISH PLASTER [M31]	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.	1996 NWE	ASSUMED POSITIVE
-	FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, 1996 NWE PAINTED, SMOOTH.	1996 NWE	ASSUMED POSITIVE
O	FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	1996 NWE	ASSUMED POSITIVE
L, G	FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	1996 NWE	ASSUMED POSITIVE
O	FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	1996 NWE	ASSUMED POSITIVE
	FINISH PLASTER [M50]	LIGHT GRAY TROWELED-ON METAL LATH, LIGHT WEIGHT ROUGH FINISH W/OUT SCRATCH.	1996 NWE	NONE DETECTED
_	FINISH PLASTER [M59]	GRAY TROWELED-ON METAL LATH COARSE W/SCRATCH COAT STUCCO, PAINTED.	1996 NWE	ASSUMED POSITIVE
Ľ C	GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	1996 NWE	ASSUMED POSITIVE
_	GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	1996 NWE	ASSUMED POSITIVE
Ľ C	GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED.	1996 NWE	ASSUMED POSITIVE
_	GYPSUM WALLBOARD [M75]	4 FT X 8 FT SHEETS W/JOINT COMPOUND & TAPE, TEXTURED, PAINTED.	1996 NWE	ASSUMED POSITIVE
	LOOSE DEBRIS [M77]	BLACK ROOFING.	1996 NWE	NONE DETECTED
Ľ, C	OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	1996 NWE	ASSUMED POSITIVE

N U O K LEGEND:

IMMEDIATE - ABATE WITHIN 1 YEAR SHORT TERM - OBSERVE AND REINSPECT LONG TERM - O&M PROGRAM RECOMMENDED CONCEALED NOT ASSESSED

DISTRICT 11 OFFICE

Date: 06/08/99

Real Estate Services Division Asbestos Program Rev. 01/06/99

SIS Bidg #	Building Name		Survey	
Priority	Specification Name [M#]	Material Description	Date/Firm	ACM Status
7	OTHER SUSPECT MATERIALS [M30]	3 IN WHITE DUCT TAPE W/BEIGE SEALANT.	1996 NWE	ASSUMED POSITIVE
_	OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	1996 NWE	ASSUMED POSITIVE
S, L	OTHER SUSPECT MATERIALS [M65]	4 FT X 8 FT BROWN CORK PANEL W/WHITE CLOTH FACING & MASTIC.	1996 NWE	ASSUMED POSITIVE
_	OTHER SUSPECT MATERIALS [M67]	4 FT X 8 FT OFF-WHITE FIBERGLASS SHEET W/MASTIC.	1996 NWE	ASSUMED POSITIVE
_1	OTHER SUSPECT MATERIALS [M84]	ROLLED LIGHT BLUE CARPET W/BRITTLE YELLOW MASTIC.	1996 NWE	ASSUMED POSITIVE
l, L	PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	1996 NWE	POSITIVE
တ	PIPE FITTINGS (HIGH TEMP) [M33]	1/2 TO 4 IN DIA WHITE MUDDED W/CANVAS WRAP.	1996 NWE	ASSUMED POSITIVE
	PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	1996 NWE	POSITIVE
l, L	PIPE INSULATION (HIGH TEMP) [M9]	1 1/2 TO 2 IN DIA GRAY AIRCELL W/CANVAS WRAP.	1996 NWE	POSITIVE
_	PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	1996 NWE	POSITIVE
	PIPE INSULATION (HIGH TEMP) [M32]	1/2 TO 4 IN DIA YELLOW PREFORMED W/CANVAS WRAP.	1996 NWE	ASSUMED NEGATIVE
•	PIPE INSULATION (HIGH TEMP) [M66]	1/2 TO 1 1/2 DIA YELLOW PREFORMED FIBERGLASS W/CANVAS WRAP.	1996 NWE	ASSUMED NEGATIVE
_	PIPE INSULATION (LOW TEMP) [M2]	1 TO 3 IN DIA WHITE STYROFOAM W/CANVAS WRAP.	1996 NWE	POSITIVE
	PIPE INSULATION (LOW TEMP) [M3]	1 TO 4 IN DIA BROWN CORK W/BLACK FELT WRAP PAINTED GRAY.	1996 NWE	NONE DETECTED
_	RESILIENT FLOORING (SHEETS) [M16]	6 FT ROLLED GREEN MARBLE PATTERN LINOLEUM W/MASTIC.	1996 NWE	ASSUMED POSITIVE
L, C	RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
_	RESILIENT FLOORING (SHEETS) [M76]	6 FT ROLLED CREAM W/BROWN VINYL IN 4 IN X 4 IN PATTERN & MASTIC.	1996 NWE	ASSUMED POSITIVE
L, C	RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS &	1996 NWE	POSITIVE

LEGEND: CONTRACTOR CON

IMMEDIATE - ABATE WITHIN 1 YEAR SHORT TERM - OBSERVE AND REINSPECT LONG TERM - O&M PROGRAM RECOMMENDED CONCEALED NOT ASSESSED

Real Estate Services Division

Asbestos Program

Rev. 01/06/99

SIS E

Bldg #	Building Name		Survey	
Priority	Specification Name [M#]	Material Description	Date/Firm	ACM Status
		MASTIC.		
Ľ, C	RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	1996 NWE	POSITIVE
_	RESILIENT FLOORING (TILES) [M23]	12 IN X 12 IN BEIGE MOTTLED W/MASTIC.	1996 NWE	ASSUMED POSITIVE
J	RESILIENT FLOORING (TILES) [M35]	12 IN X 12 IN MAUVE MOTTLED W/MASTIC.	1996 NWE	ASSUMED POSITIVE
_1	RESILIENT FLOORING (TILES) [M36]	12 IN X 12 IN GREEN MOTTLED W/MASTIC.	1996 NWE	ASSUMED POSITIVE
Ľ, C	RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
	RESILIENT FLOORING (TILES) [M48]	12 IN X 12 IN CREAM W/BROWN & WHITE FLECKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
	RESILIENT FLOORING (TILES) [M53]	9 IN X 9 IN BEIGE W/GREEN STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
_	RESILIENT FLOORING (TILES) [M56]	12 IN X 12 IN DARK BEIGE MOTTLED W/MASTIC.	1996 NWE	ASSUMED POSITIVE
ပ	RESILIENT FLOORING (TILES) [M60]	12 IN X 12 IN CREAM W/OLIVE STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
_	RESILIENT FLOORING (TILES) [M70]	12 IN X 12 IN LIGHT GRAY W/GRAY & WHITE FLAKES & MASTIC.	1996 NWE	ASSUMED POSITIVE
	RESILIENT FLOORING (TILES) [M72]	2 FT X 2 FT BROWN FORMICA PANELS W/OFF WHITE FACING.	1996 NWE	ASSUMED NEGATIVE
_	RESILIENT FLOORING (TILES) [M80]	9 IN X 9 IN GREEN W/WHITE & BLACK STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
-4	WALL BASE [M21]	4 IN CARAMEL VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
_	WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
_	WALL BASE [M27]	4 IN CREAM VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M37]	6 IN CARAMEL VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
١	WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
٦	WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M51]	3 IN CARAMEL VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
•				

_ o _ o _ LEGEND:

IMMEDIATE - ABATE WITHIN 1 YEAR SHORT TERM - OBSERVE AND REINSPECT LONG TERM - O&M PROGRAM RECOMMENDED CONCEALED NOT ASSESSED

DISTRICT 11 OFFICE

Page:

ASSUMED POSITIVE ASSUMED POSITIVE

1996 NWE 1996 NWE

6 IN BROWN VINYL W/MASTIC. 4 IN BLUE VINYL W/MASTIC.

WALL BASE [M55] WALL BASE [M57]

DISTRICT 11 OFFICE

IMMEDIATE - ABATE WITHIN 1 YEAR SHORT TERM - OBSERVE AND REINSPECT LONG TERM - O&M PROGRAM RECOMMENDED CONCEALED NOT ASSESSED

LEGEND:

Homogeneous Material Summary Report

Date: 06/08/99

Real Estate Services Division Asbestos Program Rev. 01/06/99

# SIS BIdg	Building Name		Survey	
Priority	Specification Name [M#]	Material Description	Date/Firm	ACM Status
1	WALL BASE [M58]	6 IN LIGHT GRAY VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
_	WALL BASE [M61]	4 IN MOSS GREEN VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
7	WALL BASE [M62]	6 IN MOSS GREEN VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M63]	6 IN BEIGE VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M74]	4 IN MAUVE VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
3619	MOTOR POOL			
Ø	ACOUSTICAL (PANELS) [M4]	2 FT X 4 FT WHITE W/FISSURE & SMALL PERFORATIONS.	1996 NWE	ASSUMED POSITIVE
	BUILDING INSULATION (THERMAL) [M7]	2 FT ROLLED YELLOW FIBERGLASS W/FOIL FACING.	1996 NWE	ASSUMED NEGATIVE
_	BUILTUP ROOFING [M13]	INSULATION, FELT, TAR & GRAVEL.	1996 NWE	ASSUMED POSITIVE
	DUCT INSULATION [M12]	YELLOW FIBERGLASS W/VINYL JACKET.	1996 NWE	ASSUMED NEGATIVE
.	FINISH PLASTER [M5]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, 1996 NWE COARSE, PAINTED.	1996 NWE	ASSUMED POSITIVE
-	FINISH PLASTER [M11]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, 1996 NWE ADOBE FINISH, PAINTED.	1996 NWE	ASSUMED POSITIVE
	GYPSUM WALLBOARD [M1]	4 FT X 8 FT SHEETS W/JOINT COMPOUND & TAPE, TEXTURED, PAINTED.	1996 NWE	ASSUMED POSITIVE
	GYPSUM WALLBOARD [M10]	4 FT X 8 FT SHEETS W/JOINT COMPOUND & TAPE.	1996 NWE	ASSUMED POSITIVE
_	RESILIENT FLOORING (TILES) [M2]	12 IN X 12 IN TAN MOTTLED W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	RESILIENT FLOORING (TILES) [M6]	12 IN X 12 IN BEIGE W/CREAM & BROWN STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
_	RESILIENT FLOORING (TILES) [M9]	12 IN X 12 IN CREAM W/BEIGE STREAKS & MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M3]	6 IN BROWN VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
	WALL BASE [M8]	4 IN BLACK VINYL W/MASTIC.	1996 NWE	ASSUMED POSITIVE
3620	ARCHEOLOGIST BLDG			

Facility: DISTRICT 11 OFFICE Facility Contact: VICTOR NAVA

During an asbestos reinspection Northwest Envirocon, Inc. (NWE) recorded a total of two Immediate assessments. A list of Immediate findings follows:

DSA 3617 DISTRICT OFFICE COMPLEX:

Material 6 (PIPE FITTING (HIGH TEMP)) in R-228 (BLDG. 3, PIPECHASE 6).

Material 9 (PIPE INSULATION (HIGH TEMP)) in R-74 (BLDG. 1, PIPECHASE 1).

Field Immediate conditions recorded for pipe insulation and pipe fittings, by NWE represent damage to materials which could result in episodic asbestos fiber release. These conditions would not achieve an Immediate status as determined through the use of the algorithm scores required by the Division of the State Architect, Asbestos Survey Procedures Manual. The immediate conditions for the pipe insulation and pipe fittings appear to be the result of previous maintenance activity in the area.

WO: BDH 9601 JUNE 1999 Page 1

Facility:

DISTRICT 11 OFFICE

Facility Contact: (N/A)

The Department of Transportation building surveys indicate no critical areas that require immediate or short-term abatement. There are areas where long-term abatement is necessary. The surveys generally indicate that most areas are in good condition, and suggest that abatement should not be necessary for many years. No buildings were inaccessible and there were no inaccessible areas or rooms within the building.

No Immediate hazard conditions were observed in the Department of Transportation buildings during the survey.

Facility: DISTRICT 11 OFFICE

Facility Contact: (N/A)

This report presents and discusses the results of an asbestos-containing materials (ACM) survey for the State of California, Department of Transportation (DOT). ACMs are present in the majority of the surveyed buildings in District 11. The majority of the ACMs were in generally good condition on the day of the survey and should pose little exposure potential to airborne asbestos fibers during normal building activity unless the materials are damaged or disturbed. There were limited areas of damage and/or deterioration of the ACM insulations observed throughout the surveyed buildings. These areas should be repaired and receive periodic follow-up evaluations as specified by the Operations and Maintenance Plan (OMP).

No asbestos was detected in samples collected in the following Buildings.

OSA#

Building Name

3620

Archeologist building

Recommendations

District Office Bldg: Osanum 3617

The asbestos-containing piping insulation in the 1958 portion of the District 11 Office Building (second floor) is in fair condition and has contaminated the ceiling batting. This material should receive prompt attention.

In the 1966 portion of the building, asbestos-containing spray-applied fireproofing is present on the structural elements (metal deck, steel and concrete) of the second floor. There is extensive over spray on walls, HVAC ducts, and piping. Loose asbestos-containing fireproofing material was observed on suspended ceiling tiles and HVAC ducts. The asbestos-containing spray-applied fireproofing should be removed in an expeditious manner.

Facility: DISTRICT 11 OFFICE Facility Contact: VICTOR NAVA

Upon review of all information collected, Northwest Envirocon, Inc. (NWE) recommends the following abatement alternatives for the facility.

Immediate Conditions:

NWE recommends spot removal or repair of the damaged Thermal System Insulation in the following Building:

DSA 3617 DISTRICT OFFICE

The major portion of these materials were in good condition and they would have been assigned a long term priority were it not for this damage. Either of the two options, spot removal or repair, would be more cost effective than full scale abatement of the materials.

WO: BDH 9601 JUNE 1999 Page 1

Facility: DISTRICT 11 OFFICE

Abatement Options:

The surveys generally indicate that most areas are in good condition, and suggest that abatement should not be necessary for many years. The recommended abatement options are Long Term removal with the implementation of an Operations and Maintenance plan (O&M).

ACM in most of the DOT buildings contained only non-friable floor tile, gypsum board, or transite pipe. These are Long Term abatement actions. An Operations and Maintenance Plan (OMP) should be implemented and properly trained maintenance personnel should become aware of the areas noted in the Presentation of Survey Findings.

No Immediate hazard conditions were observed in the Department of Transportation buildings during the survey.

The OMP should be implemented with regard to all ACBM until removal of the material has been initiated.

Facility: DISTRICT 11 OFFICE

Recommendations for the surveyed buildings are based upon the algorithm assessment factors for the asbestos survey provided by the Office of the State Architect. These factors assume a relationship between airborne asbestos fiber levels and the condition of the asbestos-containing materials (ACM). In general, the higher the algorithm value, the greater the potential for building occupant exposure to airborne asbestos fibers.

Implementation of the O&M Plan is recommended for all buildings of District 11 which have asbestos-containing materials. These O&M procedures are designed to minimize the risk of exposing District 11 employees, contractors and other building occupants to asbestos fibers released from asbestos-containing materials during normal building activity, maintenance, demolition and renovation. In general, asbestos-containing materials should be removed prior to renovation, demolition or other physical disturbances and replaced, as necessary, with non-asbestos-containing materials. The O&M Plan should remain in effect on an area-by-area basis until removal of all asbestos-containing materials is completed. The condition, accessibility and location of ACM in the surveyed buildings were evaluated to determine the appropriate management alternative(s).

Recommendations


It is recommended that the limited damage and deterioration on asbestos-containing piping and mechanical equipment insulation be repaired as soon as feasible within the guidelines of the OMP. These repairs would be an interim control measure until the materials are removed.

District 11 Office Bldg: Osanum 3617

Remove the asbestos-containing spray-applied fireproofing from the Second Floor 1966 portion of the District 11 Office Building. Replace all materials removed with a non-asbestos-containing material as required.


Repair or remove damaged piping insulation in the Second Floor 1958 portion of the District 11 Office Building including the contaminated batting.

In occupied areas where ACMs are exposed to building occupants, these materials should be routinely inspected and as conditions warrant (e.g., physical/water damage, deterioration) should be repaired or removed and replaced with a suitable non-asbestos substitute. Due to the non-homogenous nature of floor tiles, additional sampling should be done when maintenance, renovation or demolition work is to occur in areas where floor tile has previously been determined to contain no asbestos.

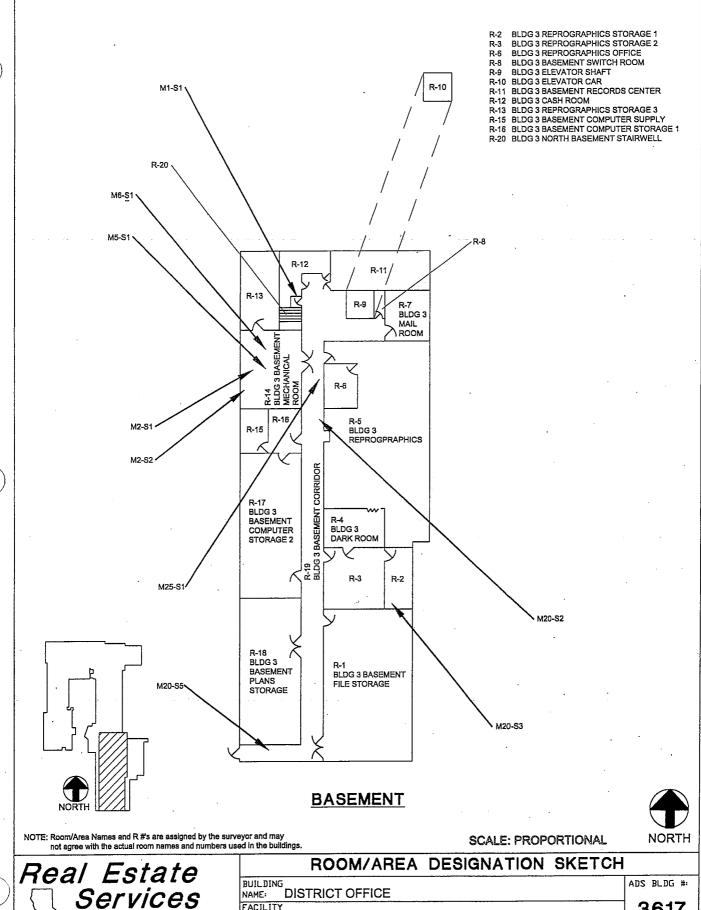

DISTRICT OFFICE NAME: FACILITY 3617 NAME: **DISTRICT 11 OFFICE** SHEET NO: CHECKED: DATE CODE: NWE CODE: **CEB** 05-30-97 GMI

Division

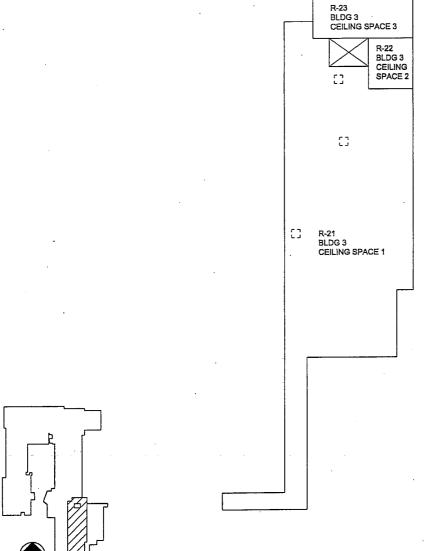



[] = CEILING SPACE ACCESS




NOTE: Room/Area Names and R #s are assigned by the surveyor and may not agree with the actual room names and numbers used in the buildings.


SCALE: PROPORTIONAL

NORTH


Real Estate Services Division

	ROOM/ARI	EA DESIG	NATION	SKETCH	
BUILDING NAME: DIST	RICT OFFICE				ADS BLDG #:
FACILITY NAME: -DISTI	3617				
DRAWN:	DATE:	CHECKED:	FIRM	DEPT	SHEET-NO:
CEB	05-30-97	GML	CODE: NME	CODE: DOT	2 of 21

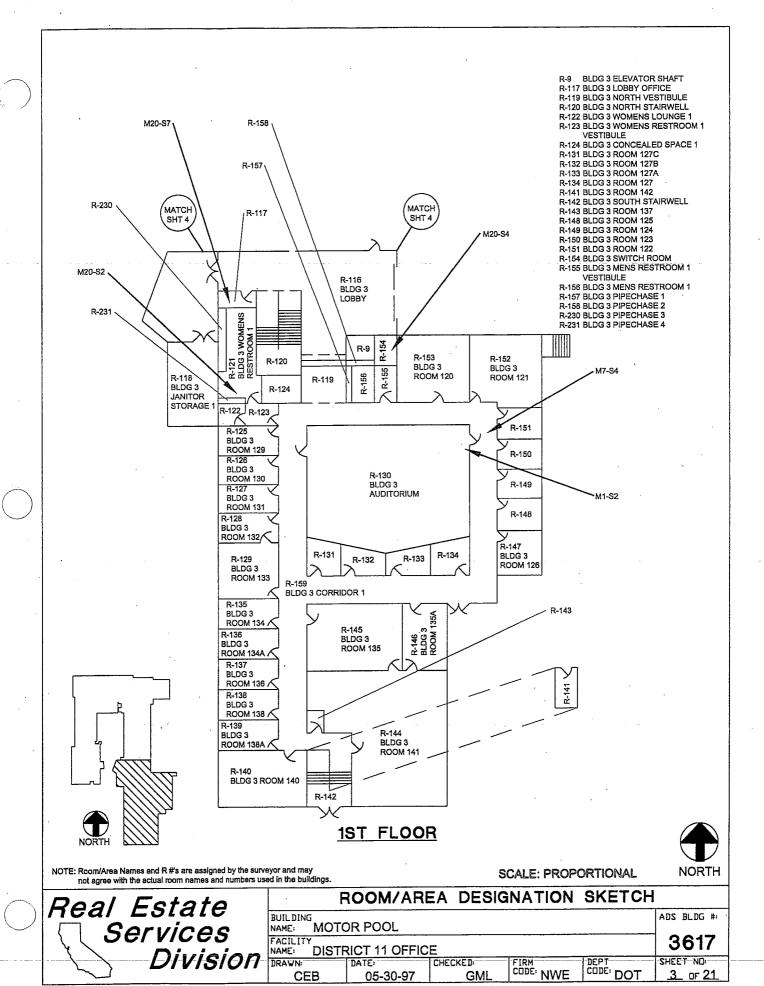

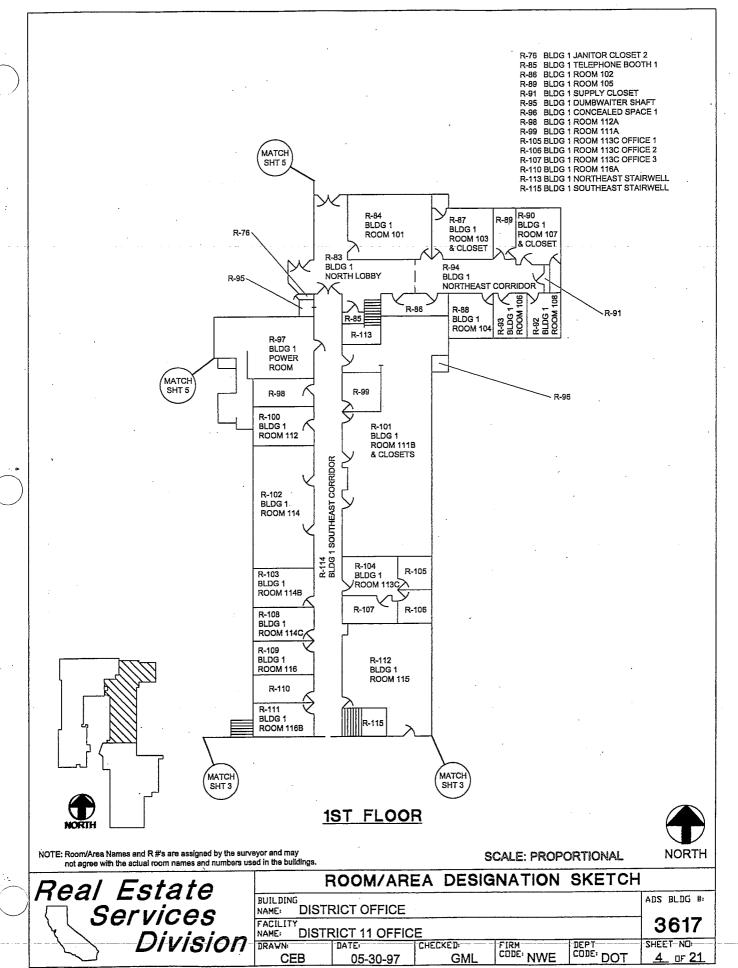

R-51 BLDG 1 ROOM 176
R-54 BLDG 1 ROOM 188
R-57 BLDG 1 NORTHWEST STAIRWELL
R-58 BLDG 1 NORTHWEST STAIRWELL SWITCH ROOM
R-70 BLDG 1 MENS RESTROOM 1
R-71 BLDG 1 MENS RESTROOM 1 STORAGE
R-72 BLDG 1 MENS RESTROOM 1 VESTIBULE
R-78 BLDG 1 JANITOR CLOSET 1
R-74 BLDG 1 PIPECHASE 1
R-75 BLDG 1 JANITOR CLOSET 2
R-77 BLDG 1 WOMENS LOUNGE 1
R-78 BLDG 1 WOMENS RESTROOM 1
R-79 BLDG 1 WOMENS RESTROOM 1

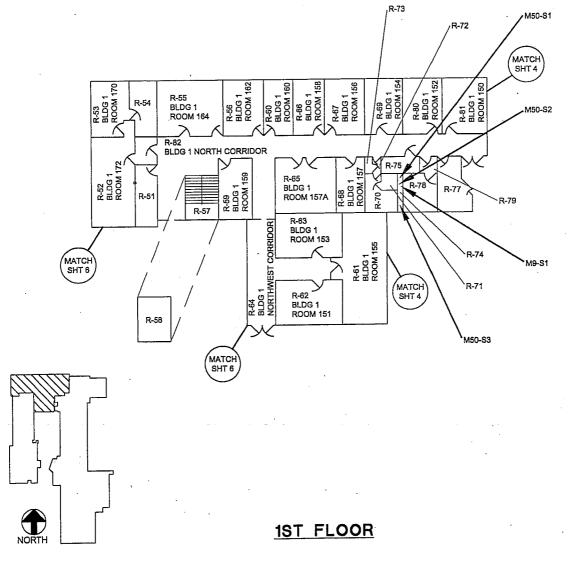


NOTE: Room/Area Names and R #s are assigned by the surveyor and may not agree with the actual room names and numbers used in the buildings.


SCALE: PROPORTIONAL

NORTH

Real Estate
Services
Division


ROOM/AREA DESIGNATION SKETCH							
BUILDING NAME: DISTE	RICT OFFICE	· · · · · · · · · · · · · · · · · · ·			ADS BLDG #:		
FACILITY NAME: DISTE	RICT 11 OFFIC	E	-		3617		
DRAWN:	DATE	CHECKED:	FIRM	DEPT	SHEET_NO:		
CEB	05-30-97	GML_	CODE: NWE	CODE: DOT	<u>5</u> or 21		

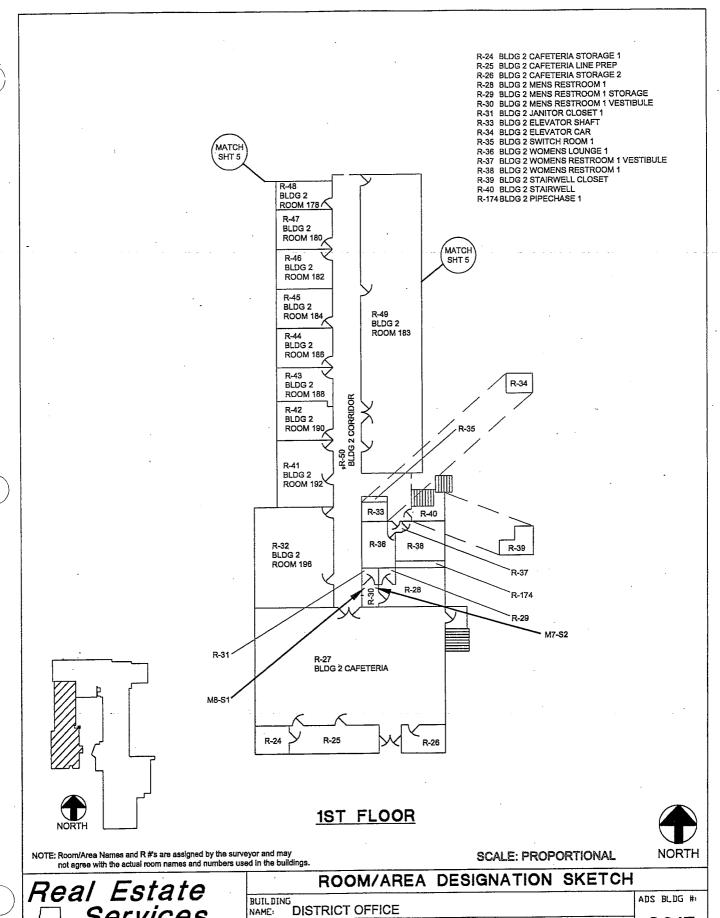

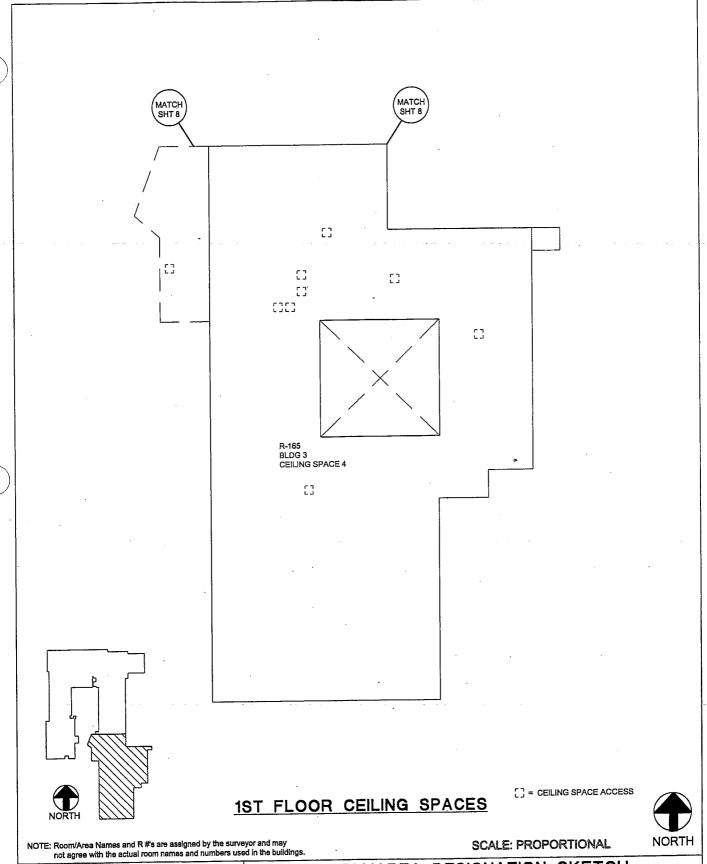


Real Estate Services Division

	F	ROOM/AR	EA DESI	SNA HON	SKEICE	1
- 1	BUILDING NAME: DISTE	RICT OFFICE				ADS BLDG #:
	FACILITY NAME: DISTE	RICT 11 OFFIC	Œ			3617
_	DRAWN:	DATE:	CHECKED:	FIRM	DEPT	SHEET NO:
	CEB	05-30-97	<u>GML</u>	CODE, NME	CODE: DOT	7 of 21

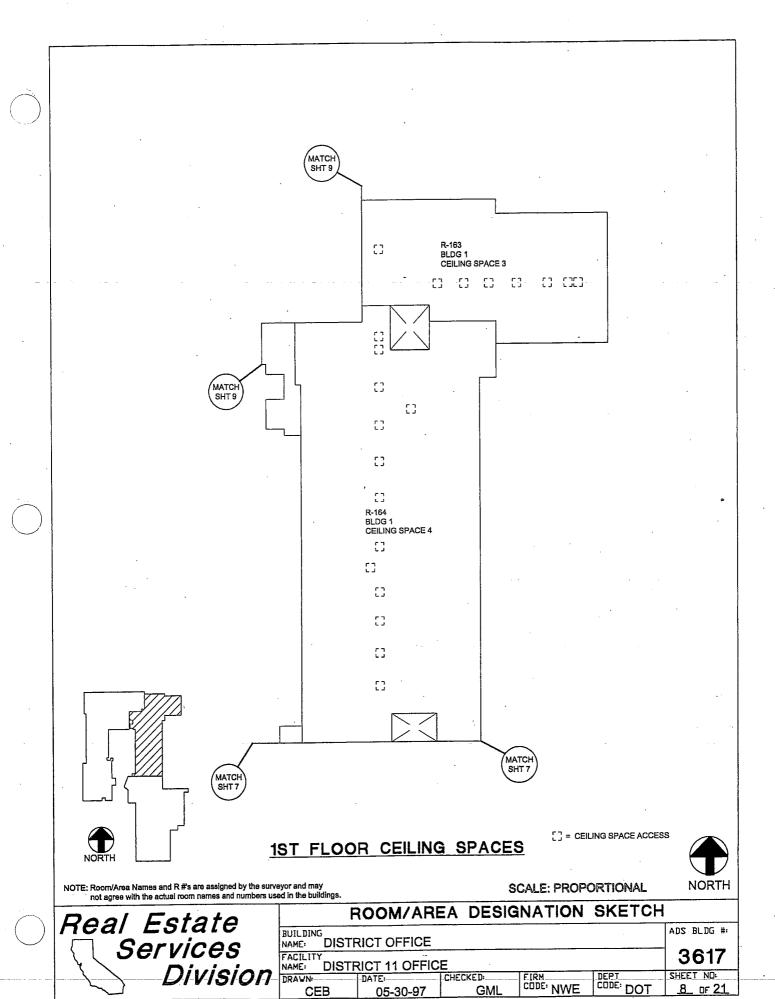

Rev. 07/01/99

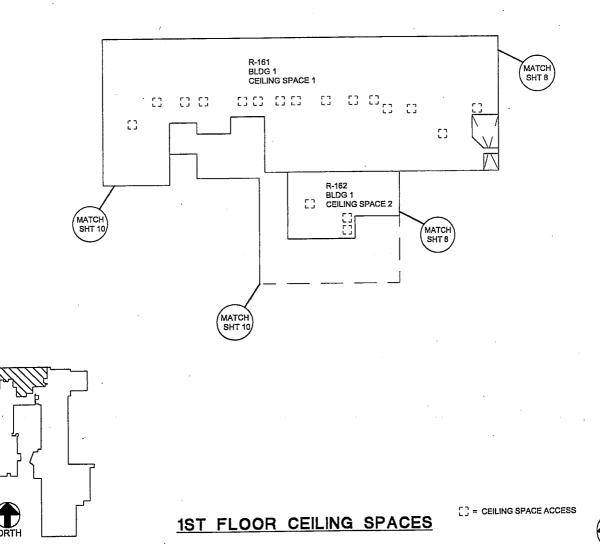

BUILDING NAME: DISTRICT OFFICE

DISTRICT 11 OFFICE

05-30-97

NAME: FACILITY NAME: DRAWN:

CEB

NOTE: Room/Area Names and R #s are assigned by the surveyor and may not agree with the actual room names and numbers used in the buildings.

Division

Real Estate

Rev. 07/01/99

NORTH

ADS BLDG #:

3617


SCALE: PROPORTIONAL

DEPT. CODE: DOT

FIRM NWE

ROOM/AREA DESIGNATION SKETCH

GML

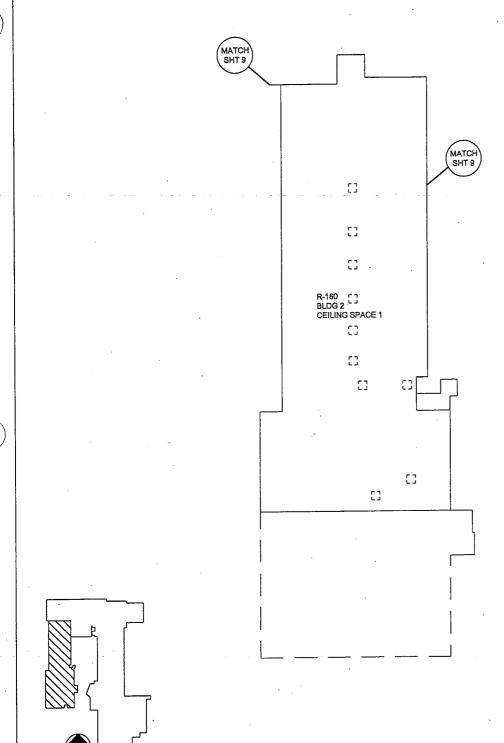

1ST FLOOR CEILING SPACES

[] = CEILING SPACE ACCESS





NOTE: Room/Area Names and R #s are assigned by the surveyor and may not agree with the actual room names and numbers used in the buildings.

SCALE: PROPORTIONAL


Real Estate Services Division

ROOM/AREA DESIGNATION SKETCH							
BUILDING	RICT OFFICE	****			ADS BLDG #:		
	KICT OFFICE				2617		
FACILITY NAME: DIST	3617						
DRAWN:	DATE:	CHECKED:	FIRM	DEPT	SHEET NO:		
CEB	05-30-97	GML	CODE: NWE	CODE: DOT	10 of 21		

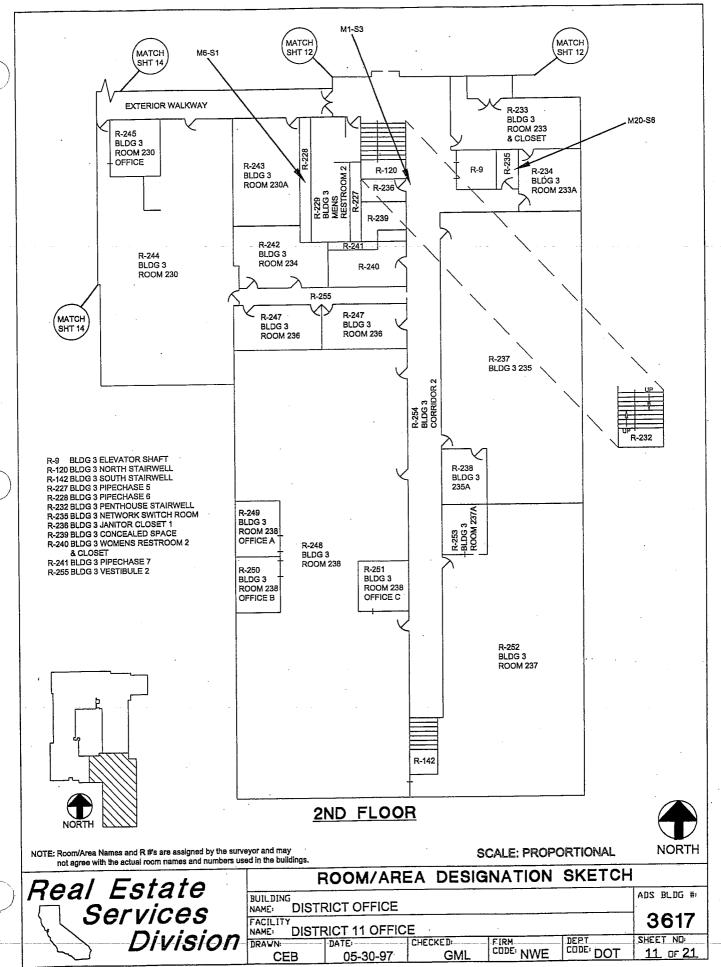

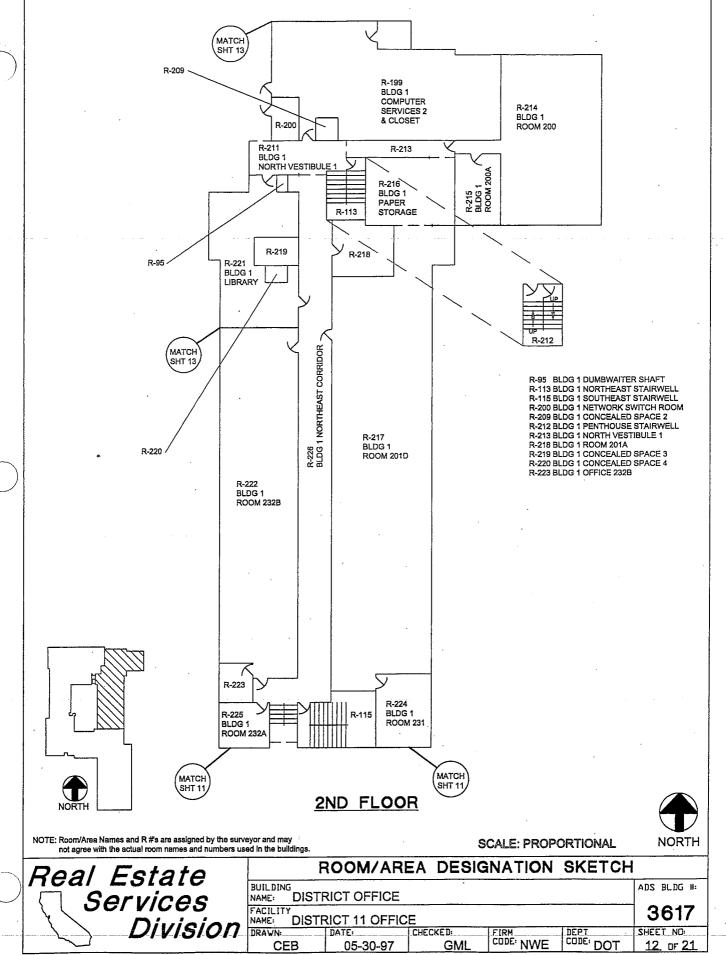

R-57 BLDG 1 NORTHWEST STAIRWELL
R-192 BLDG 2 NORTH VESTIBULE
R-201 BLDG 1 COMPUTER SERVICES STORAGE
R-204 BLDG 1 WOMENS RESTROOM 2
R-205 BLDG 1 VERTICAL DUCT CHASE
R-206 BLDG 1 JANITOR CLOSET 3
R-207 BLDG 1 PIPECHASE 2
R-210 BLDG 1 NORTH CORRIDOR 2

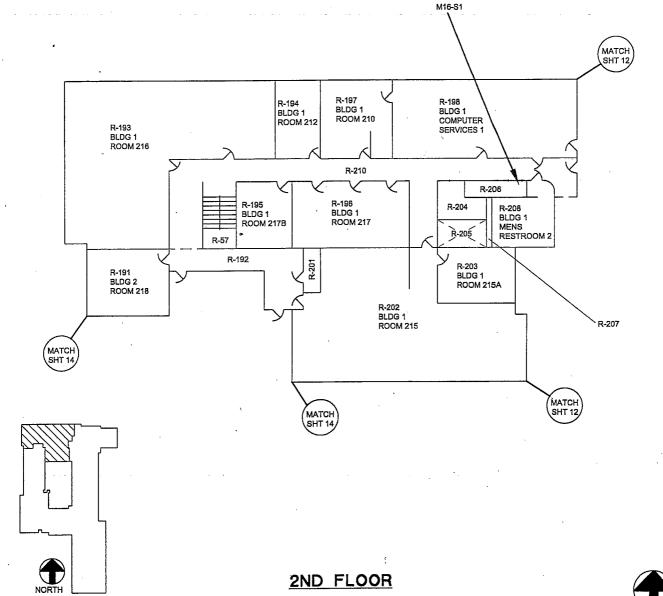


SCALE: PROPORTIONAL

NORTH

Real Estate Services Division

NOTE: Room/Area Names and R #s are assigned by the surveyor and may not agree with the actual room names and numbers used in the buildings.

	F	ROOM/ARE	EA DESIG	NATION	SKETCH	
	BUILDING NAME: DISTE	RICT OFFICE	,			ADS BLDG #:
FACILITY NAME: DISTRICT 11 OFFICE						3617
_	DRAWN:	DATE:	CHECKED:	FIRM	DEPT	SHEET_NO:
	CEB	05-30-97	GML	CODE: NWE	CODE: DOT	13 or 21

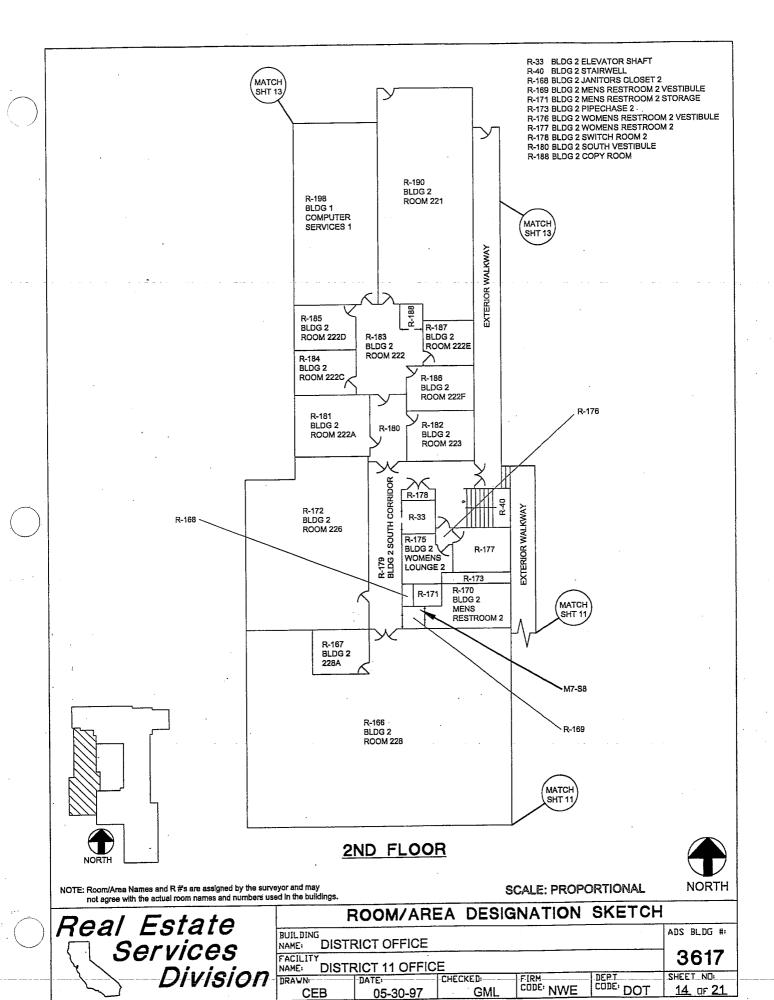


CEB

05-30-97


GMI


Rev. 07/01/99

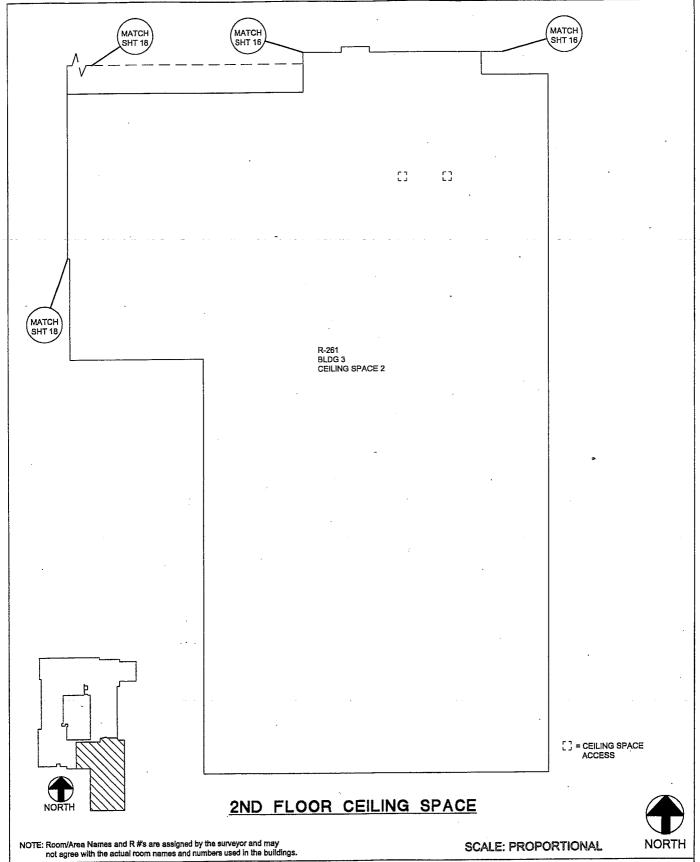

Real Estate Division

R	OOM/ARE	EA DESIG	INATION	SKETCH	
BUILDING NAME: DISTR	ICT OFFICE				ADS BLDG #:
FACILITY	ICT 11 OFFIC	 			3617
1	DATE:-	CHECKED:	FIRM CODE: NWE	DEPT CODE: DOT	SHEET NO: 15 OF 21
CEB	05-30-97	GML	INVVE	001	12 11 61.

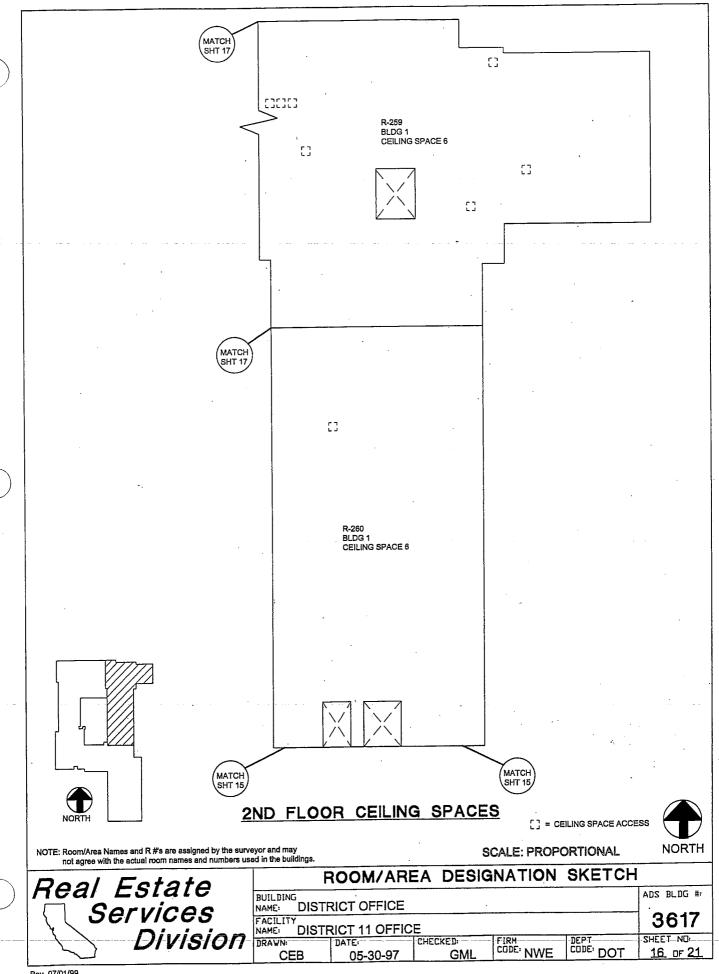

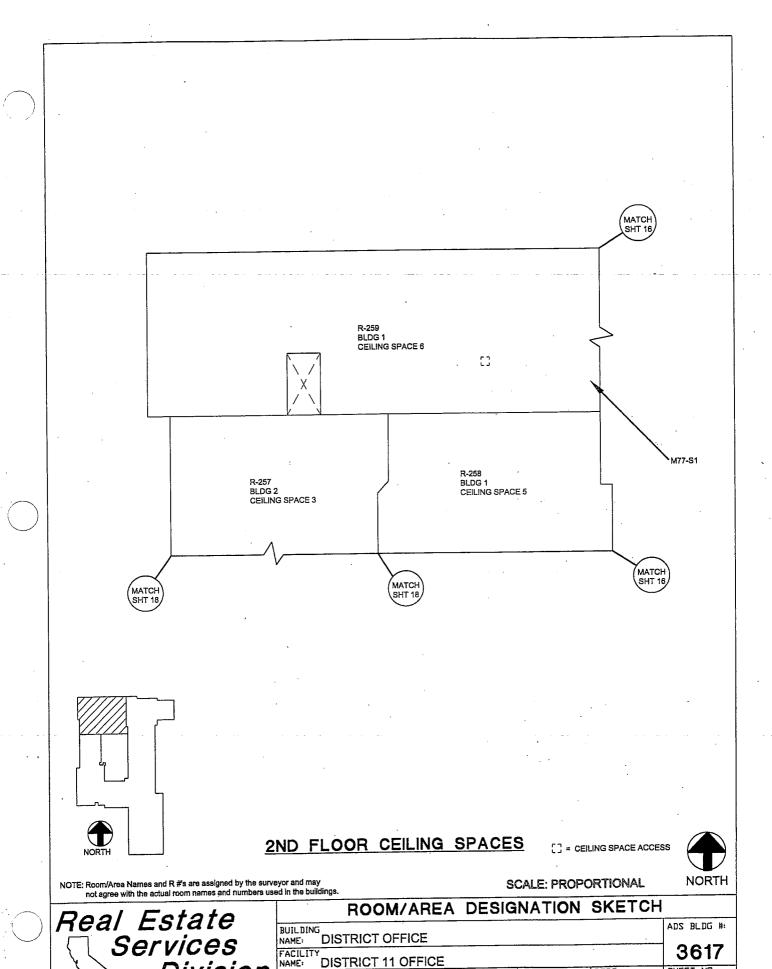

FIRM CODE: NWE

CHECKED:

05-30-97

GML

DEPT DOT


SHEET NO:


17 of 21


Division


DRAWN:

CEB

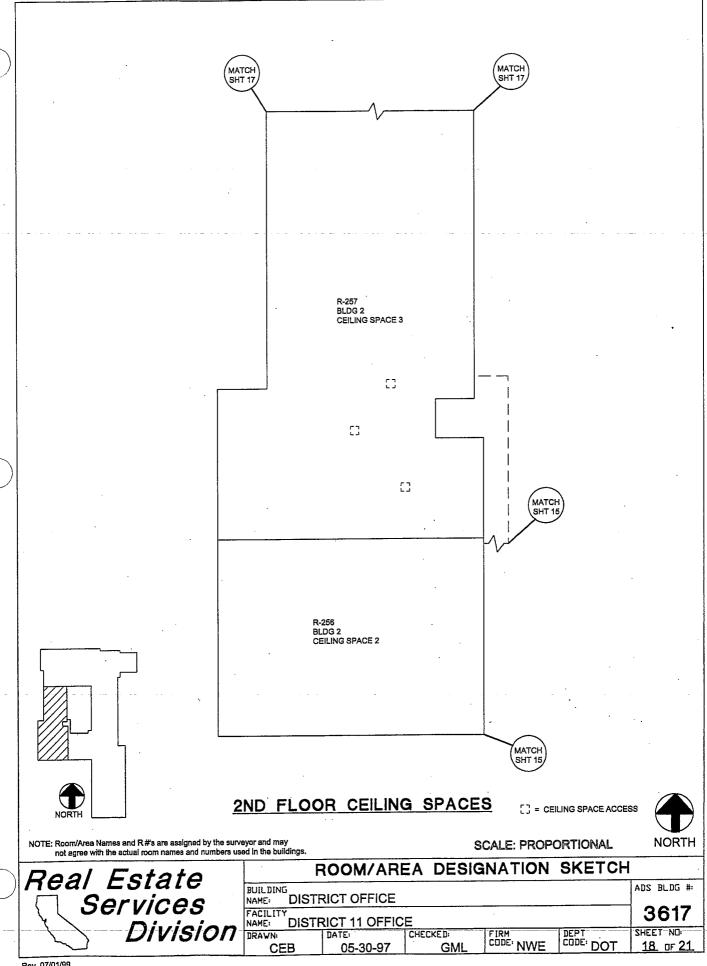

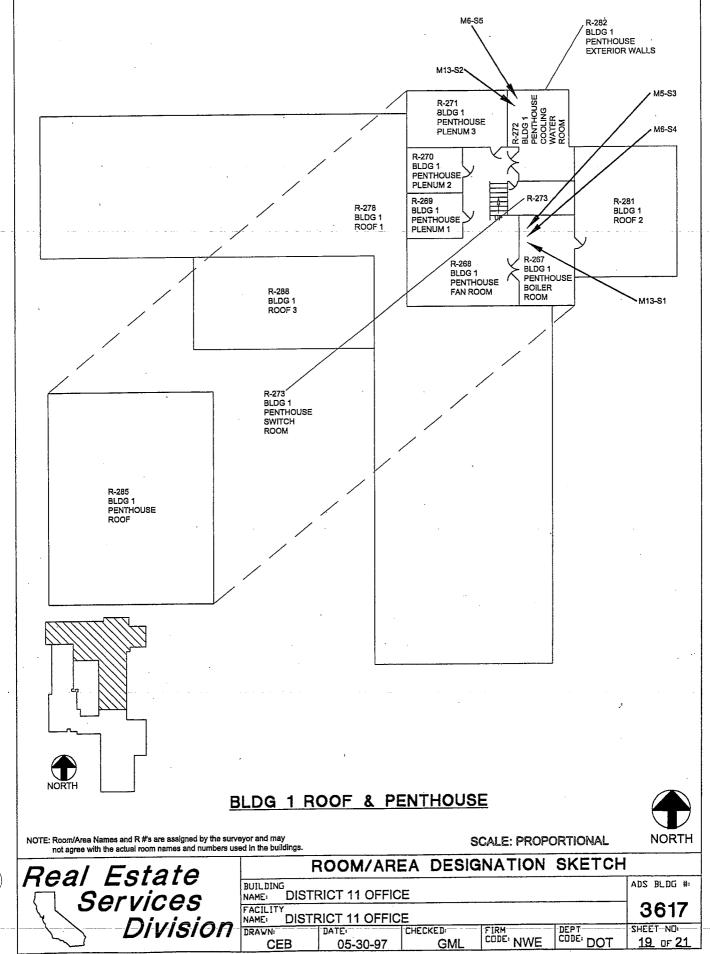

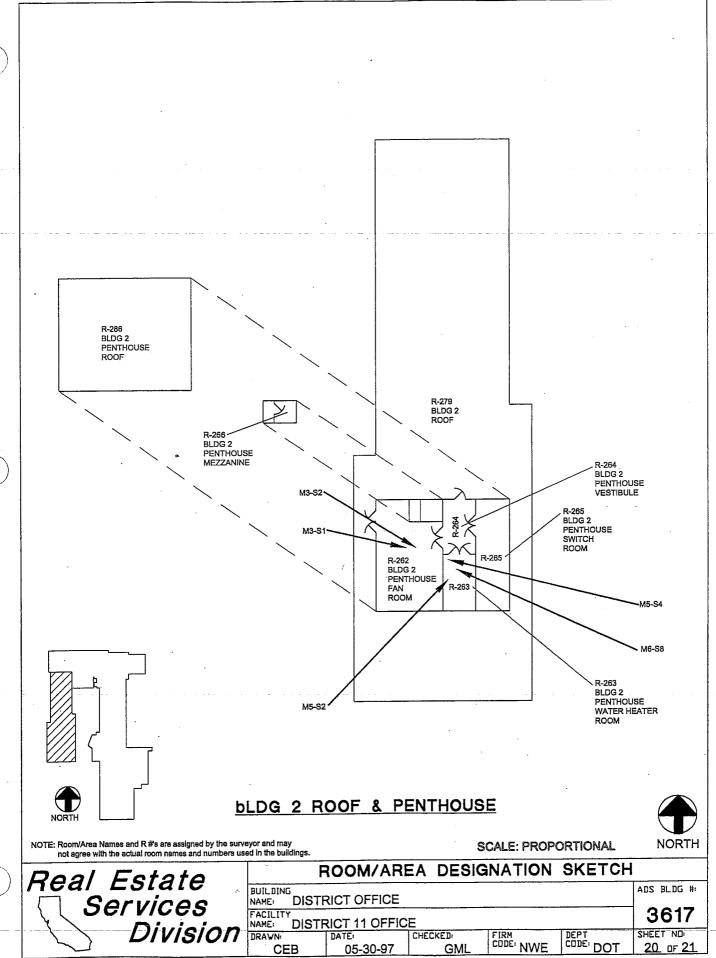

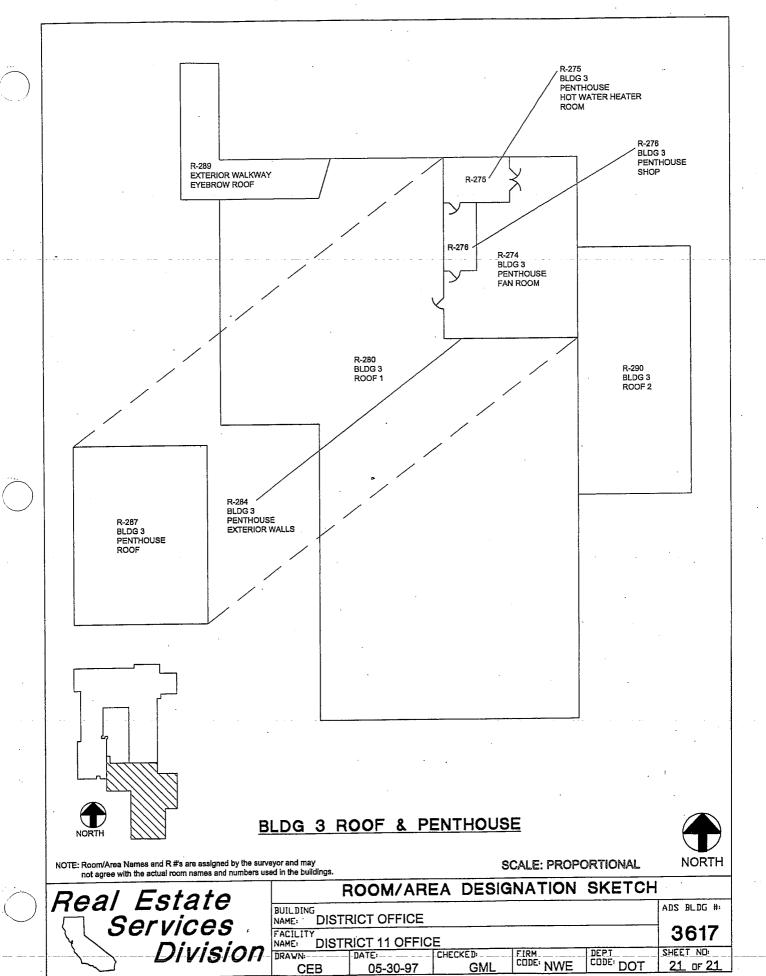

vision		
Real Estate Services Divisio	Asbestos Program	Rev. 07/30/98

Room/Area Assessment Report

DOT 66/80/90 Dept:

Date:

Hev. U//30/98			_		
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City SAN DIEGO	ZID County 92110 SAN DIEGO	
	The state of the s				
Room/Area Name [R#]	Room Notes	ACM Location/Notes	Survey Bate/Firm	Est. n Qty. Units Priority	ACM Status

ACM Location/Notes

Material Description

Material Specification Name [M #]

	9/1996 23 SY L ASSUMED POS.	9/1996 80 SY L ASSUMED POS. NWE	
	GRAY TROWELED-ON METAL LATH N & E WALLS & CEILING. W/SCRATCH COAT, PAINTED, INSTALLED IN BUILDING 2 ONLY. SMOOTH. CONTAIN ASBESTOS.	GRAY TROWELED-ON METAL LATH N, W & E WALLS & CEILING. W/SCRATCH COAT, PAINTED, INSTALLED IN BUILDING 2 ONLY. SMOOTH. CONTAIN ASBESTOS.	
BUILDING 2, CAFETERIA STORAGE 1 [R24]	FINISH PLASTER [M39]	BUILDING 2, CAFETERIA LINE PREP [R25] FINISH PLASTER [M39]	BUILDING 2, CAFETERIA STORAGE 2 [R26]

Page:

1ST FLOOR

Room/Area Assessment Report

ReportDept:DOTDate:06/08/99

SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JU	Address. 2829 JUAN ST SAN DIEGO	92110	COUNTY 10 SAN DIEGO	09
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Est. Date/Firm Qty.	Est. Qty. Units Priority	ACM ty Status
BUILDING 2, CAFETERIA [R27]					
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 3072 NWE	3072 SF S /	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	4 S WALL. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 120 NWE	120 SY L /	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	H, CEILING. INSTALLED IN BUILDING 2 ONLY, CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 34 NWE	341 SY C /	ASSUMED POS.
RESILIENT FLOORING (TILES) [M23]	12 IN X 12 IN BEIGE MOTTLED W/MASTIC.	E & W 1/3 OF FLOOR, PORTIONS OF CENTER 1/3 OF FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 47: NWE	472 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M35]	12 IN X 12 IN MAUVE MOTTLED W/MASTIC.	PORTION OF CENTER 1/3 OF FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 47 NWE	472 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M36]	12 IN X 12 IN GREEN MOTTLED W/MASTIC.	TRIM OF CENTER 1/3 OF.FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 21 NWE	216 SF L	ASSUMED POS.
WALL BASE [M37]	6 IN CARAMEL VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	269 LF L	ASSUMED POS.
-					

Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

Page: 2

SIS Bldg #: 3617

1ST FLOOR

						,
Real Estate Services Division Asbestos Program	Room/Area Asses	Area Assessment Report			Dept:	DOT
Rev. 07/30/98					Date:	66/00/00
SIS Bldg # Building Name	<u>Facility</u> Address	SS City		Zip	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 2829	2829 JUAN ST SAN DIEGO		92110 S	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM Status
BUILDING 2, MENS RESTROOM 1 [R28]						
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	51 SY	L ASS	ASSUMED POS.
BUILDING 2, MENS RESTROOM 1 STORAGE [R29]	= [R29]					
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	WALLS & CEILING, INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	1 9/1996 F NWE	26 SY	L ASS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	24 LF	L ASS	ASSUMED POS.
BUILDING 2, MENS RESTROOM 1 VESTIBULE [R30]	LE [R30]	•				
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING, TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	36 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	N & E WALLS. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	11 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF	G 9/1996 NWE	4 SY	C ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	roved, See the or a listing of suspect verification.		1ST FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98

Room/Area Assessment Report

Dept:

DOT 66/80/90 Date:

SIS Blda # Building Name	Facility	Address	Oit			Zip C	County	
	DISTRICT 11 OFFICE	2829 JUAN ST		EGO		10	SAN DIEGO	90
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	4	ACM Location/Notes	S	Survey Date/Firm	Est. Oty. Units Priority	Priorit	ACM y Status
			THIS TYPE MAY CONTAIN ASBESTOS.					,
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.		FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.		9/1996 NWE	36 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	TIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.		9/1996 NWE	24 LF	_	ASSUMED POS.
BUILDING 2, JANITOR CLOSET 1 [R31]								
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	ETAL LATH TED,	N, S & E WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	<u>.</u>	9/1996 NWE	17 SY	٦,	ASSUMED POS.
BUILDING 2, ROOM 196 [R32]								
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	COARSE	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.		9/1996 NWE	1080 SF	S	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	O-ON METAL LATH, SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.		9/1996 NWE	120 SY	O	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	WDARK	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.		9/1996 NWE	1080 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	STIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE, MASTIC		9/1996 NWE	132 LF	_	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect	is removed. See the port for a listing of suspect				! (!		Č	1 0 0

SIS BIdg #: 3617

1ST FLOOR

Page:

materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98
--

DOT 66/80/90 Dept: Date:

\$1S Bldg # 3617	SIS Bldg # Building Name_ 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address. 2829 JUAN ST	City SAN DIEGO		Zip County 92110 SAN DIEGO		
Room/Area Material S	Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes		Survey Date/Firm	Est. ACM Qty. Units Priority Status	ACM Status	
			ASSUMED POSITIVE.					
BUILDING 2,	BUILDING 2, ELEVATOR SHAFT [R33]	NO SUSPECT MAT	NO SUSPECT MATERIALS OBSERVED IN ROOM.					

BUILDING 2, ELEVATOR CAR [R34]	
ING 2, ELEV	34]
ING 2, ELEV	R IR
ING 2, ELEV	B CA
ING 2,	VATC
BUILDING 2	, ELE
BUILD	NG 2
m	□ ΩIΓΩ
	æ

RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	40 SF	_	POSITIVE
BUILDING 2, SWITCH ROOM 1 [R35]						
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	27 SF	_	POSITIVE
BUILDING 2, WOMENS LOUNGE 1 [R36]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	131 SF	တ	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	N & S WALLS. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	24 SY	_	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	14 SY	O	ASSUMED POS.

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. NOTE:

Page: 5

SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98

Room/Area Assessment Report

Dept: **DOT**Date: 06/08/99

Nev. 07/30/30						
SIS Bldg # Building Name	Facility Ad	Address City		oo diz	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 28	2829 JUAN ST SAN DIEGO		92110 SA	SAN DIEGO	0,5
,						
Room/Area Name [R#]	Room Notes		Survey	Est.		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	Priority	0,
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	131 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	43 LF	L A	ASSUMED POS.
BUILDING 2, WOMENS RESTROOM 1 VESTIBULE [R37]	TIBULE [R37]					
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	E CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	20 SF	S	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	TH S WALL. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 : NWE	4 SY	- i	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	ATH, CEILING. INSTALLED IN BUILDING AT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	284	O	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	20 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	18 LF	L	ASSUMED POS.

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Estate Services Division	sbestos Program	1/30/98
Real Estate	Asbestos Pr	Hev. 07/30/98

DOT 66/80/90 Dept: Date:

Zip County 92110 SAN DIEGO City SAN DIEGO **2829 JUAN ST** Address DISTRICT 11 OFFICE Facility DISTRICT OFFICE **Building Name** SIS BIdg # 3617

Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Survey Est. Date/Firm Qty. Units Priority	ACM Status
BUILDING 2, WOMENS RESTROOM 1 [R38]					
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH WALLS & CEILING. INSTALLED IN WYSCRATCH COAT, PAINTED, BUILDING 2 ONLY. MATERIALS OF SMOOTH. ASBESTOS.	WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	43 SY L AS	ASSUMED POS.
BIJILDING 2. STAIBWELL CLOSET 18391	NO SUSPECT MATERIALS OBSERVED IN ROOM	DBSERVED IN ROOM.			

Ë	
Ó	
N ROO	
Z	
Ē	
2	
SE	
OB	
Ś	
Z	
SUSPECT MATERIALS OF	
F	
Ž	
5	
Ä	
S	
S	
S 1ST OR 2ND FLOOR. NO SI	
α̈́	
8	
Ī	
Ω	
র	
OR	
Ë	
7	
ဗ္ဗ	
M	
Ž	
NO LAND	
9	

7
H4
92
Ë
ō
E
ผู้
Ž
2
BC

BUILDING 2, STAIRWELL [R40]

1 FT X 1 FT WHITE VERY COARSE CEILING. TILES SAMPLED ND. FISSURE, W/MASTIC. GRAY TROWEI FD. ON METAL LATH CEILING INSTALLED IN BUILDING		
<u> </u>	SMOOTH, W/OUT SCRATCH COAT.	SMOOTH, W/OUT SCRATC
\exists	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED	4 FT X 8 FT SHEETS W/TA

	Data audited and substandard records removed. See the
NOTE:	NOTE: Homogeneous Material Summary Report for a listing of suspect
	materials observed. Data requires periodic verification

Page:

SIS BIdg #: 3617

1ST FLOOR

POSITIVE

480 SF

9/1996

FLOOR. TILE SAMPLED POSITIVE.

9 IN X 9 IN LIGHT GRAY W/DARK

RESILIENT FLOORING (TILES) [M8]

CONTAIN ASBESTOS.

Estate Services Division	bestos Program	17/30/98
Real Estate	Asbestos F	Rev. 07/30

Dept: **DOT**Date: 06/08/99

164.07.00.30						
SIS Bldg # Building Name	Facility			Zip	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE	2829 JUAN ST SAN DIEGO	<u>.</u>	92110 SAN DIEGO	AN DIE	00
Room/Area Name [R#] Material Specification Name [M #1	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qtv. Units Priority	. Priorit	ACM V Status
WALL BASE IM221	STREAKS & MASTIC. 4 IN BLACK VINYL WMASTIC.	MASTIC ASSUMED POSITIVE.	NWE 9/1996	98 LF	1	ASSUMED POS.
				i B		
BUILDING 2, ROOM 190 [R42]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	ARSE CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	S	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	L LATH, CEILING. INSTALLED IN BUILDING COAT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	NG 9/1996 NWE	27 SY	O.	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	& 'UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	/	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	ARK FLOOR. TILE SAMPLED POSITIVE MASTIC ASSUMED POSITIVE.	VE. 9/1996 NWE	240 SF	٦	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S 9 FT OF E WALL & W-WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED	L 9/1996 ED NWE	21 LF		ASSUMED POS.
		POSITIVE.				

Page:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility. DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 2, ROOM 188 [R43]			•	·		
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	 H, CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. 	9/1996 · NWE	27 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	ب ا	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S 9 FT OF E WALL & W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	21 LF	L ASS	ASSUMED POS.
BUILDING 2, ROOM 186 [R44]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	300 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	H, CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	33 SY	C ASS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect c verification.		IST FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Divisic Asbestos Program Rev. 07/30/98	Ę			
	Real Estate Services Divisio	pestos Program	v. 07/30/98	

DOT 66/80/90 Dept: Date:

3617 DISTRICT OFFICE DISTRIC	-aciiit <u>y</u> DISTRICT 11 OFFICE	Address 2829 JUAN ST	SAN DIEGO	ST110 SAN DIEGO	_
		:			

				-		
Room/Area Name [R#]	Room Notes		Survey	Est.		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	Priority	Status
		ASBESTOS.				
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	L AS	ASSUMED POS.
OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	LOWER 7 FT OF WALLS. PANELING ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	490 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	300 SF.	O	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	30 LF	L AS	ASSUMED POS.
BUILDING 2, ROOM 184 [R45]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	S AS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	27 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY	9/1996 NWE	120 SF	L A8	ASSUMED POS.

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. NOTE:

Page: 10

SIS BIdg #: 3617

1ST FLOOR

POSITIVE

ပ

240 SF

9/1996

FLOOR. CONCEALED BY CARPET,

9 IN X 9 IN LIGHT GRAY W/DARK

RESILIENT FLOORING (TILES) [M8]

CONTAIN ASBESTOS.

_		
s Divisio		
Estate Services	rogram	98
Estate	sbestos Program	36/02/20
Real	Asbe	Rev. C

Dept: **DOT**Date: 06/08/99

SIS Birlo # Brilloing Name	Facility	Address		Zin	County	
	ICT 11 OFFICE	ANST		10	SAN DIEGO	0,
Room/Area Name [R#]	Room Notes		Survey	Est.		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Oty. Units Priority	Priority	
	STREAKS & MASTIC.	TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	NWE			
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 LF	L A	ASSUMED POS.
BUILDING 2, ROOM 182 [R46]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	ISE CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	S	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	ATH, CEILING. INSTALLED IN BUILDING DAT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	27 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	L. A	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	LOWER 7 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	280 SF	∀	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	K FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	· 62 LF	٦ ا	ASSUMED POS.

SIS Bldg #: 3617

Real Estate Services Division	Asbestos Program Rev. 07/30/98

Dept: **Dot** Date: 06/08/99

Sample S	SIS Blda # Building Name	Facility Address	ess City		Zip Cc	County	
Hoom Notes		•				AN DIE	05:
1 FTX 1 FT WHITE VERY COARSE FISSURED POSITIVE. GRAY TROWBLED-ON METAL LATH, SMOOTH, WOUT SCRATCH COAT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. JOINT COMPOUND PAINTED. AS ABBESTOS. JOINT COMPOUND PAINTED. ANTERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. JOINT COMPOUND PAINTED. AS THEAKS & MASTIC. ANTERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. ANTERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. ANTERIALS OF THIS SAMPLED POSITIVE. ANTERIALS OF THE SAMPLED NWE AS THOOR. TILE SAMPLED NWE AS THOOR. BASECOVE ASSUMED POSITIVE. ANTERIALS OF THE NEW WALL NWE ASTIC ASSUMED POSITIVE. ANTERIALS OF THE SAMPLED NWE AS TROWBLED-ON METAL LATH, CEILING. TILES SAMPLED ND. ASSUMED POSITIVE. ACOUSTIC TILES SAMPLED ND. ASSUMED POSITIVE. ANTERIALS OF THE WALL & WWE ASTIC ASSUMED POSITIVE. ANTERIALS OF THE WALL & WWE ASTIC ASSUMED POSITIVE. ANTERIAL LATH, CEILING. TILES SAMPLED ND. ASSUMED POSITIVE. ACOUSTIC TILES SAMPLED ND. ASSUMED POSITIVE. ANTERIAL ASTIC ASSUMED POSITIVE. ANTERIAL ASSUMED POSITI	Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Priori	
FISSURE, WMASTIC. GRAY TROWELED-ON METAL LATH, GEILING. INSTALLED IN BUILDING SMOOTH, WOUT SCRATCH COAT. 24] 4 FT X 8 FT SHEETS W/TAPE & ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. 24] 4 FT X 8 FT SHEETS W/TAPE & UPPER 3 FT OF N & S WALLS. JOINT COMPOUND PAINTED. CONTAIN ASBESTOS. 4 IN BLACK VINYL WMASTIC. A IN BLACK VINYL WMASTIC. A IN BLACK VINYL WMASTIC. A IN BLACK VINYL WMASTIC. B GRAY TROWELED-ON METAL LATH, CEILING. TILES SAMPLED ND. FISSURE, WMASTIC. GRAY TROWELED-ON METAL LATH, CEILING. TILES SAMPLED ND. SMOOTH, WOUT SCRATCH COAT. ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY THIS TYPE MAY TO NO S 9 FT OF E WALL. MASTIC ASSUMED POSITIVE. AT FLOOR BASECOVE ASSUMED POSITIVE. GRAY TROWELED-ON METAL LATH, CEILING. TILES SAMPLED ND. SMOOTH, WOUT SCRATCH COAT. ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN THIS TYPE MAY THIS TYPE MAY THIS TYPE MAY THIS TYPE MAY CONTAIN THIS TYPE MAY THIS TYPE MAY THIS TYPE MAY THIS TYPE MAY CONTAIN THIS TYPE MAY THIS TYPE	BUILDING 2, ROOM 180 [R47]						
GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING 9/1996 27 SY C SMOOTH, W/OUT SCRATCH COAT. 24] ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS. LES) [M8] 9 IN X 9 IN LIGHT GRAY W/DARK FLOOR. TILE SAMPLED POSITIVE. 4 IN BLACK VINYL W/MASTIC. AT FLOOR. BASECOVE ASSUMED POSITIVE. 4 IN BLACK VINYL W/MASTIC. AT FLOOR. BASECOVE ASSUMED POSITIVE. ASSUMED POSITIVE. GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING SY 37 SY C SMOOTH, W/OUT SCRATCH COAT. ACOUSTIC TILES SMATERIALS OF SY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF		ASSUMED POS.
LES) [M8] 9 IN X 9 IN LIGHT GRAY WIDARK CONTAIN ASBESTOS. LES) [M8] 9 IN X 9 IN LIGHT GRAY WIDARK HOOR. TILE SAMPLED POSITIVE. A IN BLACK VINYL WMASTIC. ON S 9 FT OF E WALL & W WALL BY 1996 21 LF LAT FLOOR. BASECOVE ASSUMED POSITIVE. AT FLOOR. BASECOVE ASSUMED POSITIVE. AT FLOOR. BASECOVE ASSUMED POSITIVE. AT FLOOR. BASECOVE ASSUMED POSITIVE. ASTIC ASSUMED POSITIVE. ASTIC ASSUMED POSITIVE. ASTIC ASSUMED POSITIVE. BASTIC ASSUMED POSITIVE. ASTIC ASSUMED POSITIVE. ASTIC ASSUMED POSITIVE. BASTIC ASSUMED POSITIVE. BASTI	FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH SMOOTH, W/OUT SCRATCH COAT.		9/1996 NWE	27 SY		ASSUMED POS.
LES) [M8] 9 IN X 9 IN LIGHT GRAY W/DARK RLOOR. TILE SAMPLED POSITIVE. 4 IN BLACK VINYL W/MASTIC. ON S 9 FT OF E WALL & W WALL AT FLOOR. BASECOVE ASSUMED NWE NEGATIVE. MASTIC ASSUMED POSITIVE. 1 FT X 1 FT WHITE VERY COARSE GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING SMOOTH, W/OUT SCRATCH COAT. AND STICES MATERIALS OF THIS TYPE MAY CONTAIN 1 THIS TYPE MAY CONTAIN	GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF		ASSUMED POS.
4 IN BLACK VINYL WMASTIC. AT FLOOR. BASECOVE ASSUMED NWE NEGATIVE. MASTIC ASSUMED POSITIVE. 1 FT X 1 FT WHITE VERY COARSE GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING SMOOTH, W/OUT SCRATCH COAT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	_	POSITIVE
1 FT X 1 FT WHITE VERY COARSE CEILING. TILES SAMPLED ND. 9/1996 240 SF S FISSURE, W/MASTIC. GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING 9/1996 27 SY C SMOOTH, W/OUT SCRATCH COAT. 2 ONLY. CONCEALED BY NWE ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S 9 FT OF E WALL & W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	21 LF	_	ASSUMED POS
1 FT X 1 FT WHITE VERY COARSE CEILING. TILES SAMPLED ND. 9/1996 240 SF S FISSURE, W/MASTIC. GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING 9/1996 27 SY C SMOOTH, W/OUT SCRATCH COAT. 2 ONLY. CONCEALED BY NWE ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	BUILDING 2, ROOM 178 [R48]						
GRAY TROWELED-ON METAL LATH, CEILING. INSTALLED IN BUILDING 9/1996 27 SY C SMOOTH, W/OUT SCRATCH COAT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF		ASSUMED POS.
	FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH SMOOTH, W/OUT SCRATCH COAT.			27 SY	O	ASSUMED POS.

Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

e: 12

SIS BIdg #: 3617

Heal Estate Services Division Asbestos Program

66/80/90 DOT Date: Dept:

	Rev. 07/30/98						
	SIS Bldg # Building Name_	Facility Address		,		County	
	3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 2829 JUAN ST	JAN ST SAN DIEGO		92110 SA	SAN DIEGO	2
	Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM
			ASBESTOS.				
	GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	60 SF	L A	ASSUMED POS.
	RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	240 SF	بـ	POSITIVE
	WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E, W & N WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	44 LF	٦ .	ASSUMED POS.
	BUILDING 2, ROOM 183 [R49]						
	ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING & UPPER 2 FT OF W WALL. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	2205 SF	σ «	ASSUMED POS.
	FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 NWE	222 SY	O	ASSUMED POS.
	GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF W & N SUPPORT. PARTIALLY CONCEALED. UPPER 2 FT OF W WALL COVERED W/ACOUSTICAL TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 2 NWE LS	372 SF	7	ASSUMED POS.
	RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR, CONCEALED BY CARPET	T. 9/1996	1995 SF	ပ	POSITIVE
38	Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the t for a listing of suspect dic verification.		1ST FLOOR		SIS	SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		ZID COL 92110 SA	County SAN DIEGO	·
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM
	STREAKS & MASTIC.	TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	NWE			
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	248 LF	L ASS	ASSUMED POS.
BUILDING 2, CORRIDOR [R50]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	1232 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	137 SY	C ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	1232 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL WIMASTIC.	E 17 FT OF N WALL, S 37 FT OF E WALL, W & S WALLS. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	244 LF	L AS	ASSUMED POS.

SIS Bldg #: 3617

1ST FLOOR

Page: 14

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Asbestos Program Rev. 07/30/98		Hoom/Area Assessment Report	sment Report			Date:	66/80/90
SIS Bldg # Building Name. 3617 DISTRICT OFFICE		Facility Address DISTRICT 11 OFFICE 2829 JU	Address. City. 2829 JUAN ST SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]		Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 176 [R51]			- -				
ACOUSTICAL (TILES) [M44]		1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING, UPPER 3 FT OF N & W WALLS & UPPER 3 FT OF N 12 FT OF E WALL. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	136 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]		GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S 5 FT OF E WALL & S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	14 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]		GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	15 SY	C AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]		9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	136 SF		POSITIVE
WALL BASE [M43]	<u> </u>	4 IN OLIVE VINYL W/MASTIC.	S 5 FT OF E WALL & S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	13 LF	. AS	ASSUMED POS.

DOT

Dept:

Room/Area Assessment Report

Real Estate Services Division Asbestos Program Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

.

SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM
BUILDING 1, ROOM 172 [R52]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	511 SF	s ASSUN	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S & W WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	46 SY	L ASSUN	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY. ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	57 SY (C ASSUN	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	75 SF	- ASSUM	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	511 SF	PO	POSITIVE
WALL BASE [M37]	6 IN CARAMEL VINYL W/MASTIC.	ON N 8 FT OF E WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	8 F	- ASSU	ASSUMED POS.
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	41 LF	L ASSUI	ASSUMED POS.

SIS Bldg #: 3617

1ST FLOOR

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect

NOTE:

materials observed. Data requires periodic verification.

66/80/90 DO T Date: Dept:

3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City SAN DIEGO	Zip <u>County</u> 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qtv. Units Priority	ACM

BUILDING 1, ROOM 170 [R53]						
ACOUSTICAL (TILES) [M44]	 1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	192 SF	o ေ	S ASSUMED POS.
FINISH PLASTER [M45]	 GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N & W WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	31 SY	_	31 SY L ASSUMED POS.
FINISH PLASTER [M46]	 GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT,	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF	9/1996 NWE	21 SY	O	21 SY C ASSUMED POS.

4 IN BLACK VINYL W/MASTIC.

BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE. ON N & W WALL AT FLOOR.

ASSUMED POS.

35 LF

9/1996

NWE

POSITIVE

O

192 SF

9/1996 NWE

TILE SAMPLED POSITIVE. MASTIC FLOOR, CONCEALED BY CARPET.

ASSUMED POSITIVE.

THIS TYPE MAY CONTAIN

ASBESTOS.

9 IN X 9 IN LIGHT GRAY W/DARK

RESILIENT FLOORING (TILES) [M8]

WALL BASE [M22]

STREAKS & MASTIC:

Homogeneous Material Summary Report for a listing of suspect Data audited and substandard records removed. See the

NOTE:

materials observed. Data requires periodic verification.

Real Estate Services Division	Asbestos Program	Rev. 07/30/98	

DOT 06/80/90

Dept: Date:

SIS Bldg # Building Name 3617 DISTRICT OFF	Building Name_ DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address. 2829 JUAN ST	City SAN DIEGO		Zip County 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification	oom/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes		Survey Date/Firm	Est. Otty. Units Priority	ACM Status

BUILDING 1, ROOM 168 [R54]

ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	180 SF	တ	ASSUMED POS.
FINISH PLASTER [M45]	MASTIC. GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 3 FT OF S 6 FT OF W WALL, UPPER 3 FT OF S WALL & N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE	9/1996 NWE		ب	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	MAY CONTAIN ASBESTOS. CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	20 SY	O	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	ASBESTOS. FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	180 SF	_	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	12 LF	_	ASSUMED POS.

Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

1ST FLOOR

SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name E 3617 DISTRICT OFFICE D	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		ZID CO 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 164 [R55]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	414 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 3 FT OF S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	12 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	46 SY	O ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 · NWE	77 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	414 SF	L AS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 	23 LF	L AS	ASSUMED POS.

NOTE: Homogeneous Material Summary Report for a listing of suspect Data audited and substandard records removed. See the

materials observed. Data requires periodic verification.

1ST FLOOR

SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: Date:	DOT
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 1, ROOM 162 [R56]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	180 SF	s ASS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 NWE	20 SY	C ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 3 FT OF S WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	8 8 4	L ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	64 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	180 SF	L ASS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	10 LF	L ASS	ASSUMED POS.

SIS BIdg #: 3617

1ST FLOOR

Page: 20

Homogeneous Material Summary Report for a listing of suspect Data audited and substandard records removed. See the

NOTE:

materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area As	Area Assessment Report			Dept: Date:	DOT
SIS Bidg # Building Name_3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address. 2829 JUAN ST SAN DIEGO	og.	Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Otty. Units Priority	Priority	ACM
BUILDING 1, NORTHWEST STAIRWELL [R57]	[R57]					
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	130 SF	S ASSL	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	LATH S, E & W WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 OF NWE	80 SY	L ASSU	ASSUMED POS.
FINISH PLASTER [M46] W/OL BUILDING 1, NORTHWEST STAIRWELL SWITCH ROOM	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	LATH CEILING. INSTALLED IN BUILDING DAT. 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	ING 9/1996 NWE	14 SY	C ASSL	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	LATH N, E & W WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 OF NWE	≻ S 6	L ASSL	ASSUMED POS.

SIS BIdg #: 3617

1ST FLOOR

Page: 21

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Add DISTRICT 11 OFFICE 282	Address 2829 JUAN ST SAN DIEGO		ZID CO 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 159 [R59]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	204 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H S, E & W WALLS & UPPER 3 FT OF N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	44 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	23 SY	C ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	204 SF	L ASS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	17 LF	L ASS	ASSUMED POS.
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	ON N, S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	41 LF	L ASS	ASSUMED POS.

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. NOTE:

Page: 22

1ST FLOOR

SIS Bldg #: 3617

Il Estate Services Division	s Program	86/08/
eal Estate S	sbestos Program	ev. 07/30/98

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area A	Room/Area Assessment Report	Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address City 2829 JUAN ST SAN DIEGO	Zip County 92110 SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Est. ACM Date/Firm Qty. Units Priority Status
BUILDING 1, ROOM 160 [R60]			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS &	M CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 198 SF S ASSUMED POS.

ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	198 SF	တ	ASSUMED POŜ.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 3 FT OF S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	∀S 6	_	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	22 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	180 SF	_	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	198 SF	_	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	# F	_	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON E WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	18 LF	_	ASSUMED POS.

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. NOTE:

Page: 23

1ST FLOOR

SIS BIdg #: 3617

Asbestos Program Rev. 07/30/98	KOOM/Area ASS	Area Assessment Report			Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility. Add DISTRICT 11 OFFICE 282	Address 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	riority	ACM Status
BUILDING 1, ROOM 155 [R61]				·		
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	640 SF	S ASSL	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N, S & E WALLS & CEILING. PARTIALLY CONCEALED. CEILING COVERED W/ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1290 SF	L ASSU	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	350 SF	L ASSL	ASSUMED POS.
RESILIENT FLOORING (TILES) [M48]	12 IN X 12 IN CREAM W/BROWN & WHITE FLECKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	640 SF	L ASSU	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MÁSTIC ASSUMED POSITIVE.	E . 9/1996 NWE	130 LF	L ASSU	ASSUMED POS.
BUILDING 1, ROOM 151 [R62]						
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	459 SF	s ASSI	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S & W WALLS & CEILING. PARTIALLY CONCEALED. CEILING COVERED W/ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY	9/1996 NWE	855 SF	L ASSI	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	. Page:		1ST FLOOR		SIS Bldg #:	#: 3617

DOT

Dept:

Room/Area Assessment Report

Real Estate Services Division Asbestos Program

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area A	Assessm	Area Assessment Report	en e		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name	Facility	Address	City		Zip Cc	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE	2829 JUAN ST	ST SAN DIEGO		92110 SA	SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	NOA 6	ACM I ocation/Niotes	Survey	Est.	I Inite Priority	ACM
		ĪĢ.	CONTAIN ASBESTOS.				
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N & THI	N & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	352 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M48]	12 IN X 12 IN CREAM W/BROWN & WHITE FLECKS & MASTIC.	•	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	459 SF	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.		ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	88 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 153 [R63]	٠.						
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.		CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	288 SF	s AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	≪ .	N WALL & CEILING. PARTIALLY CONCEALED. CEILING COVERED W/ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 NWE	528 SF	O AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.		S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M48]	12 IN X 12 IN CREAM W/BROWN & WHITE FLECKS & MASTIC.	·	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	288 SF	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.		ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC	= 9/1996 NWE	72 LF	L AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.		Page: 25		1ST FLOOR		SIS Bldg #:	lg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name Band Bldg Bldg Bldg Bldg Bldg Bldg Bldg Bld	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	C
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM
		ASSUMED POSITIVE.				
BUILDING 1, NORTHWEST CORRIDOR [R64]						
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	260 SF	S AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S WALL, S 7 FT OF E WALL & E 16 FT OF N WALL & CEILING. PARTIALLY CONCEALED. CEILING COVERED W/CEILING TILE. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	710 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M48]	12 IN X 12 IN CREAM W/BROWN & WHITE FLECKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	260 SF	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	98 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 157A [R65]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	340 SF	SA	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 E NWE	22 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH	CEILING. INSTALLED IN BUILDING	961/6	38 SY	C A8	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	d. See the listing of suspect fication.		1ST FLOOR		SIS Bldg #:	lg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report		0 0	Dept: Date:	DOT
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address. City. 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
	WOUT SMOOTH SCRATCH COAT.	1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	NWE			
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	340 SF L	ASSUN	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	UPPER 2 FT OF E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	40 SF L	ASSUN	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	74 LF L	ASSUN	ASSUMED POS.
BUILDING 1, ROOM 158 [R66]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	216 SF S		ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 3 FT OF S WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	9 SY . L	ASSUN	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 NWE	24 SY C		ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the or a listing of suspect verification.		1ST FLOOR		SIS Bldg #:	3617

Services Division	rogram	. 86	
Real Estate Services [Asbestos Program	Rev. 07/30/98	

DOT 66/80/90 Date:

Dept:

SIS Bldg # Building Name		Address		Zip	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 282	2829 JUAN ST SAN DIEGO		92110 S	SAN DIEGO	095
Room/Area Name [R#]	Room Notes		Sirvey	T T	•	ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	Prior	0,
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF		ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	216 SF	_	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	48 LF	_	ASSUMED POS.
BUILDING 1, ROOM 156 [R67]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	216 SF	တ	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H N WALL & UPPER 3 FT OF S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	984		ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	H CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	24 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	_	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY	FLOOR. MATERIALS OF THIS	9/1996	216 SF	_	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the or a listing of suspect verification.		1ST FLOOR		SIS	SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	TOQ
SIS Bida # Building Name	Facility	Address		Zio	County	
•	CT 11 OFFICE	AN ST		10	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units	Units Priority	ACM Status
WALL BASE [M42]	STREAKS & MASTIC. 4 IN BROWN VINYL W/MASTIC.	TYPE MAY CONTAIN ASBESTOS. ON N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE 9/1996 NWE	48 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 157 [R68]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	180 SF	s AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TH E WALL & UPPER 3 FT OF N WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	22 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING T. 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	20 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE.& JOINT COMPOUND PAINTED.	S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	100 SF	L AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	W WALL, MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	180 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	180 SF	Ö	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE	9/1996	56 LF	L AS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:		1ST FLOOR		SIS Bidg #:	lg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report	-		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Addi	Address. 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 1, ROOM 154 [R69]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	342 SF	s ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H N WALL & UPPER 3 FT OF S WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	14 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	THE CEILING. INSTALLED IN BUILDING TONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	38 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 NWE	342 SF	C ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	74 LF	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	30	1ST FLOOR		SIS Bidg #:	#: 3617

					Dept: DOT
Real Estate Services Division Aspestos Program	Room/Area Asses	rea Assessment Report	- yn		Date: 06/08/99
SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JUAN ST	City AN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM riority Status
BUILDING 1, MENS RESTROOM 1 [R70]					,
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. PARTIALLY CONCEALED. LOWER 6 FT OF WALLS COVERED W/CERAMIC TILE. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	35 SY	ASSUMED POS.
BUILDING 1, MENS RESTROOM 1 STORAGE [R71] FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	18 SY	L ASSUMED POS.
BUILDING 1, MENS RESTROOM 1 VESTIBULE [R72]	ULE [R72]				
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN	N 9/1996 DF NWE	16 SY	L ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR. TILE SAMPLED POSITIVE	/E. 9/1996 NWF	16 SF	L · POSITIVE
WALL BASE [M43]	STREAKS & MASTIG. 4 IN OLIVE VINYL W/MASTIC.	MASTIC ASSUMED FOSTIVE. ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	-	16 LF	L ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	removed. See the ort for a listing of suspect ordic verification.		1ST FLOOR	æ	SIS BIdg #: 3617

			· · ·		Dept:	DOT
Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	City AN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	Su ACM Location/Notes Date	Survey Date/Firm	Est. Qty. Units Priority	riority	ACM Status
BUILDING 1, JANITOR CLOSET 1 [R73] FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT,	N, S & E WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY	9/1996 NWE		L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8] WALL BASE [M43]	PAIN I ED. 9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC. 4 IN OLIVE VINYL W/MASTIC.		9/1996 NWE 9/1996 NWE	9 SF 12 LF	L ASS	POSITIVE ASSUMED POS.
BUILDING 1, PIPECHASE 1 [R74] FINISH PLASTER [M50]	LIGHT GRAY TROWELED-ON METAL LATH, LIGHT WEIGHT ROUGH	E.& W WALLS. SEVERE DAMAGE & WATER DAMAGE, RESULTING FROM PREVIOUS MAINTENANCE	9/1996 NWE	21 SY		NONE
PIPE FITTINGS (HIGH TEMP) [M6] PIPE INSULATION (HIGH TEMP) [M9]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP. 1 1/2 TO 2 IN DIA GRAY AIRCELL W/CANVAS WRAP.	ACTIVITY. ELBOWS & TEES ON DOMESTIC WATER RUNS. HORIZONTAL & VERTICAL DOMESTIC WATER RUNS. SEVERE DAMAGE RESULTING FROM PAST	9/1996 NWE 9/1996 NWE	14 EA 35 LF	_ _	POSITIVE
		MAINTENANCE ACTIVITY.		!		

SIS BIdg #: 3617

1ST FLOOR

Page: 32

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

				_) -togC	DOT
Real Estate Services Division Asbestos Program	Room/Area Assess	rea Assessment Report			Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JUAN ST	City AN ST SAN DIEGO		Zip County 92110 SAN DI	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM
BUILDING 1, JANITOR CLOSET 2 [R75] FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	27 SY	L ASSU	ASSUMED POS.
BUILDING 1, WOMENS LOUNGE 1 CLOSET [R76] FINISH PLASTER [M45]	[R76] GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	12 SY	L ASSI	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8] WALL BASE [M43]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC. 4 IN OLIVE VINYL W/MASTIC.	ASBESTOS. FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE. ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE E 9/1996 NWE	9 SF 12 LF	L ASS	POSITIVE ASSUMED POS.
BUILDING 1, WOMENS LOUNGE 1 [R77] FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.		, 9/1996 F NWE	71 SY	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	ASBESTOS. FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	r. 9/1996 C NWE	136 SF	O .	POSITIVE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the art for a listing of suspect addic verification.	-	1ST FLOOR	œ	SIS Bldg #:	g#: 3617

Rev. 07/30/98 SIS Bldg # Building Name_ 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	City JAN ST SAN DIEGO		Zip County. 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#]	Room Notes	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
Material Specification Name [M #] WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	99 LF	L ASS	ASSUMED POS.
BUILDING 1, WOMENS RESTROOM 1 [R78]						
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. PARTIALLY CONCEALED. LOWER 6 FT OF WALLS COVERED W/CERAMIC TILE. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	53 SY	L ASS	ASSUMED POS.
BUILDING 1, WOMENS RESTROOM 1 VESTIBULE [R79]	RBULE [R79]					
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 : NWE	18 SY	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR. TILE SAMPLED POSITIVE.	9/1996 NWE	20 SF		POSITIVE
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	•	18 LF	L AS	ASSUMED POS.

DOT 06/08/99

Dept:

Room/Area Assessment Report

Real Estate Services Division Asbestos Program

NOTE:

Page: **34**

SIS Bldg #: 3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JUAN ST	IAN ST SAN DIEGO		Zip Cot 92110 SA	County SAN DIEGO	Q
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Priority	ACM
BUILDING 1, ROOM 152 [R80]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	180 SF	S.	ASSUMED POS.
FINISH PLASTER [M45]	MASTIC. GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 3 FT OF S WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY	. 9/1996 NWE	8 SY	L A	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CONTAIN ASBESTOS. CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF	3 9/1996 NWE	20 SY	O	ASSUMED POS.
,		THIS TYPE MAY CONTAIN ASBESTOS.				
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	٦ ,	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	180 SF		ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	46 LF		ASSUMED POS.
		. *				

66/80/90 DOT

> Date: Dept:

SIS BIdg #: 3617

1ST FLOOR

Page: 35

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report	,		Dept: Date:	DOT
SIS Bidg # Building Name. 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 UUAN ST	City JAN ST SAN DIEGO		Zip Cor 92110 SA	County SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Otty. Units	Priority	ACM Status
BUILDING 1, ROOM 150 [R81]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	270 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 3 FT OF S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY	. 9/1996 NWE	12 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	30 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	ASBESTOS. E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STEFAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	270 SF	L AS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	51 LF	L A	ASSUMED POS.
WALL BASE [M51]	3 IN CARAMEL VINYL W/MASTIC.	ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	15 LF	- A	ASSÜMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	removed. See the orthogonal for a listing of suspect orthogonal and a suspect orthogonal and a suspect orthogonal architecture.		1ST FLOOR	Œ	SIS	SIS Bldg #: 3617

66/80/90 DOT

Real Estate Services Division Asbestos Program	Room/Area Asses	Assessment Report			Dept: DOT Date: 06/08/99	_ 6
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JUAN ST	JAN ST SAN DIEGO		Zip County 92110 SAN DI	County. SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Priority Status	
BUILDING 1, NORTH CORRIDOR 1 [R82]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS &	CEILING, W 1/2 OF ROOM. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE	9/1996 NWE	724 SF	S ASSUMED POS.	S.
ACOUSTICAL (TILES) [M49]	MASTIC. 1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING, E 1/2 OF ROOM. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	490 SF	S ASSUMED POS.	OS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS AT S/W 1/3 & N/E 1/3 OF ROOM. INSTALLED IN BUILDING I ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 1 NWE	116 SY	L ASSUMED POS.	SO
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING, W 1/2 OF ROOM. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES MATERIALS OF THIS TYPE MAY	9/1996 NWE S.	724 SY	C ASSUMED POS.	OS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	BUILD-OUT WALLS IN CENTER 1/3 OF S END OF ROOM & UPPER 1 FT OF N WALL & E 1 PARTIALLY CONCEALED. CEILING COVERED W/ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	3 9/1996 =T NWE	754 SF	L ASSUMED POS.	· · · · · · · · · · · · · · · · · · ·
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	ASBESTOS. E 7 FT ON N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	56 SF	L ASSUMED POS.	.50S.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rit for a listing of suspect dic verification.		1ST FLOOR	٣.	SIS Bldg #: 36	3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	DOT 06/08/99
Rev. 07/30/98					County	
SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	IAN ST SAN DIEGO		92110 SA	SAN DIEGO	0.
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE.	9/1996 NWE	1214 SF	-	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	VARIOUS WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	60 LF	L A	ASSUMED POS.
WALL BASE [M37]	6 IN CARAMEL VINYL W/MASTIC.	ON W 4 FT OF N WALL & N 7 FT OF W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	F 9/1996 NWE	11日	L A	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	VARIOUS WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	10 LF	٦ ا	ASSUMED POS.
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	VARIOUS WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	80 LF	Г Г	ASSUMED POS.
WALL BASE [M51]	3 IN CARAMEL VINYL W/MASTIC.	ON E 7 FT OF N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	7 LF	, L	ASSUMED POS.
BUILDING 1, NORTH LOBBY [R83]	TERRAZZO FLOOR.					
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	631 SF	σ	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S 1/3 OF E & W WALLS & S WALL INSTALLED IN BUILDING 1 ONLY MATERIALS OF THIS TYPE MAY	9/1996 NWE	66 SY	_	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	removed. See the ort for a listing of suspect odic verification.		1ST FLOOR	~	SIS	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report	. , ,	,	Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City SAN DIEGO	•	Zip Co 92110 SA	County SAN DIEGO	
	-					
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CONTAIN ASBESTOS. CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	70 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	ASBESTOS. CEILING LIGHT WELL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	s 9/1996 NWE	111 SF	L ASS	ASSUMED POS.
BUILDING 1, ROOM 101 [R84]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 NWE	480 SF	S AS	ASSUMED POS.
OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	N & E WALLS. PANELING ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	352 SF	L AS	ASSUMED POS.
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	ON WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	88 LF	L AS	ASSUMED POS.

Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect ic verification.		1ST FLOOR	~	SIS BIdg #:	dg #: 3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT
Hev. 0//30/98	Facility Address	SSS	:	Zip Cot	County	
3617 DISTRICT OFFICE	CT 11 OFFICE	2829 JUAN ST SAN DIEGO		92110 SA	SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Priority	ACM Status
BUILDING 1, TELEPHONE BOOTH 1 [R85]			······································			
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	13 SY	T A§	ASSUMED POS.
RESILIENT FLOORING (TILES) [M53]	9 IN X 9 IN BEIGE W/GREEN	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	15 SF	L A	ASSUMED POS.
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	16 LF	L A	ASSUMED POS.
BUILDING 1, ROOM 102 [R86]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 , NWE	240 SF	σ O	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H W8 FT OF N WALL, UPPER 2 FT OF E 10 FT OF N WALL, E & W WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE 3 1	70 SY		ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	•	NG 9/1996 NWE	5 27 SY	0	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:		1ST FLOOR		SIS	SIS Bldg #: 3617

DOT 66/80/90

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		ZID COL 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Priority S	ACM Status
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S WALL & LOWER 7 FT OF E 10 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	- 9/1996 NWE	270 SF	L ASSUN	ASSUMED POS.
RESILIENT FLOORING (TILËS) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 . NWE	240 SF	O D	POSITIVE
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	ON WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	64 LF	L ASSUM	ASSUMED POS.
BUILDING 1, ROOM 103 & CLOSET [R87]			÷			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	233 SF	S ASSUI	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 2 FT OF S WALL & N, E & W WALLS OF CLOSET. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	W 9/1996 NWE	15 SY	L ASSU	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	1G 9/1996 NWE	26 SY	C ASSU	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	LOWER 8 FT OF S WALL & W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	, 9/1996 E NWE	261 SF	L ASSU	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect ic verification.		1ST FLOOR	۳.	SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: DOT Date: 06/08/99	DOT /08/99
Hev. 07/30/36	Facility Address			1	County	
	DISTRICT 11 OFFICE 2829 JUAN ST	AN ST SAN DIEGO	_	92110 SAI	SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	ACM Priority Status	
OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	N & E WALLS. PANELING ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	235 SF	L ASSUMED POS.	POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 3 NWE	233 SF	C POSITIVE	П
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	ON WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	60 LF	L ASSUMED POS.	POS.
BUILDING 1, ROOM 104 [R88]			. managan . pamman	,		
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	216 SF	S ASSUMED POS.	POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 2 FT OF N & W WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 . NWE	787	L ASSUMED POS.	POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	IG 9/1996 NWE F	24 SY	C ASSUMED POS.	POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	LOWER 8 FT OF N & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	224 SF	L ASSUMED POS.	POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	removed. See the ort for a listing of suspect odic verification.		1ST FLOOR	т.	SIS Bidg #:	3617

			in g a spin recogn)	1
Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	66/80/90
SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JUAN ST	City IAN ST SAN DIEGO	and the control of th	Zip Cor 92110 SA	County. SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY WIDARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	216 SF	0	POSITIVE
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	ON WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	60 LF	L ASS	ASSUMED POS.
BUILDING 1, ROOM 105 [R89]			Come a ser e estámi			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	204 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL & UPPER 2 FT OF S WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	17.8Y	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	23 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	102 SF	L AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	LOWER 7 FT OF W WALL & LOWER 8 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	232 SF	. L AS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.		1ST FLOOR	~	SIS Bldg #:	dg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		ZIP CO 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	r. 9/1996 C NWE	204 SF	O.	POSITIVE
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	ON WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY DONTAIN ASBESTOS.	9/1996 NWE	58 LF	L ASSL	ASSUMED POS.
BUILDING 1, ROOM 107 & CLOSET [R90]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	OFFICE CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE	9/1996 .: NWE	323 SF	S ASSL	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	E 9 FT OF S WALL, N & E WALLS & CLOSET WALLS & CEILING. PARTIALLY CONCEALED. LOWER 3 1/2 FT OF N & E WALLS COVERED W/WOOD PANELING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY	8 9/1996 NWE	73 SY	L ASSI	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.		9/1996 BY NWE F	36 SY	C ASSI	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	W 8 FT OF S WALL & UPPER 3 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	r 9/1996 IS NWE	137 SF	L ASSI	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the tor a listing of suspect lic verification.		1ST FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area As	Room/Area Assessment Report	-		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility DISTRICT 11 OFFICE 28	Address City 2829 JUAN ST SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	_
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	LOWER 7 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	133 SF	L ASS	ASSUMED POS.
OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	LOWER 3 1/2 FT OF N & E WALLS PANELING ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	108 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	T. 9/1996 C NWE	322 SF	O	POSITIVE
RESILIENT FLOORING (TILES) [M56]	12 IN X 12 IN DARK BEIGE MOTTLED W/MASTIC.	TLED CLOSET FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	= 9/1996 NWE	30 SF	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON CLOSET WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	22 LF	L AS	ASSUMED POS.
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	TIC. ON OFFICE WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	72 LF	L AS	ASSUMED POS.
BUILDING 1, SUPPLY CLOSET [R91]						
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED BUILDING 1 ONLY. MATERIALS THIS TYPE MAY CONTAIN ASBESTOS.	IN 9/1996 OF NWE	18 SY	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	K FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	/E. 9/1996 NWE	18 SF	_	POSITIVE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect coerification.	45	1ST FLOOR		SIS Bldg #:	g#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/	Area Asses	Room/Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	Oity IAN ST SAN DIEGO		Zip Cc 92110 SA	County. SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	tes	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 108 [R92]				-			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	E W/MEDIUM BRATIONS &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	221 SF	s AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL W/SMOOTH SCRATCH COAT, PAINTED.	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S & E WALLS. PARTIALLY CONCEALED. LOWER 3 1/2 FT OF WALLS COVERED W/WOOD PANELING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 DF NWE OF	11 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELEI W/OUT SMOOTH	D-ON METAL LATH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	25 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	FAB WALL L FACING.	E 8 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	OF 9/1996 NWE	80 SF	L AS	ASSUMED POS.
OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	D PANELING	S & E WALLS. PANELING ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	102 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GR STREAKS & MASTIC.	GRAY W/DARK TIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	T. 9/1996 C NWE	221 SF	O	POSITIVE
WALL BASE [M52]	4 IN LIGHT GRAY	VINYL W/MASTIC.	ON WALLS AT FLOOR.	9/1996	60 LF	L AS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the tor a listing of suspect ic verification.	Page: 46		1ST FLOOR		SIS Bldg #:	lg #: 3617

Room/Area Assessment Report

DOT 66/80/90 Dept: Date;

SIS Bidg # Building Name_3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City SAN DIEGO	anna ann amarainn dà nao	Zip County 92110 SAN DIEGO	
				and the second		
Room/Area Name [R#]	Room Notes		-	Survey	Est.	ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	es	Date/Firm	Qty. Units Priority Status	Status
		MATERIALS OF THIS TYPE MAY	THIS TYPE MAY	NWE		
		CONTAIN ASBESTOS.	STOS.			
BUILDING 1, ROOM 106 [R93]						

ACOUSTICAL (TILES) [M44]	 1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	204 SF	တ	S ASSUMED POS.
FINISH PLASTER [M45]	 GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT,	UPPER 2 FT OF N WALL & S WALLS. PARTIALLY CONCEALED.	9/1996 NWE	17 SY	_	L ASSUMED POS.
	 PAINTED.	LOWER 3 1/2 FT OF S WALL COVERED W/WOOD PANELING. INSTALLED IN BUILDING 1 ONLY.	w o en de con en			
		MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.				
FINISH PLASTER [M46]	 GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY	9/1996 NWE	23 _. SY	O	C ASSUMED POS.
		ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	e des e compres s'anne s'acompagne d'			

7		

GYPSUM WALLBOARD [M41]

	_	
4 FT X 10 FT PREFAB WALL	SYSTEM W/VINYL FACING.	

ASSUMED POS.

274 SF

9/1996

NWE

WALL. MATERIALS OF THIS TYPE

MAY CONTAIN ASBESTOS.

LOWER 8 FT OF N WALL & W

ASBESTOS.

9 IN X 9 IN LIGHT GRAY	STREAKS & MASTIC.
•	
RESILIENT FLOORING (TILES) [M8]	

9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR. CONCEALED BY CARPET.
STREAKS & MASTIC.	TILE SAMPLED POSITIVE. MASTIC
	ASSUMED POSITIVE.
4 IN LIGHT GRAY VINYL W/MASTIC. ON WALLS AT FLOOR.	ON WALLS AT FLOOR.

ם
 C
Ū
H
Ŧ

Page: 47

Homogeneous Material Summary Report for a listing of suspect Data audited and substandard records removed. See the

NOTE:

WALL BASE [M52]

materials observed. Data requires periodic verification.

ASSUMED POS.

58 LF

9/1996

NWE

MATERIALS OF THIS TYPE MAY

POSITIVE

O

204 SF

9/1996

NWE

Asbestos Program Rev. 07/30/98			ne : '''''''''''''''	•	Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Add DISTRICT 11 OFFICE 285	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		CONTAIN ASBESTOS.				
BUILDING 1, NORTHEAST CORRIDOR [R94]						
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	301 SF	S AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	CEILING. CONCEALED BY ACOUSTICAL TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	301 SF	O AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	800 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	301 SF	O	POSITIVE
WALL BASE [M52]	4 IN LIGHT GRAY VINYL W/MASTIC.	C. ON WALLS AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	100 LF	L AS	ASSUMED POS.
BUILDING 1, DUMBWAITER SHAFT [R95]	CONVERTED INTO CON	CONVERTED INTO CONDUIT CHASE. NO SUSPECT MATERIALS OBSERVED IN ROOM.	OBSERVE	O IN ROOM.		
•						

DOT 66/80/90

Dept:

Room/Area Assessment Report

Real Estate Services Division

NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. Data audited and substandard records removed. See the

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area As	Room/Area Assessment Report	anne e e e e e e e e e e e e e e e e e e		Dept: DoT Date: 06/08/99	DOT /08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address City 2829 JUAN ST SAN DIEGO		Zip Cou 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	ACM Units Priority Status	
BUILDING 1, CONCEALED SPACE 1 [R96]	UNABLE TO PHYSICALLY OR VISUALI PLANS. ROOM/AREA NOT ACCESSED	FO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM OOM/AREA NOT ACCESSED.	RUCTIVE	EASURES. IDE	ENTIFIED FROM	
BUILDING 1, POWER ROOM [R97]			mangun manan saman naman			
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	LLATH E WALL & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	N 9/1996 F NWE	26 SY	L ASSUMED POS.	POS,
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	& PATCHES IN CEILING ABOVE . ELECTRICAL CIRCUIT BREAKERS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 S. NWE	32 SF	L ASSUMED POS.	POS.
BUILDING 1, ROOM 112A [R98]	INCLUDES SPACE B	INCLUDES SPACE BETWEEN ORIGINAL & DROPPED CEILING	rounder - 14 months deutschaft (1994)			
ACOUSTICAL (PANELS) [M54]	2 FT X 4 FT WHITE, COARSE DIVOT PATTERN.	DIVOT DROPPED CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	D 9/1996 NWE	119 SF	S ASSUMED POS.	POS.
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	M CEILING. PARTIALLY CONCEALED N 2/3 OF CEILING IS COVERED BY DROPPED CEILING SYSTEM. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	:D. 9/1996 3Y NWE :E	170 SF	S ASSUMED POS.	POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	AL LATH N & W WALLS & UPPER 2 FT OF E F, WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE	E 9/1996 1 NWE	32 SY	L ASSUMED POS.	POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.		Page: 49	1ST FLOOR	œ	SIS Bldg #: 3	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	05
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priorit	ACM / Status
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	MAY CONTAIN ASBESTOS. CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF	9/1996 NWE	19 SY	O	ASSUMED POS.
•		THIS TYPE MAY CONTAIN ASBESTOS.				
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	1 FT STRIP BELOW PLASTER ON E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	10 SF		ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	170 SF	٦	POSITIVE
WALL BASE [M21]	4 IN CARAMEL VINYL W/MASTIC.	ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	17 LF		ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	17 LF	_	ASSUMED POS.
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIG.	ON W WALL AT FLOOR. PAINTED BROWN. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	10 LF	_	ASSUMED POS

SIS Bldg #: 3617

1ST FLOOR

Page: 50

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report			Dept: Date:	DOT 06/80/90
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	-	Zip Co 92110 SA	County SAN DIEGO	·
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM
BUILDING 1, ROOM 111A [R99]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	132 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT; PAINTED.	TH S & E WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 : NWE	20 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING TONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	15 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	88 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	· 132 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON S, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	35 LF	L AS	ASSUMED POS.
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 .: NWE	11 LF	L AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	72	1ST FLOOR	~	SIS Bldg #:	ıg#: 361 7

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cou	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 1, ROOM 112 [R100]			man man da			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	221 SF	S ASSL	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TH W WALL & UPPER 2 FT OF E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	14 SY	L ASSU	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	25 SY	C ASSI	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	1 FT STRIPE BELOW PLASTER ON E WALL & UPPER 4 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 . NWE	62 SF	L ASSI	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	221 SF	O	POSITIVE
WALL BASE [M43]	4 IN OLIVE VINYL W/MASTIC.	ON W WALL AT FLOOR. PAINTED BLACK. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	13 LF	L ASS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	52	1ST FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	-	Zip Co 92110 SA	County. SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 111B & CLOSETS [R101]	01]				,	
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	2072 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W 11 FT OF N WALL, E & S BUILD-OUT WALLS, E WALL & UPPER 2 FT OF W WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	135 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	230 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S WALL & E 20 FT OF N WALL & N BUILD-OUT WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	519 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 . NWE	2072 SF	Ö	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	214 LF	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.		1ST FLOOR		SIS Bldg #:	#: 3617

					/	١
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT :
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	0	Zip Co 92110 SA	County SAN DIEGO	09:
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Prior	ACM ty Status
BUILDING 1, ROOM 114 [R102]			and the second second			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	646 SF	S	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL & UPPER 2 FT OF E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 1 NWE	56 SY	-	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH WOUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	IG 9/1996 NWE	72 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 3 FT OF N WALL & 1 FT STRIP BELOW PLASTER ON E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE E	89 SF	_	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 . NWE	170 SF	_	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	646 SF	ب	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	38 LF		ASSUMED POS.
WALL BASE [M51]	3 IN CARAMEL VINYL W/MASTIC.	ON S WALL AT FLOOR.	9/1996	17 LF	_	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the tor a listing of suspect lic verification.	•	1ST FLOOR		SIS	SIS Bldg #: 3617

	. (()	
Achooton Drogram		ジング スロング・ドラング
ASDESION FINGERIA		
00/00/20		
nev. 0//00/30		
_	_	

Real Estate Services Division

Room/Area Assessment Report

Dept: **DOT**Date: 06/08/99

SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City ST SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	09
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACN	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM y Status
		BA	BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 1, ROOM 114B [R103]							
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.		CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	255 SF	S	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	LATH	W WALL & UPPER 2 FT OF E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 1 NWE	20 SY	, _	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	T.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	28 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.		1 FT STRIPE BELOW PLASTER ON E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	N 9/1996 NWE	15 SF	-J	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.		N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	340 SF	ب	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	급스	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	255 SF	_	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.		ON W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE.	9/1996 E. NWE	15 LF	_	ASSUMED POS.

Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

Page: **55**

SIS Bldg #: 3617

1ST FLOOR

Real Estate Services Division	Asbestos Program	Rev. 07/30/98

Room/Area Assessment Report

Dept: Date:

DOT 66/80/90

Hev. 07/30/98				•		· · · · · · · · · · · · · · · · · · ·
SIS Bldg # Building Name	Facility Address	S		Zip County	 ≱	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 2829 J	2829 JUAN ST SAN DIEGO		92110 SAN	SAN DIEGO	
				,		
Room/Area Name [R#]	Room Notes		Survey	Est.		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	riority	Status
	•	MASTIC ASSUMED POSITIVE.				
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	17 LF L		ASSUMED POS.
WALL BASE [M51]	3 IN CARAMEL VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	17 LF L		ASSUMED POS.
BUILDING 1, ROOM 113C [R104]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	236 SF	S ASSL	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 2 FT OF W WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	3 SY 1	. ASSL	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	26 SY (C ASSU	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	1 FT STRIPE BELOW PLASTER ON W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	1 9/1996 NWE	14 SF	L ASSU	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N, S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN	. 9/1996 NWE	440 SF	L ASSU	ASSUMED POS.

Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. Data audited and substandard records removed. See the NOTE:

Page: **56**

SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area As	Room/Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name_ 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 29	Address City 2829 JUAN ST SAN DIEGO		Zip Cc 92110 S/	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM
		ASBESTOS.				
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	236 SF	L AS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	15 LF	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON S & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	29 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 113C OFFICE 1 [R105]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	156 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	ATH E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 E NWE	14 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	ATH CEILING. INSTALLED IN BUILDING AT. 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	17 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N, S & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	370 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY	FLOOR. MATERIALS OF THIS	9/1996	156 SF	L AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the or a listing of suspect verification.	25	1ST FLOOR		SIS Bldg #:	g#: 3617

Asbestos Program Rev. 07/30/98	Hoom/Area Asses	Area Assessment Report			Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City. 2829 JUAN ST SAN DIEGO		ZID Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
WALL BASE [M22]	STREAKS & MASTIC. 4 IN BLACK VINYL W/MASTIC.	TYPE MAY CONTAIN ASBESTOS. ON N & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	NWE 9/1996 :: NWE	25 LF	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON N, S & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 :. NWE	25 LF	L ASS	ASSUMED POS.
BUILDING 1, ROOM 113C OFFICE 2 [R106]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	144 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S & E WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	26 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	16 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	240 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	144 SF	L ASS	ASSUMED POS,
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect c verification.		1ST FLOOR		SIS Bldg #:	#: 3617

Dept:

Room/Area Assessment Report

Real Estate Services Division Asbestos Program

Real Estate Services Division Asbestos Program. Rev. 07/30/98	Room	/Area Asses	Room/Area Assessment Report	,		Dept: Date:	DOT
# Bp	Facility				}	County	
3617 DISTRICT OFFICE	DISTRICT 1.1 OFFICE	2829 JUAN ST	JAN ST SAN DIEGO	0	92110 S/	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	otes	ACM Location/Notes	Survey Date/Firm	Est. Otty. Units Priority	Priority	ACM Status
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	'L W/MASTIC.	ON S & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL WMASTIC.	YL W/MASTIC.	ON N & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF	L ASS	ASSUMED POS.
BUILDING 1, HOOM 113C OFFICE 3 [H107]				ale e anno e alece e			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	TE W/MEDIUM ORATIONS &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	192 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL W/SMOOTH SCRATCH COAT, PAINTED.	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 2 FT OF W WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	384	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELEI WOUT SMOOTH	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	IG 9/1996 NWE F	21 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	ETS W/TAPE & ND PAINTED.	S WALL & 1 FT STRIP BELOW PLASTER ON W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	172 SF	L ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	EFAB WALL 1L FACING.	N & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	280 SF	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect c verification.	Page: 59		1ST FLOOR		SIS Bidg #:	1#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Col	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Priority	ACM Status
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	192 SF	L ASSUM	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	16 LF	L ASSUM	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON N & E WALLS AT FLOOR: BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 . NWE	28 LF	L ASSUN	ASSUMED POS.
BUILDING 1, ROOM 114C [R108]			o hann i man ann ann ann an ann an ann an ann an			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	170 SF	S ASSUM	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL & UPPER 2 FT OF E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	13 SY	L ASSUN	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	19 SY	C ASSUN	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S WALL & 1 FT STRIP BELOW PLASTER ON E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 LS NWE	180 SF	L ASSUN	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the t for a listing of suspect lic verification. Page: 60		1ST FLOOR		SIS Bldg #:	3617

1.5

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			Dept: Date:	DOT
SIS Blda # Building Name	Facility Address	S		Zip Col	County	
	CT 11 OFFICE	2829 JUAN ST SAN DIEGO		92110 SA	SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM ocation/Notes	Survey Date/Firm	Est. Otv. Units Priority	Priority	ACM Status
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 · NWE	170 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	170 SF	L ASS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	10 LF	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL WIMASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	17 LF	L ASS	ASSUMED POS.
BUILDING 1, ROOM 116 [R109]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	204 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL & UPPER 2 FT OF E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	16 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 NWE	23 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N & S WALLS & 1 FT STRIP BELOW PLASTER ON E WALL. MATERIALS	W 9/1996 S NWE	352 SF	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect c verification.		1ST FLOOR		SIS Bldg #:	g#: 3617

).						j
Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	66/80/90
_		340		Zin Cot	County	
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	AN ST		10	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
M47	9 IN WHITE WIGHAY	OF THIS TYPE MAY CONTAIN ASBESTOS. FLOOR. MATERIALS OF THIS	9/1996	204 SF	L ASS	ASSUMED POS.
WALL BASE [M22]	STREAKS & MASTIC. 4 IN BLACK VINYL W/MASTIC.	TYPE MAY CONTAIN ASBESTOS. ON N, S & W WALLS AT FLOOR.	0,	46 LF	L ASS	ASSUMED POS.
		BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	Ш Ж Х			
BUILDING 1, ROOM 116A [R110]			wis, and american			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 · NWE	221 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL & UPPER 2 FT OF E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 1 NWE	16 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	IG 9/1996 NWE F	25 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL & 1 FT STRIP BELOW PLASTER ON E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 LS NWE	35 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY	FLOOR. MATERIALS OF THIS	9/1996	221 SF	L AS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the tor a listing of suspect tic verification.		1ST FLOOR		SIS Bldg #:	dg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
					4	
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address Address DISTRICT 11 OFFICE 2829 JU.	Address 2829 JUAN ST SAN DIEGO		92110 S/	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
	STREAKS & MASTIC.	TYPE MAY CONTAIN ASBESTOS.	NWE			
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N, S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996	46 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 116B [R111]					•	
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	204 SF	s AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S & W WALL & S 5 FT OF E WALL OPPER 2 FT OF N 6 FT OF E WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	8 9/1996 L. NWE	40 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	23 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	1 FT STRIPE BELOW PLASTER N 6 FT OF E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	6 9/1996 NWE	7 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	204 SF	L AS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE	/E 9/1996	58 LF	L AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the t for a listing of suspect lic verification.	-	1ST FLOOR	~	SIS BIdg #:	dg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name	Facility Add	Address City ST SAN DIEGO		Zip Co	County SAN DIEGO	
			.			
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NW			
BUILDING 1, ROOM 115 [R112]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	E CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	988 SF	s ASS	ASSUMED POS.
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	PATCHED AREA IN NAW CORNER CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	3 9/1996 NWE	30 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TH WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 1 9/1996 E NWE	180 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	NG 9/1996 NWE F	110 SY	C ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M47]	9 IN X 9 IN WHITE W/GRAY STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	T. 9/1996 NWE	988 SF	C ASS	ASSUMED POS.
WALL BASE [M57]	4 IN BLUE VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	VE 9/1996 NWE	162 LF	L ASS	ASSUMED POS.

SIS Bldg #: 3617

1ST FLOOR

Page: **64**

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect

NOTE:

materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report	and the second second	J ,-	Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
BUILDING 1, NORTHEAST STAIRWELL [R113]	3]					
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	MIDDLE & UPPER LANDING CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	75 SF S		ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	55 SY L		ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	H LANDING CEILINGS. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	8 SY C		ASSUMED POS.
BUILDING 1, SOUTHEAST CORRIDOR [R114]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	1038 SF S		ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H N 26 FT OF E & W WALLS, S 38 FT OF E WALL & N & S WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	92 SY 1	ASSUM	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	H CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF	9/1996 NWE	115 SY (C ASSUM	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved, See the or a listing of suspect verification.		1ST FLOOR		SIS Bldg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report	1		Dept: Date:	DOT
SIS Bldg # Building Name	Facility Ado	Address		Zip Cot	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 282	AN ST	÷	10	SAN DIEGO	
Room/Area Name [R#]	Room Notes		Survey	To T		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm		Units Priority	Status
,		THIS TYPE MAY CONTAIN ASBESTOS.	Secure and control and an			
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	UPPER 1 FT OF E & W WALLS ABOVE METAL PREFABRICATED WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	202 SF	L ASSU	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	1038 SF	L PC	POSITIVE
WALL BASE [M43]	4 IN OLIVE VINYL WMASTIC.	ON N 26 FT OF E & W WALLS, S 38 FT OF E WALL & N & S WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	104 LF	L ASSU	ASSUMED POS.
BUILDING 1, SOUTHEAST STAIRWELL [R115]	5]					
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	130 SF	S ASSL	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TH WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	1 9/1996 NWE	289 SY	L ASSU	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	14 SY	C ASSU	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the or a listing of suspect verification.		1ST FLOOR		SIS Bldg #:	# 3617

at the contract

SIS Bldg # 3617

Room/Area Assessment Report

DOT 66/80/90

> Date: Dept:

Building Name	Facility	Address	<u>City</u>	Zip County	
DISTRICT OFFICE	DISTRICT 11 OFFICE	2829 JUAN ST	SAN DIEGO	92110 SAN DIEGO	
a Name [R#] Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey es Date/Firm	Est. m Qty. Units Priority	ACM Status

ASSUMED POS.

5 SY

9/1996 NWE

FLOOR OF UPPER LANDING. VINYL SAMPLED ND. MASTIC

6 FT GRAY VINYL W/WHITE

RESILIENT FLOORING (SHEETS) [M71]

Material Specification Name [M #]

Room/Area Name [1

STREAKS & MASTIC.

4 IN MOSS GREEN VINYL

WALL BASE [M61]

W/MASTIC.

BUILDING 3, LOBBY [R116]

ASSUMED POSITIVE.

ASSUMED POS.

28 LF

9/1996 NWE

LANDING. BASECOVE ASSUMED ON WALLS AT FLOOR OF UPPER

NEGATIVE. MASTIC ASSUMED

POSITIVE.

ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE	CEILING. SUSPENDED CEILING	9/1996	801 SF	NONE
	MEDIUM FISSURE PATTERN.	SYSTEM.	NWE		DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH N, E & W WALLS & W 10 FT OF S	N, E & W WALLS & W 10 FT OF S	9/1996	152 SY	NONE

801 SF NONE DETECTED	152 SY NONE DETECTED	801 SF C POSITIVE	14 LF L ASSUMED POS.
9/1996 NWE	9/1996 NWE	9/1996 • NWE	9/1996 NWE
CEILING. SUSPENDED CEILING SYSTEM.	N, E & W WALLS & W 10 FT OF S WALL. INSTALLED IN BUILDING 3 ONLY.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	ON E 14 FT OF S WALL AT FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.
1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	4 IN LIGHT GRAY VINYL W/MASTIC.
ACOUSTICAL (PANELS) [M25]	FINISH PLASTER [M20]	RESILIENT FLOORING (TILES) [M8]	WALL BASE [M52]

	Data audited and substandard records removed. See the	
COTE:	NOTE: Homogeneous Material Summary Report for a listing of suspect	
	motorials observed Data requires pariadis verification	

Page: **67**

3617 SIS Bldg #:

1ST FLOOR

ASSUMED POS.

103 LF

9/1996 NWE

WALLS. BASECOVE ASSUMED

W 10 FT OF S WALL, N, E & W

6 IN LIGHT GRAY VINYL W/MASTIC.

WALL BASE [M58]

NEGATIVE. MASTIC ASSUMED

POSITIVE.

Heal Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Add DISTRICT 11 OFFICE 282	Address. 2829 JUAN ST SAN DIEGO		Zip County. 92110 SAN DIEGO	OS.
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 3, LOBBY OFFICE [R117]			.		
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH S WALL & CEILING. INSTALLED IN BUILDING 3 ONLY.	NWE	20 SY	NONE DETECTED
BUILDING 3, JANITOR STORAGE 1 [R118]		-			
FINISH PLASTER [M59]	GRAY TROWELED-ON METAL LATH COARSE W/SCRATCH COAT STUCCO, PAINTED.	TH CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	62 SY L A	ASSUMED POS.
BUILDING 3, NORTH STAIRWELL [R120]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	378 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH WALLS. INSTALLED IN BUILDING ONLY.	3 9/1996 NWE	130 SY	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE MIDDLE LANDING FLOOR.	9/1996 NWE	108 SF L	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON MIDDLE LANDING WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	22 LF L A	ASSUMED POS.
					·
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	89	1ST FLOOR	SIS	SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report	enga engantenga	Dept:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 2, CEILING SPACE 1 [R160]	UNABLE TO PHYSICALLY	E TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	URES. LIMI	TED VISUAL ACCESS	ONLY.
DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	EXTERIOR SURFACE OF AIR DUCT.	9/1996 NWE	1600 SF	NONE DETECTED
BUILDING 1, CEILING SPACE 1 [R161]	UNABLE TO PHYSICALLY	E TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	URES. LIMI	TED VISUAL ACCESS	ONLY.
DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	EXTERIOR SURFACE OF AIR DUCT.	9/1996 NWE	1120 SF	NONE DETECTED
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	AIR DUCT JOINT. CONCEALED BY DUCT INSULATION. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	C ASK	ASSUMED POS.
BUILDING 1, CEILING SPACE 2 [R162]	UNABLE TO PHYSICALLY	E TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	URES. LIMI	TED VISUAL ACCESS	ONLY.
DUCT INSULATION [M68]	6 IN DIA YELLOW FIBERGLASS W/GRAY VINYL JACKET FLEX DUCT.	FLEX REGISTER DUCTS. T. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE	AS	ASSUMED NEG.
DUCT INSULATION [M69]	6 IN X 18 IN YELLOW FIBERGLASS W/SILVER FOIL JACKET FIRM DUCT.	MINOR SUPPLY DUCTS. T. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE	AS	ASSUMED NEG.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	ON SHEET METAL AIR DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 NWE	75 LF L AS(ASSUMED POS.
			ili en navono relicoreza navi e resulta.		

SIS Bldg #: 3617

1ST FLOOR

Page: 69

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area A	Room/Area Assessment Report	t.		Dept: Date:	DOT 06/80/99
SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address. 2829 JUAN ST	City SAN DIEGO		Zip County 92110 SAN DIEGO	C
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes		Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 1, CEILING SPACE 3 [R163]	UNABLE TO PHYSIC	LE TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	RUCTIVE MEA	SURES. LIMIT	FED VISUAL ACCES	S ONLY.
DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	P. EXTERIOR SURFACE OF AIR DUCT.	CE OF AIR	9/1996 NWE	632 SF	NONE DETECTED
BUILDING 1, CEILING SPACE 4 [R164]	UNABLE TO PHYSIC	UNABLE TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	RUCTIVE MEA	SURES. LIMIT	TED VISUAL ACCES	S ONLY.
DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	P. EXTERIOR SURFACE OF AIR DUCT.	CE OF AIR	9/1996 NWE	1360 SF	NONE DETECTED
BUILDING 2, PIPECHASE 1 [R174]	NO SUSPECT MATE	SPECT MATERIALS OBSERVED IN ROOM.		om "e seminormania in come e esse		
EXTERIOR WALLS [R277]	NO SUSPECT MATE	SPECT MATERIALS OBSERVED IN ROOM.	_	cues une cue sen edentaleles estado que estado escuente		

SIS Bldg #: 3617

1ST FLOOR

Page: 70

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			. Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cc 92110 S/	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	. Priority	ACM Status
BUILDING 2, ROOM 228 [R166]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	3215 SF	S ASSI	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	3215 SF	L	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL WIMASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	228 LF	L ASSI	ASSUMED POS.
BUILDING 2, ROOM 228A [R167]						•
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	144 SF	S ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	144 SF	L P	POSITIVE
BUILDING 2, JANITORS CLOSET 2 [R168]						
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	N, S & E WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	17 SY	L ASS	ASSUMED POS.
Control to the body of the body of the control of t	Control Control				,	
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	ved. see the a listing of suspect erification.		2ND FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	66/80/90
Sis Building Name Sis Building Name Sis Si	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	City. AN ST SAN DIEGO		Zip Co	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 2, MENS RESTROOM 2 VESTIBULE [R169]	[R169]					
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE. W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	36 SF	s ASS	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	N & E WALLS. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	11 87	L ASS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	¥ S ¥	C AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR. TILE SAMPLED POSITIVE.	9/1996 NWE	36 SF		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	.	24 LF	L AS	ASSUMED POS.
BUILDING 2, MENS RESTROOM 2 [R170]						
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	51 SY	L AS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the or a listing of suspect verification.		2ND FLOOR	Œ	SIS Bldg #:	ldg #: 3617

			-		Dent:	DOT
Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units	Units Priority	ACM
BUILDING 2, MENS RESTROOM 2 STORAGE [R171]	ae [R171]					
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	26 SY	L AS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 LF	L AS	ASSUMED POS.
BUILDING 2, ROOM 226 [R172]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1176 SF	S S	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	1176 SF	.	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE.	9/1996 NWE	112 LF	L A	ASSUMED POS.
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	MASTIC ASSUMED POSITIVE. ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	28 LF	L A	ASSUMED POS.
			r			

SIS Bldg #: 3617

2ND FLOOR

Page:

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

)	
Asb Rev	Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report	a sayan gagananin magana		Dept: Date:	DOT 06/08/99
	SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	SAN DIEGO		Zip Cou	County SAN DIEGO	Q
Ē	Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
]8-	BUILDING 2, PIPECHASE 2 [R173]						
	PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS ON DOMESTIC HOT & COLD WATER RUNS.	9/1996 NWE	3 EA	<u></u>	POSITIVE
	PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	VERTICAL DOMESTIC HOT WATER RUN.	R 9/1996 NWE	8 LF		POSITIVE
	PIPE INSULATION (HIGH TEMP) [M9]	1 1/2 TO 2 IN DIA GRAY AIRCELL W/CANVAS WRAP.	VERTICAL DOMESTIC COLD WATER RUN.	9/1996 NWE	8 LF	_	POSITIVE
ਕ	BUILDING 2, WOMENS LOUNGE 2 [R175]						
	ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	131 SF	S	ASSUMED POS.
	FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	N & S WALLS. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	24 SY	, ,	ASSUMED POS.
	FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	14 SY	O	ASSUMED POS.
	RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	131 SF		POSITIVE
	WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	VE 9/1996 NWE	43 LF	<u>ـ</u>	ASSUMED POS.
	Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	loved. See the or a listing of suspect verification.		2ND FLOOR	œ	SIS	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report		,	Dept:	DOT 06/08/99
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		ZID CO 92110 SA	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM Status
BUILDING 2, WOMENS RESTROOM 2 VESTIBULE [R176]	TIBULE [R176]	-				
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE. WMASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	20 SF	s AS	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.		9/1996 NWE	4 SY	L AS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.		9/1996 NWE	2 SY	C A§	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	20 SF	لــ	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL WIMASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	18 LF	L A	ASSUMED POS.
BUILDING 2, WOMENS RESTROOM 2 [R177]	1/1					
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	H WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	43 SY	٦	ASSUMED POS.

66/80/90 DOT

SIS Bldg #: 3617

2ND FLOOR

Ŋ

Page:

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 2, SWITCH ROOM 2 [R178]			_			
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR, TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	27 SF		POSITIVE
BUILDING 2, SOUTH CORRIDOR [R179]				•		
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE EISSLIRE WMASTIC	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	490 SF	S AS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY	9/1996 NWE	54 SY	C AS	ASSUMED POS.
		ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.				
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STRFAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	490 SF	ــ ـا	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	88 LF	L AS	ASSUMED POS.
BUILDING 2, SOUTH VESTIBULE [R180]	•					
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	91 SF	S AS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	, CEILING. INSTALLED IN BUILDING 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	10 SY	ο	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect lic verification.		2ND FLOOR	· ~	SIS Bldg #:	dg #: 3617

66/80/90 DOT

Real Estate Services Division	Room/Area Assessment Report	ssment Report		Dept:	DOT 06/08/99
Aspestos Program Rev. 07/30/98			i		
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	ZID 92110	County 0 SAN DIEGO	05
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Est. Date/Firm Qty.	Est. Qty. Units Priority	ACM / Status
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	ASBESTOS. N, E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 330 NWE	330 SF L A	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 91 NWE	91 SF L	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	40 LF L A	ASSUMED POS.
BUILDING 2, ROOM 222A [R181]			-		
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL, UPPER 3 FT OF W 16 FT OF N WALL & E 4 FT OF N WALL MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 380 NWE	380 SF L #	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	360 SF L	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	26 LF L	ASSUMED POS.

DOT 66/80/90

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed, Data requires periodic verification.

NOTE:

SIS Bldg #: 3617

2ND FLOOR

		•		ם	Dept: DOT
Real Estate Services Division Asbestos Program	Room/Area Asses	rea Assessment Report		П	Date: 06/08/99
Hev. 07/30/98		200		Zip County	ty
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility. DISTRICT 11 OFFICE 2829 JU	ANST		10	SAN DIEGO
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units P	ACM Priority Status
Material Specification Natife [M #]					
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY	9/1996 NWE	240 SF	S ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	320 SF	L ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. TILE SAMPLED POSITIVE. MASTIC ASSLIMED POSITIVE.	r. 9/1996 C NWE	240 SF	C POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	64 LF	L ASSUMED POS.
BUILDING 2, ROOM 222 [R183]				,	
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	я. 9/1996 NWE	448 SF	S ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S & W WALLS, W 10 FT OF N WALL & S 20 FT OF E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	LL. 9/1996 NWE	740 SF	L ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	/E. 9/1996 NWE	448 SF	L POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE	VE 9/1996	88 LF	L ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	σ.	2ND FLOOR	æ	SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report			Dept: Date:	DOT
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Add DISTRICT 11 OFFICE 2828	Address City 2829 JUAN ST SAN DIEGO		ZID CO 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 2, ROOM 222C [R184]			n an an angaran manan ngan			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	8. 9/1996 NWE	192 SF	s ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL & UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	216 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	192 SF	<u>-</u>	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF	L ASS	ASSUMED POS.
BUILDING 2, ROOM 222D [R185]			are miner			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3. 9/1996 NWE	192 SF	S ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL & UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	216 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	192 SF	٠	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR.	9/1996	24 LF	L ASS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	. Page:	ග	2ND FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report	· · · · · · · · · · · · · · · · · · ·		Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU.	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
Material Specification range [w #]		BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 2, ROOM 222F [R186]	٠					
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	240 SF	S ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S & W WALLS, W 4 FT OF N WALL & UPPER 3 FT OF E 16 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	408 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	. 9/1996 NWE	240 SF		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	64 LF	L AS	ASSUMED POS.
BUILDING 2, ROOM 222E [R187]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	192 SF	S AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	W WALL & UPPER 3 FT OF N & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	216 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	192 SF	_	POSITIVE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	10	2ND FLOOR	· m	SIS BIdg #:	dg #: 3617

DOT

Dept:

						<i>:-</i>
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	24 LF	L AS	ASSUMED POS.
BUILDING 2, COPY ROOM [R188]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.), 9/1996 NWE	48 SF	S A	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	140 SF	L A	ASSUMÉD POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	48 SF	-	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	14 LF	L A	ASSUMED POS.
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	14 LF	٦	ASSUMED POS.
BUILDING 2, ROOM 220 [R189]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE WIMEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1040 SF	S S	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL, E 4 FT OF S WALL & UPPER 3 FT OF W 16 FT OF S	9/1996 NWE	608 SF	L A	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.		2ND FLOOR	·	SIS	SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Room/Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 28:	Address City 2829 JUAN ST SAN DIEGO	O	Zip Cou 92110 SA	County SAN DIEGO	_
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		WALL, MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	Ш			
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	VE. 9/1996 NWE	1040 SF		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	, ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	0VE 9/1996 NWE	144 LF	L ASS	ASSUMED POS.
BUILDING 2, ROOM 221 [R190]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	.R. 9/1996 NWE	1680 SF	s AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	W WALL, W 12 FT & UPPER 3 FT OF E 16 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	768 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	VE. 9/1996 NWE	1680 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	OVE 9/1996 NWE	176 LF	L AS	ASSUMED POS.

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. NOTE:

2ND FLOOR

Page: 12

SIS BIdg #: 3617

Real Estate Services Division Asbestos. Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Ac DISTRICT 11 OFFICE 28	Address City 2829 JUAN ST SAN DIEGO		Zip Co	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	. Priority	ACM Status
BUILDING 2, ROOM 218 [R191]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE WMEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 NWE	240 SF	s As	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	240 SF	٦	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	64 LF	L AS	ASSUMED POS.
BUILDING 2, NORTH VESTIBULE [R192]			er er vere di ligerer ren e e com			
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	E CEILING. TILES SAMPLED ND. , MASTIC ASSUMED POSITIVE.	9/1996 NWE	812 SF.	S AS	ASSUMED POS.
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	INSTALLED IN BUILDING 2 ONLY MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	52 SY	L AS	ASSUMED POS.
FINISH PLASTER [M40]	GRAY TROWELED-ON METAL LATH, SMOOTH, W/OUT SCRATCH COAT.	ATH, CEILING. INSTALLED IN BUILDING AT. 2 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	\S 06	C AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	E. 9/1996 NWE	812 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. PAINTED	9/1996	130 LF	L AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	13	2ND FLOOR		SIS Bldg #:	lg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report	,		Dept: Date:	DOT
SIS BIdg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
	;	WHITE. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 1, ROOM 216 [R193]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 ' NWE	1678 SF	S ASS	ASSUMED POS.
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	UPPER 2 FT OF E 11 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	33 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N & W WALLS, W 25 FT & E 28 FT OF S WALL, UPPER 2 FT OF S 25 FT OF E WALL. PARTIALLY CONCEALED. E 11 FT OF S WALL COVERED W/ACOUSTIC TILES. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	148 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	186 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	1 FT STRIPE BELOW PLASTER ON E 28 FT OF S WALL & S 25 FT OF E WALL. MATERIALS OF THIS TYPE	NWE	53 SF	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.		2ND FLOOR		SIS Bldg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
		MAY CONTAIN ASBESTOS.				
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N 16 FT OF E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	200 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	i) 6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	186 SY	L AS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL WMASTIC.	N & W WALLS & W 25 FT OF S WALL. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	123 LF	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	E 11 FT OF S WALL & N 16 FT OF E WALL. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	27 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 212 [R194]			-			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	216 SF	s AS	ASSUMED POS.
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	UPPER 2 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	36 SF	s AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 E NWE	9 SY	L AS	ASSUMED POS.
, FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH	H CEILING. INSTALLED IN BUILDING	9/1996	24 SY	C AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.		2ND FLOOR		SIS Bldg #:	g#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area A	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address City 2829 JUAN ST SAN DIEGO	0	Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Otty. Units	Units Priority	ACM Status
	W/OUT SMOOTH SCRATCH COAT.	OAT. 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	MW M			
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	8 S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	84 SF	L ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	L ASS	ASSUMED POS.
GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED	& UPPER 2 FT OF S WALL. ED. CONCEALED BY CEILING TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	36 SF	C ASS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 SY	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	C. ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	VE 9/1996 NWE	60 LF	L ASS	ASSUMED POS.
BUILDING 1, ROOM 217B [R195]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	MASTIC ASSUMED POSITIVE.	9/1996 NWE	240 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	LATH N, W & S WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 OF , NWE	51 SY	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	vved. See the r a listing of suspect rerification.	je: 16	2ND FLOOR		SIS BIdg #:	#: 3617

	,					
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name	Facility Address	<u>sss.</u> City		Zip	County	
	DISTRICT 11 OFFICE 2829	ANST	i	10	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
		ASBESTOS.				
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING, INSTALLED IN BUILDING 1 ONLY, CONCEALED BY	9/1996 NWE	27 SY	C ASS	ASSUMED POS.
		ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.				
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	160 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	27 SY	L ASS	ASSUMED POS.
WALL BASE [M21]	4 IN CARAMEL VINYL W/MASTIC.	ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	15 LF	L ASS	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	31 LF	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL WMASTIC.	ON E WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	16 LF	L ASS	ASSUMED POS.
BUILDING 1, ROOM 217 [R196]			Carrier area of the control of the c			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	528 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT,	N, S & E WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF	9/1996 NWE	91 SY	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the or a listing of suspect retilication.	. /	2ND FLOOR		SIS Bldg #:	1#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	Assessm	ent Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City ST SAN DIEGO		Zip Co	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACN	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
	PAINTED.	THI	THIS TYPE MAY CONTAIN ASBESTOS.		į		
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	T	CEILING. INSTALLED IN BUILDING 1 ONLY: CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 NWE	59 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	W V	W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	160 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLC	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	59 SY	L AS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.		ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	'E 9/1996 NWE	98 LF	L AS	ASSUMED POS.
BUILDING 1, ROOM 210 [R197]				manara miningar sara amaranan mas m			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	~	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	324 SF	s AS	ASSUMED POS.
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.		UPPER 2 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	54 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	~ + ~	N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 PE NWE	8 SY	L AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH	_	CEILING. INSTALLED IN BUILDING	G 9/1996	36 SY	C AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.		Page: 18		2ND FLOOR		SIS Bldg #:	lg #: 3617

£.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JU.	Address City 2829 JUAN ST SAN DIEGO		Zip Col 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
	W/OUT SMOOTH SCRATCH COAT."	1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	NWE			
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	L ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	W WALL & PARTITION WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	340 SF	L ASS	ASSUMED POS.
GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED.	UPPER 2 FT OF S WALL. CONCEALED BY CEILING TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	54 SF	C ASS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY RESILIENT FLOORING TILES & RAISED FLOORING. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	29 SY	C ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M70]	12 IN X 12 IN LIGHT GRAY W/GRAY & WHITE FLAKES & MASTIC.	S LANDING FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	60 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M72]	2 FT X 2 FT BROWN FORMICA PANELS W/OFF WHITE FACING.	RAISED FLOOR. RAISED FLOORING SYSTEM. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE		ASS	ASSUMED NEG.
WALL BASE [M42]	4 IN BROWN VINYL WMASTIC.	ON WALLS AT FLOOR. BASECOVE	9/1996	72 LF	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	wed. See the railsting of suspect rerification.		2ND FLOOR		SIS Bldg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Ado	Address City 2829 JUAN ST SAN DIEGO		Zip Col.	County SAN DIEGO	1.
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ļ Ī	ACM Status
		ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 1, COMPUTER SERVICES 1 [R198]						
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	E, W & S WALLS & CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1704 SF	S ASSU	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TH N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	21 SY	L ASSU	ASSUMED POS.
GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED.	E, W & S WALLS & CEILING. CONCEALED BY CEILING TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1704 SF	C ASSU	ASSUMED POS.
RESILIENT FLOORING (TILES) [M70]	12 IN X 12 IN LIGHT GRAY W/GRAY & WHITE FLAKES & MASTIC.	Y S LANDING FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	56 SF	L ASSU	ASSUMED POS.
RESILIENT FLOORING (TILES) [M72]	2 FT X 2 FT BROWN FORMICA PANELS W/OFF WHITE FACING.	RAISED FLOOR. RAISED FLOORING SYSTEM. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE		ASSU	ASSUMED NEG.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	132 LF	L ASSU	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	20	2ND FLOOR		SIS Bldg #:	ŧ: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report	-		Dept: Date:	DOT
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip G	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units	Units Priority	ACM Status
BUILDING 1, COMPUTER SERVICES 2 & CLOSET [R199]	INCLUDE	S SPACE BETWEEN ORIGINAL & RAISED FLOOR.	•			
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1652 SF	S AS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	A W 24 FT OF N & S WALLS & WALLS & WALLS & CEILING OF CLOSET. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	184 SY	L AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E 35 FT OF N & S WALLS, E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1260 SF	L AS	ASSUMED POS.
GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED.	CEILING. CONCEALED BY CEILING TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1652 SF	C AS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	CLOSET FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	4 SY	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M48]	12 IN X 12 IN CREAM W/BROWN & WHITE FLECKS & MASTIC.	N LANDING FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	9 S F	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M70]	12 IN X 12 IN LIGHT GRAY W/GRAY & WHITE FLAKES & MASTIC.	S LANDING FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	20 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M72]	2 FT X 2 FT BROWN FORMICA PANELS W/OFF WHITE FACING.	RAISED FLOOR. RAISED FLOORING SYSTEM. MATERIAL	9/1996 NWE		AS	ASSUMED NEG.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect			***************************************			
materials observed. Data requires periodic verification.	verification. Page: 21		2ND FLOOR		SIS BIdg #:	lg #: 3617

))	
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: Date:	TOO
SIS Bldg # Building Name	Facility Address	<u>ss</u> Cit <u>y</u>		Zip County	Inty	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 2829 J	2829 JUAN ST SAN DIEGO		9	SAN DIEGO	·········
Boom/Area Name [B#]	Doom Motoe			1		
Material Specification Name [M #]	Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
		OBSERVED USUALLY CONTAINS NO ASBESTOS.				
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	174 LF	L ASSUI	ASSUMED POS.
WALL BASE [M61]	4 IN MOSS GREEN VINYL W/MASTIC.	ON CLOSET WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 LF	L ASSUI	ASSUMED POS.
BUILDING 1, NETWORK SWITCH ROOM [R200]	00]					
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	, 9/1996 NWE	38 SY	L ASSU	ASSUMED POS.
BUILDING 1, COMPUTER SERVICES STORAGE [R201]	GE [R201]					
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	. 40 SF	s Assu	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	YS 6	L ASSU	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	55 S	C ASSU	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the ratio of suspect rerification.	· ·	2ND FLOOR		SIS Bldg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Room/Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name	Facility	Address		Zip	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 28	AN ST		10	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priorit	ACM y Status
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	40 SF	ب ا	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	28 LF	٦ /	ASSUMED POS.
BUILDING 1, ROOM 215 [R202]						
ACOUSTICAL (PANELS) [M54]	2 FT X 4 FT WHITE, COARSE DIVOT PATTERN.	OT CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1852 SF	S	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	ATH PARTITION WALL N SIDE OF ROOM. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	20 SY		ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N, E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1340 SF	, ,	ASSUMED POS.
WALL BASE [M74]	4 IN MAUVE VINYL W/MASTIC.	ON WALLS AT FLOOR. WALLBASE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	236 LF	L /	ASSUMED POS.
				·		
,						
,						

2ND FLOOR

Page: 23

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division	Asbestos Program	Rev. 07/30/98

SIS Bldg #

3617

Room/Area Assessment Report

DOT 66/80/90 Dept: Date: Zip County 92110 SAN DIEGO SAN DIEGO City **2829 JUAN ST** Address DISTRICT 11 OFFICE Facility DISTRICT OFFICE Building Name

Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes Da	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 215A [R203]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	169 SF	S	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	12 SY	L	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	19 SY	۷ ن	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S, E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	312 SF	L A	ASSUMED POS.
WALL BASE [M74]	4 IN MAUVE VINYL W/MASTIC.	ON WALLS AT FLOOR. WALLBASE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	. 52 LF	L	ASSUMED POS.

	_	
	7	
4	•	
0		
7		
W		
~		
	١.	
_		
_		
C		
-		
$\overline{}$		
_		
$\overline{}$		
u		
m		
ц,		
C)		
ш		
~		
ц,		
m		
•		
Ż		
ш		
_		
2		
$\overline{}$		
•		
=		
-		
-		
_		
	•	
•		
m		
\mathbf{z}		
~		
-		
J		
_		
1		
=		
=		
_	_	
=		

COMPOUND & TAPE, TEXTURED, 4 FT X 8 FT SHEETS W/JOINT PAINTED. GYPSUM WALLBOARD [M75]

9/1996 NWE TILE. MATERIALS OF THIS TYPE WALLS COVERED W/CERAMIC WALLS & CEILING. PARTIALLY CONCEALED. LOWER 6 FT OF MAY CONTAIN ASBESTOS.

ASSUMED POS.

446 SF

Page: 24 Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

Data audited and substandard records removed. See the

NOTE:

2ND FLOOR

SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area A	/Area Assessment Report	t		ăă	Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes		Survey Date/Firm	Est. Oty. Units Priority		ACM Status
BUILDING 1, VERTICAL DUCT CHASE [R205]	UNABLE TO PHYSIC PLANS. ROOM/AREA	E TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM ROOM/AREA NOT ACCESSED.	WOUT DESTRI	JCTIVE ME	ASURES. IDENT	IIFIED FR	OM
BUILDING 1, JANITOR CLOSET 3 [R206]				iti aan aa aa aa aa a			
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	L LATH N, S & E WALLS & CEILING. PARTIALLY CONCEALED. W 6 FT OF S WALL COVERED W/GYPSUM INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	LED. W 6 FT D W/GYPSUM. ING 1 ONLY. TYPE MAY	9/1996 NWE	28 SY L	ASSUM	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	& W WALL & W 6 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	S WALL. TYPE MAY	9/1996 NWE	7 JS 06	ASSUN	ASSUMED POS.
BUILDING 1, PIPECHASE 2 [R207]							
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	& N, E & W WALLS & CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	EILING. TYPE MAY	9/1996 NWE	306 SF	ASSUN	ASSUMED POS.
-							
			,	······································			

2ND FLOOR

Page: 25

NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

)	
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS BIdg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
BUILDING 1, MENS RESTROOM 2 [R208]						
GYPSUM WALLBOARD [M75]	4 FT X 8 FT SHEETS W/JOINT COMPOUND & TAPE, TEXTURED, PAINTED.	WALLS & CEILING. PARTIALLY CONCEALED. LOWER 6 FT OF WALLS COVERED W/CERAMIC TILE. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	640 SF	L ASSU	ASSUMED POS.
BUILDING 1, CONCEALED SPACE 2 [R209]	UNABLE TO PHYSICALLY OR VISUALI PLANS. ROOM/AREA NOT ACCESSED	UNABLE TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM PLANS. ROOM/AREA NOT ACCESSED.	UCTIVE ME	ASURES. IDE	NTIFIED F	ROM
BUILDING 1, NORTH CORRIDOR 2 [R210]						
ACOUSTICAL (TILES) [M7]	1 FT X 1 FT WHITE VERY COARSE FISSURE, W/MASTIC.	CEILING, S CENTER LEG OF ROOM. TILES SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	119 SF	s Assu	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	E WALL & PORTIONS OF S WALL & CEILING. INSTALLED W/GYPSUM ALONG S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	250 SY	L ASSU	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING, S CENTER LEG OF ROOM. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	13 SY	C ASSU	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	loved. See the or a listing of suspect verification.		2ND FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cor 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL & PORTIONS OF S WALL. INSTALLED W/PLASTER ALONG S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1060 SF	L ASSI	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M16]	6 FT ROLLED GREEN MARBLE PATTERN LINOLEUM W/MASTIC.	FLOOR. FLOORING SAMPLED ND. MASTIC ASSUMED POSITIVE. BUILDING 3.	9/1996 NWE	113 SY	L ASSI	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	306 LF	L ASSI	ASSUMED POS.
BUILDING 1, NORTH VESTIBULE 1 [R211]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	270 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	1 9/1996 NWE	33 SY	L ASSI	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	30 SY	C ASSI	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M16]	6 FT ROLLED GREEN MARBLE PATTERN LINOLEUM W/MASTIC.	FLOOR. FLOORING SAMPLED ND. MASTIC ASSUMED POSITIVE. BUILDING 3.	9/1996 NWE	30 SY	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the in a listing of suspect verification.		2ND FLOOR		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	/Area Assessment Report			Dept: Date;	DOD .
SIS Bldg # Building Name 3617 DISTRICT OFFICE	FacilityAddressDISTRICT 11 OFFICE2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cc 92110 S/	County SAN DIEGO	30
		,	•			
Room/Area Name [R#] Material Specification Name IM #1	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Otv. Units Priority	Priorit	ACM
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	74 LF	٦	SSO
BUILDING 1, PENTHOUSE STAIRWELL [R212]	2]					
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	100 SY	٦	ASSUMED POS.
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOW ON DOMESTIC WATER RUN.	9/1996 NWE	1 EA	٦	POSITIVE
PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	HORIZONTAL DOMESTIC WATER RUN, 1 FT BELOW CEILING AT E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	12 LF	_ <u></u>	POSITIVE
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR OF LOWER LANDING. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	2 SY		ASSUMED POS.
WALL BASE [M61]	4 IN MOSS GREEN VINYL W/MASTIC.	ON WALLS AT FLOOR OF LOWER LANDING. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	13 LF	- T	ASSUMED POS.

2ND FLOOR

Page: 28

Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area	Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City AN ST SAN DIEGO		Zip Cc	County SAN DIEGO	Og.
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description		ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM Status
BUILDING 1, NORTHEAST VESTIBULE [R213]							
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	NUM S &	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	108 SF	S A	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TAL LATH	W WALL & W 5 FT OF S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	8 SY	٠ ا	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	D-ON METAL LATH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	12 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	PE & ED.	N WALL & E 22 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	392 SF	∀	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	ન <i>ત</i>	E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	32 SF	٦	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	Ш	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	12 SY	اً ا	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL WMASTIC.	STIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	62 LF	ر ا	ASSUMED POS.

2ND FLOOR

Page: 29

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program	Room/Area Asses	Area Assessment Report	•		Dept:	DOT
					-	-
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	i	2lp Cc 92110 SA	County SAN DIEGO	O.
Hoom/Area Name [H#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM
BUILDING 1, ROOM 200 [R214]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	1183 SF	۷ ۷	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	E 26 FT OF N & S WALLS & E WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	111 SY	L A	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	131 SY	O	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N 20 FT OF W WALL, W 13 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	330 SF	L A	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S 17 FT OF W WALL, W 13 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	300 SF	L A	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	131 SY	L A	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	174 LF	L A	ASSUMED POS.

NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. Data audited and substandard records removed. See the

2ND FLOOR

Page: 30

SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name	Facility Address	S		Zip Cot	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 2829 JI	2829 JUAN ST SAN DIEGO		92110 SA	SAN DIEGO	···
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 200A [R215]			ermane imer mannen er			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	192 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 2 FT OF W WALL & S WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	}S 6	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	21 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N & E WALLS, LOWER 7 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	408 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	21 SY	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	56 LF	L ASS	ASSUMED POS.

2ND FLOOR

Page: 31

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report	J		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Ad DISTRICT 11 OFFICE 28	Address City. 2829 JUAN ST SAN DIEGO		Zip Co	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units	Units Priority	ACM Status
BUILDING 1, PAPER STORAGE [R216]			•			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	360 SF	S ASSI	A <u>s</u> SUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING T. 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	40 SY	C ASSI	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL & S 14 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	304 SF	L ASSI	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S & E WALLS, N 4 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	304 SF	L ASSI	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	40 SY	L ASSI	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL WMASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	76 LF	L ASSI	ASSUMED POS.

Page: 32

2ND FLOOR

SIS Bldg #: 3617

)	ŀ
Real Estate Services Division Asbestos Program	Room/Area Assessment Report	ssment Report			Dept: Date:	66/80/90
SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority Si	ACM
BUILDING 1, ROOM 201D [R217]	7 FT PARTITION WALL ON W SIDE OF ROOM	N SIDE OF ROOM.				
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WIMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	3268 SF	•	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	UPPER 4 FT OF N WALL, W 15 FT OF S WALL & N 120 FT OF E WALL INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	137 SY	L ASSUM	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	_	9/1996 NWE	363 SY	C ASSUN	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S 6 FT OF E WALL & E 13 FT OF S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	190 SF	L ASSUI	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	W WALL & LOWER 7 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 E NWE	1128 SF	L ASSÚ	ASSÜMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	T. 9/1996 NWE	363 SY	C ASSU	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON N & W WALLS, N 12 FT OF E WALL & W 16 FT OF S WALL AT FLOOR. BASECOVE ASSUMED	9/1996 NWE	319 LF	L ASSU	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect coverification.	m	2ND FLOOR	٣.	SIS Bldg	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	/Area Assessment Report	age is, consistence and an analysis of the second		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	_	Zip Cc 92110 S/	County SAN DIEGO	Q
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
	0-	NEGATIVE. MASTIC ASSUMED POSITIVE.				
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON S 6 FT OF E WALL & E 13 FT OF S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	19 LF	L A	ASSUMED POS.
BUILDING 1, ROOM 201A [R218]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	210 SF	ω A	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W 8 FT OF N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	N 9/1996 F NWE	7 SY	٦ ۲	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	23 SY	∢ O	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	L A	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E 6 FT OF N WALL, E & S WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	280 SF	L	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL WWHITE	FLOOR. VINYL SAMPLED ND.	9/1996	23 SY	٦	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect c verification.		2ND FLOOR		SIS	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report	_		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	0	Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority		ACM Status
WALL BASE [M21]	STREAKS & MASTIC. 4 IN CARAMEL VINYL W/MASTIC.	MASTIC ASSUMED POSITIVE. ON S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE 9/1996 E. NWE	14 LF	L ASSU	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON E WALL & E 6 FT OF N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 ED NWE	21 LF	L ASSU	ASSUMED POS.
BUILDING 1, CONCEALED SPACE 3 [R219]	UNABLE TO PHYSICALLY OR VISUALL PLANS. ROOM/AREA NOT ACCESSED.	TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM 300M/AREA NOT ACCESSED.	TRUCTIVE ME	:ASURES. IDEI	NTIFIED F	ROM
BUILDING 1, CONCEALED SPACE 4 [R220]	UNABLE TO PHYSICALLY OR VISUALL PLANS. ROOM/AREA NOT ACCESSED.	UNABLE TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM PLANS. ROOM/AREA NOT ACCESSED.	TRUCTIVE ME	ASURES. IDE	NTIFIED F	ROM
BUILDING 1, LIBRARY [R221]				,		
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	N 9/1996 DF NWE	230 SY	L ASSU	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	75 SY	L ASSU	ASSUMED POS.
WALL BASE [M61]	4 IN MOSS GREEN VINYL W/MASTIC.	ON WALLS AT FLOOR. PAINTED BLACK. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED	9/1996 NWE	174 LF	L ASSU	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the railsting of suspect verification.		2ND FLOOR		SIS Bldg #:	: 3617

Asbestos Program Rev. 07/30/98	Hoom/Area Assessment Report	sment Report			Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		POSITIVE.				
BUILDING 1, ROOM 232B [R222]	7 FT S & E PARTITION WALLS.	S,	-			
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	, 1881 SF	s ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL & UPPER 3 FT OF N WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	113 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	209 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	LOWER 8 FT OF N & S WALLS & E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	984 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6. FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	209 SY	C ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	228 LF	L ASS	ASSUMED POS.
	noved. See the					
NOTE: Homogeneous Material Summary Report for a listing of suspect	Aeport for a listing of suspect				0	1. 5647

2ND FLOOR

Page: 36

materials observed. Data requires periodic verification.

DOT

Dept:

Room/Area Assessment Report

Real Estate Services Division Asbestos Program

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 1, OFFICE 232B [R223]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	144 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	W WALL. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 5E NWE	13 SY	L ASS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	16 SY	C ASS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	192 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	16 SY	L ASS	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON N & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF	L ASS	ASSUMED POS.
WALL BASE [M61]	4 IN MOSS GREEN VINYL W/MASTIC.	ON W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	12 LF	L ASS	ASSUMED POS.

SIS Bldg #: 3617

2ND FLOOR

Page: 37

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect

NOTE:

materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address 2829 JUAN ST SAN DIEGO		<u>Zip</u> Co 92110 SA	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOM 231 [R224]						,
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	208 SF	s AS	ASSUMED POS.
FINISH PLASTER [M45].	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S & E WALLS & S B FT OF W WALL. CONCEALED BY GYPSUM & WOOD PANELING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	L. 9/1996 3D NWE F	43 SY	O AS	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	G 9/1996 NWE	23 SY	C AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL & N 6 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	190 SF	L AS	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	UPPER 7 FT OF S WALL & UPPER 7 FT OF S 8 FT OF E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	245 SF	L AS	ASSUMED POS.
OTHER SUSPECT MATERIALS [M38]	4 FT X 8 FT WOOD PANELING W/MASTIC.	LOWER 4 FT OF S, E & W WALLS PANELING ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	168 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE	FLOOR. VINYL SAMPLED ND.	9/1996	23 SY	L AS	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the or a listing of suspect verification.		2ND FLOOR	•	SIS Bldg #:	lg #: 3617

)			_	-			
Real Estate Services Division Asbestos Program Rev. 07/30/98		Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name	-	Facility Address	S		Si diZ	County	
3617 DISTRICT OFFICE		DISTRICT 11 OFFICE 2829 JI	2829 JUAN ST SAN DIEGO		92110 SA	SAN DIEGO	05
Room/Area Name [R#]		Room Notes		Survey	Est.	: (
Material Specification Name [M #]	[M #]	Material Description	ACM Location/Notes	Date/Firm	Oty. Units	Units Priority	Status
		STREAKS & MASTIC.	MASTIC ASSUMED POSITIVE.	NWE			
WALL BASE [M22]	- iii - iii	4 IN BLACK VINYL W/MASTIC.	ON S, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE.	9/1996 NWE	42 LF	L	ASSUMED POS.
		•	יייאכווס אפסטואורם רספוווארי				-
WALL BASE [M42]		4 IN BROWN VINYL W/MASTIC.	ON N WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 . NWE	16 LF	L A	ASSÚMED POS.
BUILDING 1, ROOM 232A [R225]	[2]						
ACOUSTICAL (TILES) [M44]	·	1 FT X 1 FT WHITE W/MEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	165 SF	ω «	ASSUMED POS.
FINISH PLASTER [M45]		GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	S & W WALLS. INSTALLED IN BUILDING 1 ONLY, MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	29 SY	٦	ASSUMED POS.
FINISH PLASTER [M46]		GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	3 9/1996 NWE	18 SY	O	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	4EETS) [M71:]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	18 SY	1	ASSUMED POS.
WALL BASE [M61]		4 IN MOSS GREEN VINYL W/MASTIC.	ON S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	26 LF	7	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect	dard records remo	removed. See the fort for a listing of suspect		i		Č	: :

2ND FLOOR

Page: 39

materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program	Room/Area Ass	Area Assessment Report	era amerika (h.)	*	Dept:	DOT
Rev. 07/30/98		•			Date:	66/80/90
SIS Bldg # Building Name	Facility	Address City		Zip Cot	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 282	2829 JUAN ST SAN DIEGO		92110 SA	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority S	ACM Status
BUILDING 1, NORTHEAST CORRIDOR [R226]						
ACOUSTICAL (TILES) [M44]	1 FT X 1 FT WHITE WMEDIUM UNIFORM PERFORATIONS & MASTIC.	CEILING. TILE SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	1069 SF	s ASSUN	ASSUMED POS.
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	TH N 13 FT OF E WALL, N 40 FT OF W WALL, N & S WALLS. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	70 SY	L ASSUN	ASSUMED POS.
FINISH PLASTER [M46]	GRAY TROWELED-ON METAL LATH W/OUT SMOOTH SCRATCH COAT.	TH CEILING. INSTALLED IN BUILDING 1 ONLY. CONCEALED BY ACOUSTIC TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	119 SY	C ASSUN	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	BUILD-OUT WALLS N END OF ROOM. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 : NWE	112 SF	L ASSUI	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W PARTITION WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1712 SF	L ASSUI	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M71]	6 FT GRAY VINYL W/WHITE STREAKS & MASTIC.	FLOOR EXCLUDING MEZZANINE LANDING. VINYL SAMPLED ND. MASTIC ASSUMED POSITIVE.	9/1996 NWE	119 SY	L ASSUI	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	MEZZANINE LANDING FLOOR. TILE SAMPLED POSITIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	30 SF	L PO	POSITIVE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	40	2ND FLOOR		SIS Bldg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM riority Status
WALL BASE [M21]	4 IN CARAMEL VINYL WMASTIC.	ON MAJORITY OF WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	214 LF	L ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	PATCHES ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	15 LF	ASSUMED POS.
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	PATCHES ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	28 LF	ASSUMED POS.
WALL BASE [M61] BUILDING 2, CEILING SPACE 2 [R256]	4 IN MOSS GREEN VINYL W/MASTIC.	ON N 40 FT OF W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	40 LF	- ASSUMED POS.
BUILDING INSULATION (THERMAL) [M14]	ROLLED YELLOW FIBERGLASS WIBLACK PAPER BACKING.	FLOOR. NEITHER COMPONENT IS A SUSPECT MATERIAL.	9/1996 NWE	3215 SF	NONE DETECTED
DUCT INSULATION [M68]	6 IN DIA YELLOW FIBERGLASS W/GRAY VINYL JACKET FLEX DUCT.	EXTERIOR SURFACE OF AIR DUCT. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE		ASSUMED NEG.

SIS Bldg #: 3617

2ND FLOOR

Page: 41

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Dept: DOT Date: 06/08/99	SO COUNTY SO 92110 SAN DIEGO	Survey Est. ACM Date/Firm Qty. Units Priority Status		FIS 9/1996 9645 SF NONE NWE DETECTED	9/1996 ASSUMED NEG.		9/1996 ASSUMED NEG.	9/1996 75 LF L ASSUMED POS. NWE		T IS 9/1996 6355 SF NONE NWE NWE	9/1996 465 SF NONE NWE DETECTED	9/1996 70 CF NONE NWE DETECTED	2ND FLOOR SIS Bldg #: 3617
sement Report	Address. 2829 JUAN ST SAN DIEGO	ACM Location/Notes		FLOOR. NEITHER COMPONENT IS A SUSPECT MATERIAL.	EXTERIOR SURFACE OF AIR DUCT. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.		EXTERIOR SURFACE OF AIR DUCTS. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	•	FLOOR. NEITHER COMPONENT IS A SUSPECT MATERIAL.	EXTERIOR SURFACE OF AIR DUCT.	FLOOR, DEBRIS RESULTING FROM PREVIOUS ROOF REMOVAL,	
Room/Area Assessment Report	Facility Address DISTRICT 11 OFFICE 2829 JU	Room Notes Material Description		ROLLED YELLOW FIBERGLASS W/BLACK PAPER BACKING.	6 IN DIA YELLOW FIBERGLASS , WGRAY VINYL JACKET FLEX DUCT.		6 IN X 18 IN YELLOW FIBERGLASS W/SILVER FOIL JACKET FIRM DUCT.	3 IN WHITE DUCT TAPE.		ROLLED YELLOW FIBERGLASS W/BLACK PAPER BACKING.	YELLOW FIBERGLASS WRAP.	BLACK ROOFING.	d. See the listing of suspect lification.
 Real Estate Services Division Asbestos Program Rev. 07/30/98	SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Room/Area Name [R#] Material Specification Name [M #]	BUILDING 2, CEILING SPACE 3 [R257]	BUILDING INSULATION (THERMAL) [M14]	DUCT INSULATION [M68]	BUILDING 1, CEILING SPACE 5 [R258]	DUCT INSULATION [M69]	OTHER SUSPECT MATERIALS [M19]	BUILDING 1, CEILING SPACE 6 [R259]	BUILDING INSULATION (THERMAL) [M14]	DUCT INSULATION [M12]	LOOSE DEBRIS [M77]	Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip O	County SAN DIEGO	
Room/Area Name [R#]	Room Notes		Survey	Est.		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	Briority	Status
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	195 LF	L ASS	ASSUMED POS.
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & TEES ON 1 IN DOMESTIC HOT WATER RUN.	9/1996 NWE	30 EA		POSITIVE
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	ON DOMESTIC HOT WATER RUNS.	S. 9/1996 NWE	310 LF		POSITIVE
PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	2 IN DOMESTIC HOT WATER RUN MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	J. 9/1996 NWE	200 LF	_	POSITIVE
BUILDING 1, CEILING SPACE 7 [R260]	UNABLE TO PHYSICALLY OR VISUALI PLANS. ROOM/AREA NOT ACCESSED.	UNABLE TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM PLANS. ROOM/AREA NOT ACCESSED.	RUCTIVE MI	EASURES. II	DENTIFIED	FROM
BUILDING 3, CEILING SPACE 2 [R261]	•					
ACOUSTICAL (SPRAYED) [M78]	WHITE FIBROUS INSULATION.	ON STRUCTURAL MEMBERS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1050 SF	s AS6	ASSUMED POS.
DUCT INSULATION [M69]	6 IN X 18 IN YELLOW FIBERGLASS WSILVER FOIL JACKET FIRM DUCT.	EXTERIOR SURFACE OF AIR DUCT. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE		ASS	ASSUMED NEG.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the or a listing of suspect verification.		2ND FLOOR	~	SIS Bldg #;	g#: 3617

· · · · · · · · · · · · · · · · · · ·					
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: DOT Date: 06/08/99
SIS Bldg # Building Name. 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Priority Status
BUILDING 3, BASEMENT FILE STORAGE [R1]	11]				
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H N & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	105 SY	NONE DETECTED
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	DUCT JOINT AT S END OF ROOM NEAR CEILING. PAINTED BEIGE. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 ' NWE	36 LF	L ASSUMED POS.
RESILIENT FLOORING (TILES) [M23]	12 IN X 12 IN BEIGE MOTTLED W/MASTIC.	FLOOR IN N/W CORNER. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	135 SF	L ASSUMED POS.
WALL BASE [M21]	4 IN CARAMEL VINYL WMASTIC.	N 15 FT OF W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	15 LF	L ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	N WALL & S 42 FT OF W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	71 LF	L ASSUMED POS.
BUILDING 3, REPROGRAPHICS STORAGE 1 [R2]	1 [R2]				
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	1 FT PERIMETER OF CEILING. PAINTED ORANGE. SUSPENDED CEILING SYSTEM.	9/1996 NWE	60 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	H S WALL. HOLES IN WALL RESULTING FROM PREVIOUS	9/1996 NWE	∀S 6	NONE DETECTED
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect sverification.		BASEMENT		SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	DOT 06/08/99
Sis Blda # Building Name	Facility Add	Address City		Zip Cou	County	
	CT 11 OFFICE	AN ST		10	SAN DIEGO	
Room/Area Name [R#]	Room Notes		Survey	ESt.	*	ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm		Units Priority St	Status
	PAINTED.	MAINTENANCE ACTIVITY. INSTALLED IN BUILDING 3 ONLY.				
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	160 SF	L ASSUM	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR. MATERIAL IS BEYOND USEFUL LIFE SPAN. HAS BECOME BRITTLE & BEGUN TO DELAMINATE FROM SUBSTRATE.	9/1996 E NWE	200 SF	L POS	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOV ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	60 LF	L ASSUM	ASSUMED POS.
BUILDING 3, REPROGRAPHICS STORAGE 2 [R3]	. 2 [R3]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	400 SF	NC	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH S & W WALLS. INSTALLED IN BUILDING 3 ONLY.	. 9/1996 · NWE	36 SY	N DETE	NONE DETECTED
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	160 SF	L ASSUM	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	ITE FLOOR.	9/1996 NWE	400 SF	L POS	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL WMASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	80 LF	L ASSUM	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect ic verification.	N	BASEMENT		SIS Bldg #:	3617

)			Dept:	TOO
Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report		Date:	66/80/90
Rev. 07/30/98 Building Name Fg 3617 DISTRICT OFFICE DI	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	City JAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	053
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM status
Material Specification Name [M #]	Material Coordinates		·		
BUILDING 3, DAHK HOOM [H4] ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE	CEILING. PAINTED ORANGE. SUSPENDED CEILING SYSTEM.	9/1996 NWE	252 SF	NONE
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	S & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	28 SY	NONE DETECTED
GYPSUM WALLBOARD [M24]	PAINTED. 4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	256 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE	ASBESTOS. FLOOR.	9/1996 NWE	252 SF L	POSITIVE
WALL BASE [M22]	STREAKS & MASTIC. 4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	64 LF L	ASSUMED POS.
PALE SOLIDA COMPANIO SE INSTITUTO DE LA COMPANIO DELA COMPANIO DEL COMPANIO DE LA COMPANIO DEL COMPANIO DE LA COMPANIO DEL COMPANIO DE LA COMPANIO DEL COMPANIO DEL COMPANIO DEL COMPANIO DE LA COMPANIO DE LA COMPANIO DEL COMPANI				,	
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	SYSTEM.	9/1996 NWE	2439 SF 864 SF	NONE DETECTED ASSUMED POS.
BUILDING INSULATION (ACOUSTIC) [M26]	4 FT X 10 FT BROWN CELLULOSE PANELS W/MASTIC.	N 1/2 OF W WALL, N & E WALLS. PANELS ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NM		
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.		9/1996 8 NWE	88 S ∀	NONE DETECTED
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	ved. See the a listing of suspect erification.		BASEMENT		SIS Bldg #: 3617

Rev. 07/30/98						
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City. 2829 JUAN ST SAN DIEGO	aande saame ee saame ee saame ee saad ee sadd	Zip Col. 92110 SAI	<u>County</u> SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	INSTALLED IN BUILDING 3 ONLY. BUILD-OUT WALLS IN S/W & N/W CORNERS OF ROOM. MATERIALS OF THIS TYPE MAY CONTAIN ASRESTOS.	9/1996 NWE	544 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1] WALL BASE [M22]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC. 4 IN BLACK VINYL W/MASTIC.		9/1996 NWE 9/1996 NWE	2439 SF 268 LF	L AS	POSITIVE ASSUMED POS.
BUILDING 3, REPROGRAPHICS OFFICE [R6]	6]			·		
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	135 SF		NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,		G 9/1996 NWE	13 SY		NONE DETECTED
GYPSUM WALLBOARD [M24]	PAIN I ED. 4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N, S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	264 SF	L A	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.		9/1996 NWE	135 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	VE 9/1996 NWE	48 LF	٠. ·	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	4	BASEMENT	⊢	SIS	SIS BIdg #: 3617

DOT 66/80/90

> Date: Dept:

Room/Area Assessment Report

Real Estate Services Division Asbestos Program

) .	Į
Real Estate Services Division Asbestos Program	Room/Area Asses	Area Assessment Report	<u></u>		Dept: 06	66/80/90
SIS Bldg # Building Name E 3617 DISTRICT OFFICE D	Facility DISTRICT 11 OFFICE 2829 JUAN ST	City JAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Priority Status	≥ su
BUILDING 3, MAIL ROOM [R7]			· sanora a s alima a sanora			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	252 SF	S ASSUMED POS.	o Pos.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	S & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	28 SY	NONE DETECTED	JE YTED
RESILIENT FLOORING (TILES) [M23]	PAINTED. 12 IN X 12 IN BEIGE MOTTLED WMAASTIC	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	252 SF	L ASSUMED POS.	D POS.
WALL BASE [M27]	4 IN CREAM VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	•	64 LF	L ASSUMED POS.	D POS.
BUILDING 3, BASEMENT SWITCH ROOM [R8]						
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	S & E WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	18 SY	NONE DETECTED	NONE ETECTED
BUILDING 3, ELEVATOR SHAFT [R9]	NO SUSPECT MATERIALS C	PECT MATERIALS OBSERVED IN ROOM.				

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

SIS Bldg #: 3617

BASEMENT

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	ssment Report			Dept: Date:	66/80/90
SIS Bidg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cou	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 3, ELEVATOR CAR [R10] RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	40 SF		POSITIVE
BUILDING 3, BASEMENT RECORDS CENTER [R11]	ER [R11]					
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	8. 9/1996 NWE	479 SF	<u>ج</u> م	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.		. 9/1996 ED NWE	476 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	VE 9/1996 NWE	96 LF	L	ASSUMED POS.
BUILDING 3, CASH ROOM [R12]						
ACOUSTICAL (TILES) [M29]	1 FT X 1 FT WHITE, COARSE TEXTINE WIMASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 3. NWE	299 SF	S	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE &	S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 3. NWE	208 SF	/ 	ASSUMED POS.
RESILIENT FLOORING (TILES) [M8]	9 IN X 9 IN LIGHT GRAY W/DARK STREAKS & MASTIC.	FLOOR E 1/2 OF ROOM. TILE SAMPLED POSITIVE. MASTIC	9/1996 NWE	232 SF		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ASSUMED POSITIVE. ON WALLS AT FLOOR. BASECOVE	VE 9/1996	114 LF		ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	9	BASEMENT		SIS	SIS BIdg #: 3617

DOT 66/80/90

Room/Area Assessment Report

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT 96/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU.	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
Material opeonicator rangity 1		ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE			
BUILDING 3, REPROGRAPHICS STORAGE 3 [R13]	3 [R13]					
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE &	S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	144 SF	L ASSUN	ASSUMED POS.
OTHER SUSPECT MATERIALS [M30]	3 IN WHITE DUCT TAPE W/BEIGE SEALANT.	DÙCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN	9/1996 NWE	6 LF	L ASSUN	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ASBESTOS. S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	12 LF	L ASSUI	ASSUMED POS.
BUILDING 3, BASEMENT MECHANICAL ROOM [R14]	JOM [R14]		 -			
BUILDING INSULATION (ACOUSTIC) [M26]	126] 4 FT X 10 FT BROWN CELLULOSE PANELS W/MASTIC.	WALLS & CEILING. PANELS ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	1825 SF	L ASSU	ASSUMED POS.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	RECTANGULAR DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	110 LF	L ASSU	ASSUMED POS.
OTHER SUSPECT MATERIALS [M30]	3 IN WHITE DUCT TAPE W/BEIGE SEALANT.	CIRCULAR DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	16 LF	L ASSU	ASSUMED POS.
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & TEES ON DOMESTIC HOT WATER RUNS.	9/1996 NWE	7 EA	L P(POSITIVE
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS	HORIZONTAL & VERTICAL	9/1996	45 LF	L P(POSITIVE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the t for a listing of suspect dic verification.		BASEMENT		SIS Bldg #:	#: 3617

66/80/90 DOT

)	
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report	e to a supple date to a supple to the supple		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cou	County SAN DIEGO	Q
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
PIPE INSULATION (LOW TEMP) [M2]	PREFORMED W/CANVAS WRAP. 1 TO 3 IN DIA WHITE STYROFOAM W/CANVAS WRAP.	DOMESTIC HOT WATER RUNS. HORIZONTAL & VERTICAL CHILLED WATER RUNS. MATERIAL INSULATES FITTINGS ON SYSTEM ALSO. CHILLED WATER IN BUILDING 3 ONLY.	NWE . 9/1996	80 LF	·	POSITIVE
BUILDING 3, BASEMENT COMPUTER SUPPLY [R15]	PPLY [R15]					
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 · NWE	208 SF	·	ASSUMED POS.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	AIR DUCT JOINTS. MATÉRIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	: 9/1996 NWE	48 LF	-	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	169 SF	_ ·	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	26 LF	_	ASSUMED POS.
BUILDING 3, BASEMENT COMPUTER STORAGE 1 [R16]	ORAGE 1 [R16]					
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	208 SF	<u>ـ</u>	ASSUMED POS.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	AIR DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN	F 9/1996 NWE	66 LF	_	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	removed. See the ort for a listing of suspect odic verification.		BASEMENT		SIS	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program	Room/Area Assess	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility. DISTRICT 11 OFFICE 2829 JUAN ST	City AN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	ASBESTOS. FLOOR.	9/1996 NWE	169 SF	<u> </u>	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	26 LF	L ASS	ASSUMED POS.
BUILDING 3, BASEMENT COMPUTER STORAGE 2 [R17]	RAGE 2 [R17]					
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	S WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	35 SY	, ⊔	NONE DETECTED
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & IOINT COMPOUND PAINTED.	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	232 SF	L AS	ASSUMED POS.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	AIR DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	F 9/1996 NWE	396 LF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	1534 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL WIMASTIC.	ON E, W & S WALLS AT FLOOR. PAINTED BLUE ON S WALL & S 1/3 OF E & W WALLS. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 3 NWE	144 LF	L AS	ASSUMED POS.
						·

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

SIS BIdg #: 3617

BASEMENT

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	sment Report			Dept: Date:	DOT
Rev. 07/30/98						
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JUAN ST	OITY IAN ST SAN DIEGO		ST10 SAN DI	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
BUILDING 3, BASEMENT PLANS STORAGE [R18]	E [R18]					
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	S & N WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	70 SY	DET	NONE DETECTED
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	AIR DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	186 L.F	L ASSUN	ASSUMED POS.
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	52 LF	L ASSUN	ASSUMED POS.
BUILDING 3, BASEMENT CORRIDOR [R19]						
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	1625 SF	N N	NONE . DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	S & E WALLS. SEVERAL LARGE HOLES AT RANDOM LOCATIONS EXPOSED ENDS & DEBRIS FROM DAMAGE. INSTALLED IN BUILDING	9/1996 NWE	250 SY	Z EDC	NONE DETECTED
FINISH PLASTER [M31]	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.	S ONLY. CEILING. CONCEALED BY ACOUSTICAL PANELS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 S NWE	181 SY	C ASSU	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.		9/1996 NWE	1450 SF	PG .	POSITIVE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.		BASEMENT		SIS Bldg #:	3617

·)	•
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area A	rea Assessment Report			Dept: Date: 0	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address City 2829 JUAN ST SAN	SAN DIEGO	Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Caty. Units Priority		ACM Status
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. ASSUMED NEGATIVE. N	BASECOVE 9/1996 MASTIC NWE	96 500 LF	L ASSUMED POS.	D POS.
BUILDING 3, NORTH BASEMENT STAIRWELL [R20]	ELL [R20]			erona mano nacria	٠	
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	OSE CEILING. SUSPENDED CEILING N. SYSTEM.	EILING 9/1996 NWE	96 147 SF E	NONE DETECTED	VE STED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	& WHITE LANDING FLOORS.	9/1996 NWE	36 144 SF E	L POSITIVE	IIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	IC. ON LANDING WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	FLOOR. 9/1996 EGATIVE. NWE TIVE.	96 59 LF E	L ASSUMED POS.	D POS.
BUILDING 3, CEILING SPACE 1 [R21]			- ·- <u></u> - · - <u></u>			
DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	AP. RECTANGULAR AIR DUCT.	.T. 9/1996 NWE	96 2520 SF E	NONE DETECTED	NE OTED
PIPE FITTINGS (HIGH TEMP) [M33]	1/2 TO 4 IN DIA WHITE MUDDED W/CANVAS WRAP.	DDED ELBOWS & HANGER ATTACHMENTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 IALS OF NWE N	26 EA E	S ASSUMED POS.	ED POS.
PIPE INSULATION (HIGH TEMP) [M32]	1/2 TO 4 IN DIA YELLOW PREFORMED W/CANVAS WRAP.	HORIZONTAL RUN. MATERIAL VRAP. OBSERVED USUALLY CONTAINS NO ASBESTOS.	ERIAL 9/1996 ONTAINS NWE	9 ш	ASSUMI	ASSUMED NEG.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.		Page: 11	BASEMENT	. L	SIS Bldg #:	3617

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	ssment Report		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Pacility DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 3, CEILING SPACE 2 [R22] DUCT INSULATION [M34]	8 IN DIA YELLOW FIBERGLASS W/GRAY VINYL JACKET.	FLEX DUCT. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE	ASSL	ASSUMED NEG.
BUILDING 3, CEILING SPACE 3 [R23] DUCT INSULATION [M34]	8 IN DIA YELLOW FIBERGLASS W/GRAY VINYL JACKET.	FLEX DUCTS. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE	ASSI	ASSUMED NEG.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed, Data requires periodic verification.	Page:		BASEMENT	T SIS Bidg #:	g#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report	erior i sanareno amarion	Dept: Date:	ot: DOT (6)
SIS Bldg # Building Name_ 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City. 2829 JUAN ST SAN DIEGO		Zip County. 92110 SAN DIEGO	EGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM rrity Status
BUILDING 3, NORTH VESTIBULE [R119]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	90 SF	NONE
FINISH PĻASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	I WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	16 SY .	NONE
FINISH PLASTER [M31]	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.	GEILING. CONCEALED BY ACOUSTICAL PANELS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	10 SY C	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	90 SF L	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	18 LF	ASSUMED POS.
BUILDING 3, WOMENS RESTROOM 1 [R121]	21]				
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H WALLS & CEILING. SEVERE PHYSICAL & WATER DAMAGE IN S/E CORNER OF CEILING. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	102 SY	NONE

Real Estate Services Division Asbestos Program	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	riority	ACM Status
BUILDING 3, WOMENS LOUNGE 1 [R122]			and the second	,		
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	81 SF	Ö	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH, W/SCRATCH COAT, SMOOTH, PAINTED.	N, S & E WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	24 SY	Ö	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	81 SF L		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	36 LF 1	L ASS	ASSUMED POS.
BUILDING 3, WOMENS RESTROOM 1 VESTIBULE [R123]	3ULE [R123]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	56 SF	Ω	NONE
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	27 SY	Ω	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	56 SF		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	30 LF	L ASS	ASSUMED POS.

3617

SIS BIdg #:

MEZZANINE 1

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report		Dept:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 3, CONCEALED SPACE 1 [R124]	UNABLE TO PHYSICALLY OR VISUALL PLANS. ROOM/AREA NOT ACCESSED.	TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM IOOM/AREA NOT ACCESSED.	RUCTIVE ME	ASURES. IDENTIFIE	D FROM
BUILDING 3, ROOM 129 [R125]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H N & E WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	29 SY	NONE
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	204 SF L	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 . NWE	41 LF L A	ASSUMED POS.
BUILDING 3, ROOM 130 [R126]			·		
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH E WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	12 SY	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	. 9/1996 NWE	204 SF L	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR.	9/1996	24 LF L A	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect c verification.	·	MEZZANINE 1	• .	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report	e e e e e e e e e e e e e e e e e e e		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU.	Address City 2829 JUAN ST SAN DIEGO		ZID Cou	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
		BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE:			
BUILDING 3, ROOM 131 [R127]			en e			
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	Ω	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	E WALL. INSTALLED IN BUILDING 3 ONLY.	3 ' 9/1996 NWE	12 SY	Ω	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	204 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF	L ASS	ASSUMED POS.
BUILDING 3, ROOM 132 [R128]						
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	u	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	E WALL. INSTALLED IN BUILDING 3 ONLY.	G 9/1996 NWE	12 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	T. 9/1996 NWE	204 SF	ပ	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF	L AS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the or a listing of suspect verification.		MEZZANINE 1		SIS Bldg #:	ig #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report		•	Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address. City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 3, ROOM 133 [R129]			·			
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	255 SF	õ	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	E WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	15 SY	۵	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	9/1996 NWE	255 SF	O	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	32 LF	L ASS	ASSUMED POS.
BUILDING 3, AUDITORIUM [R130]			managan i sa masangan a			
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	UPPER 6 FT OF WALLS & CEILING. SUSPENDED CEILING SYSTEM.	. 9/1996 · NWE	2484 SF	٥	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	LOWER 8 FT OF E & W WALLS & N WALL. PARTIALLY CONCEALED. UPPER 4 FT OF N WALL COVERED W/ACOUSTICAL PANELS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	135 SY	Ω	NONE DETECTED
FINISH PLASTER [M31]	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.	CEILING IN 4 FT PERIMETER OF S, E & W WALLS & UPPER 4 FT OF ALL WALLS. CONCEALED BY ACOUSTICAL PANELS. MATERIALS OF THIS TYPE MAY CONTAIN	, 9/1996 NWE S	76 SY	C ASS	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	emoved. See the rt for a listing of suspect dic verification.	, ,	MEZZANINE 1		SIS Bldg #:	3#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO	um Entermonente van anna e tradenium (è e e	Zip Co 92110 SA	County SAN DIEGO	09
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Otty. Units	Units Priority	ACM y Status
		ASBESTOS.				
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	328 SF	٦	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	1804 SF		POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL WMASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	170 LF	, _	ASSUMED POS.
BUILDING 3, ROOM 127C [R131]			· · · · · · · · · · · · · · · · · · ·			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	165 SF	တ	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	S & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	23 SY		NONE DETECTED
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	88 SF	<u>ب</u>	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	_	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	165 SF	۔	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	42 LF	_	ASSUMED POS.

SIS BIdg #: 3617

MEZZANINE 1

Page: 6

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report	and the second s		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM Status
BUILDING 3, ROOM 127B [R132]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	s A8	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	S WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	}S 6		NONE DETECTED
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	80 SF	L A	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	192 SF	L A	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	120 SF	_	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	= 9/1996 NWE	44 LF	ا A	ASSUMED POS.
BUILDING 3, ROOM 127A [R133]						•
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	∢ ග	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	3 ONLY.	9/1996 NWE	AS 6		NONE DETECTED
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	removed. See the ort for a listing of suspect odic verification.		MEZZANINE 1	<u>.</u>	SIS	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	Assėssm	ent Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST	City ST SAN DIEGO		ZID CC 92110 SA	County SAN DIEGO	0
Room/Area Name [R#]	Room Notes			Survey	Est.		ACM
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE	<u>«</u>	N WALL. MATERIALS OF THIS	9/1996	80 SF L AS	L AS	ASSUMED POS.
	JOINT COMPOUND PAINTED		TYPE MAY CONTAIN ASBESTOS.	NWE	. '		
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	E & THIS	E & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	192 SF	- AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.		FLOOR.	9/1996 NWE	120 SF		POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL WMASTIC.	,	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	44 LF	L AS	ASSUMED POS.
BUILDING 3, ROOM 127 [R134]			. •	ar a kalina kakamum zara			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE WIMEDIUM FISSURE.		CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	165 SF	S	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.		S & E WALLS. INSTALLED IN BUILDING 3 ONLY.	. 9/1996 NWE	23 SY		NONE DETECTED
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	,	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 SF	L A§	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	W T	W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	88 SF	L A	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.		FLOOR.	9/1996 NWE	165 SF	_	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.		ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC	9/1996 NWE	42 LF	L A	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.		Page: 8	×	MEZZANINE 1		SIS Bldg #:	dg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report	nament e e emmanant meneral me		Dept: 0	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
		ASSUMED POSITIVE.				
BUILDING 3, ROOM 134 [R135]					,	
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	NONE DETECTED	AE STED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	E WALL. INSTALLED IN BUILDING 3 ONLY.	3 9/1996 NWE	12 SY	NONE DETECTED	NE STED
RESILIENT FLOORING (TILES) [M1]	9 IN X.9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	204 SF L	- POSITIVE	ΓΙΛΕ
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	24 LF L	- ASSUMED POS.	D POS.
BUILDING 3, ROOM 134A [R136]						
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	153 SF	NONE DETECTED	AE CTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	E WALL. INSTALLED IN BUILDING 3 ONLY.	3 9/1996 NWE	}S 6	NONE DETECTED	VE CTED
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 . NWE	119 SF	L ASSUMED POS.	D POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	153 SF	L POSITIVE	rive
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE.	9/1996 E. NWE	18 LF	L ASSUMED POS.	ED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect. materials observed. Data requires periodic verification.	moved. See the t for a listing of suspect. It verification.		MEZZANINE 1		SIS BIdg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	essment Report		ÕÕ	Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	MEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	ACM ority Status
		MASTIC ASSUMED POSITIVE.			
BUILDING 3, ROOM 136 [R137]		-			
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	187 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H E WALL. INSTALLED IN BUILDING 3 ONLY.	G 9/1996 NWE	11 SY	NONE
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	119 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	187 SF	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 E. NWE	22 LF	ASSUMED POS.
BUILDING 3, ROOM 138 [R138]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH E WALL. INSTALLED IN BUILDING 3 ONLY.	G 9/1996 NWE	12 SY	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	204 SF L	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE.	9/1996 E. NWE	24 LF L	ASSUMED POS.
NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:		MEZZANINE 1		SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Priority Status
		MASTIC ASSUMED POSITIVE.		:	
BUILDING 3, ROOM 138A [R139]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	204 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H E WALL. INSTALLED IN BUILDING 3 ONLY.	O,	12 SY	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	204 SF	L POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 LF	L ASSUMED POS.
BUILDING 3, ROOM 140 [R140]			i		
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	552 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H E8FT OF N WALL & S & E WALLS INSTALLED IN BUILDING 3 ONLY.	3, 9/1996 NWE	55 SY.	NONE
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR. CONCEALED BY CARPET.	. 9/1996 NWE	552 SF	C POSITIVE
WALL BASE [M21]	4 IN CARAMEL VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	94 LF	L ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect c verification.		MEZZANINE 1	Ξ	SIS BIdg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Room/Area Assessment Report	en e e e e e e e e e e e e e e e e e e		Dept: Date;	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Add DISTRICT 11 OFFICE 282	Address. 2829 JUAN ST SAN DIEGO		ZID COU 92110 SAI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 3, ROOM 142 [R141]	NO SUSPECT MATERIAL	ECT MATERIALS OBSERVED IN ROOM.				
BUILDING 3, STAIRWELL [R142]						
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	9/1996 NWE	100 SF	S ASSU	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH WALLS. INSTALLED IN BUILDING ONLY.	3 9/1996 NWE	120 SY	DE	NONE DETECTED
FINISH PLASTER [M31]	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.	TH CEILING OF MIDDLE LANDING H. ONLY. CONCEALED BY ACOUSTICAL PANELS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE LS	7 SY	C ASSU	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	CEILING OF UPPER TREAD CASE ONLY. CONCEALED BY ACOUSTICAL TILES UNPAINTED. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	100 SF	C ASSU	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE MIDDLE LANDING FLOOR.	9/1996 NWE	55 SF	L P(POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON S, E & W WALLS ON MIDDLE LANDING AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC	9/1996 E NWE	22 LF	L ASSU	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	12°	MEZZANINE 1		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report	- Communication and a second an		Dept: DOT Date: 06/08/99
SIS Bidg # Building Name. 3617 DISTRICT OFFICE	Facility Add DISTRICT 11 OFFICE 282	Address City 2829 JUAN ST SAN DIEGO		Zip County.	County SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Priority Status
		ASSUMED POSITIVE.			
BUILDING 3, ROOM 137 [R143]					
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	42 SF	S ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	FH S & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	13 SY	NONE
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	117 SF	L ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	42 SF	L POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 :. NWE	7 LF	L ASSUMED POS.
BUILDING 3, ROOM 141 [R144]					
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE,	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. 9/1996 NWE	1946 SF	S ASSUMED POS.
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	S WALL & S 24 FT OF W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	423 SF	S ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH	TH S&W WALLS. PARTIALLY	9/1996	82 SY	NONE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:		MEZZANINE 1		SIS Bldg #: 3617

Real Estate Services Division	
Asbestos Program	
Rev. 07/30/98	

Room/Area Assessment Report

66/80/90 DOT Dept:

Date:

Hev. U//30/98		=			
SIS Bldg # Building Name	Facility	Address	Z	Zip County	. 7
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 28:	2829 JUAN ST SAN DIEGO	ன் 	92110 SAN DIEGO	ИЕ GО
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey E Date/Firm C	Est. Qty. Units Priority	ACM ority Status
	W/SCRATCH COAT, SMOOTH, PAINTED.	CONCEALED. S WALL & S 24 FT OF W WALL COVERED W/ACOUSTICAL TILES. INSTALLED IN BUILDING 3 ONLY.	NW		DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N WALL & BUILD-OUT WALLS ON W SIDE OF ROOM. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	450 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M60]	12 IN X 12 IN CREAM W/OLIVE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 19 NWE	1946 SF C	ASSUMED POS.
WALL BASE [M61]	4 IN MOSS GREEN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	250 LF L	ASSUMED POS.
BUILDING 3, ROOM 135 [R145]					
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	330 SF S	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	N & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	37 SY	NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	333 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE	IITE FLOOR. CONCEALED BY CARPET.	9/1996	330 SF C	POSITIVE
Data audited and substandard records removed. See the	noved, See the		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,		

MEZZANINE 1

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
WALL BASE [M62]	STREAKS & MASTIC. 6 IN MOSS GREEN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	NWE 9/1996	74 LF	L ASSI	ASSUMED POS.
BUILDING 3, ROOM 135A [R146]		,	mara salah sal			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	210 SF	S ASSI	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H N WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	15 SY	Ö	NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	261 SF	L ASS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR. CONCEALED BY CARPET.	9/1996 NWE	210 SF	O	POSITIVE
WALL BASE [M62]	6 IN MOSS GREEN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	58 LF	L ASS	ASSUMED POS.
						·

NOTE:

MEZZANINE 1

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report	ilia - v - v - viener serienari di mana		Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Ado	Address City 2829 JUAN ST SAN DIEGO		ZID County 92110 SAN D	County SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM riority Status
BUILDING 3, ROOM 126 [R147]					
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	288 SF	NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N, S & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	468 SF 1	ASSUMED POS
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	ITE FLOOR. CONCEALED BY CARPET.	9/1996 NWE	288 SF (C POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL WMASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	68 LF 1	L ASSUMED POS
BUILDING 3, ROOM 125 [R148]	• .				
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	216 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH WWALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	12 SY	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	ITE FLOOR.	9/1996 NWE	216 SF 'I	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 LF	L ASSUMED POS.
	,				
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	noved. See the for a listing of suspect sverification.		MEZZANINE 1	·	SIS Bldg #: 3617

Asbestos Program Rev. 07/30/98	Room/Area Ass	Room/Area Assessment Report	,		Dept: Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Add DISTRICT 11 OFFICE 282	Address City 2829 JUAN ST SAN DIEGO		ZID Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 3, ROOM 124 [R149]						
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	216 SF		NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH WISCRATCH COAT, SMOOTH, PAINTED.	TH WWALL. INSTALLED IN BUILDING 3 ONLY.	3 9/1996 NWE	12 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	216 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	24 LF	L AS	ASSUMED POS.
BUILDING 3, ROOM 123 [R150]						
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	216 SF	П	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH N&WWALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	30 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	216 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	N, E & W WALLS. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 · NWE	30 LF	L AS	ASSUMED POS.
•						

Dept:

Room/Area Assessment Report

Real Estate Services Division

NOTE:

Page: 17

MEZZANINE 1

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/	Area Asses	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name	Facility	Address	City		Zip Cc	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE	2829 JUAN ST	AN ST SAN DIEGO	_	92110 S/	SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ses	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority	ACM Status
BUILDING 3, ROOM 122 [R151]				· · · · · · · · · · · · · · · · · · ·			
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	E CELLULOSE E PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	216 SF	_	NONE DETECTED
BUILDING INSULATION (ACOUSTIC) [M64]	J 4 FT X 10 FT BROWN CELLULOSE WOOD FIBER PANELS W/MASTIC.	WN CELLULOSE NELS W/MASTIC.	WALLS. PANELS ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	540 SF	L AS	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL W/SCRATCH COAT, SMOOTH, PAINTED.	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	N, S & W WALLS. CONCEALED BY ACOUSTICAL BUILDING INSULATION. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	48 SY	<u>-</u> ن	NONE DETECTED
OTHER SUSPECT MATERIALS [M84]	ROLLED LIGHT BLUE CARPET W/BRITTLE YELLOW MASTIC.	LUE CARPET DW MASTIC.	FLOOR. CARPET ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	216 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/E STREAKS & MASTIC.	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET	. 9/1996 NWE	216 SF	O	POSITIVE
WALL BASE [M63]	6 IN BEIGE VINYL W/MASTIC.	W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	/E 9/1996 NWE	60 LF	L AS	ASSUMED POS.
BUILDING 3, ROOM 121 [R152]							
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	E CELLULOSE E PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	669 SF		NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL W/SCRATCH COAT, SMOOTH, PAINTED.	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	N, S & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	79 SY		NONE DETECTED
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	ved. See the a listing of suspect erification.	Page: 18		MEZZANINE 1	-	SIS Bldg #:	dg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Are	a Asses	/Area Assessment Report				Dept: Date:	DOT
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address 2829 JUAN ST		Oity SAN DIEGO		ZID Co 92110 SA	County SAN DIEGO	Q
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description		ACM Location/Notes	<u></u>	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	CK & WHITE	FLOOR. CONCEALED BY CARPET	CARPET.	9/1996 NWE	669 SF	ပ	POSITIVE
WALL BASE [M58]	6 IN LIGHT GRAY VINYL W/MASTIC.	W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	ASECOVE ASTIC	9/1996 NWE	144 LF	L	ASSUMED POS.
BUILDING 3, ROOM 120 [R153]	·			<u>-</u> 				
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	JULOSE TERN.	CEILING. SUSPENDED CEILING SYSTEM.	EILING	9/1996 NWE	391 SF		NONE DETECTED
BUILDING INSULATION (ACOUSTIC) [M64]	4 FT X 10 FT BROWN CELLULOSE WOOD FIBER PANELS W/MASTIC.	ELLULOSE W/MASTIC.	E 13 FT OF N WALL. PANELS ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	IELS ASTIC	9/1996 NWE	176 SF	L A	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL W/SCRATCH COAT, SMOOTH PAINTED.	ED-ON METAL LATH	WALLS. PARTIALLY CONCEALED E 13 FT OF N WALL COVERED W/ACOUSTIC BUILDING INSULATION. INSTALLED IN BUILDING 3 ONLY.	CEALED. ERED	9/1996 NWE	80 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLA STREAKS & MASTIC.	Y W/BLACK & WHITE STIC.	FLOOR. CONCEALED BY CARPET	CARPET.	9/1996 NWE	391 SF	O	POSITIVE
WALL BASE [M58]	6 IN LIGHT GRAY VINYL W/MASTIC.	. W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	ASECOVE ASTIC	9/1996 NWE	80 LF	L A	ASSUMED POS.
		٠		· · ·	emende same mer a disease			

NOTE:

Page: 19

MEZZANINE 1

L		
Real Estate Services Division	sbestos Program	. 07/30/98
Bea.	Asb	Rev.

Room/Area Assessment Report

66/80/90 DOT Date: Dept:

.					
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 28:	Address 2829 JUAN ST SAN DIEGO	•	S2110 SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 3, SWITCH ROOM [R154]					
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH S, E & W WALLS & CEILING. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	31.87	NONE DETECTED
BUILDING 3, MENS RESTROOM 1 VESTIBULE [R155]	JLE [R155]		,		
ACOUSTICAL (PANELS) [M25]	1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	CEILING. SUSPENDED CEILING SYSTEM.	9/1996 NWE	42 SF	NONE DETECTED
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH WALLS. PARTIALLY CONCEALED LOWER 4 FT OF W WALL COVERED W/CERAMIC TILE. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	. 34 SY	NONE DETECTED
FINISH PLASTER [M31]	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.	TH CEILING. CONCEALED BY H. ACOUSTICAL PANELS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 S NWE	5 SY C A	ASSUMED POS.
BUILDING 3, MENS RESTROOM 1 [R156]					
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH WALLS & CEILING. PARTIALLY CONCEALED. LOWER 4 FT OF WALLS COVERED WICERAMIC TILE. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	57 SY	NONE DETECTED
		-			

SIS Bldg #: 3617

MEZZANINE 1

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	/Area Assessment Report		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 3, PIPECHASE 1 [R157]					
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & VALVE ON DOMESTIC HOT WATER RUNS.	9/1996 NWE	5EA L F	POSITIVE
PIPE INSULATION (HIGH TEMP) [M66]	1/2 TO 1 1/2 DIA YELLOW PREFORMED FIBERGLASS W/CANVAS WRAP.	DOMESTIC HOT WATER RUNS. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE	ASS	ASSUMED NEG.

_
6
ĬÓ
-
Œ
_
Ψ-
α
ō
ă
Œ
α
0
Ö
Ξ.
က
G
Ž
=
Q
=
5
≂

BUILDING 3, PIPECHASE 2 [R158]

NO SUSPECT MATERIALS OBSERVED IN ROOM.

NONĘ DETECTED	L ASSUMED POS.	NONE	C ASSUMED POS.
1407 SF	100 SF	416 SY	156 SY (
9/1996 NWE	9/1996 NWE	9/1996 NWE	9/1996 NWE
CEILING. SUSPENDED CEILING SYSTEM.	WALLS IN THE S/E CORNER OF MAIN CORRIDOR. PANELS ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	WALLS. PARTIALLY CONCEALED. PORTIONS OF WALL ARE COVERED W/ACOUSTIC BUILDING INSULATION & OTHER MATERIAL. INSTALLED IN BUILDING 3 ONLY.	CEILING. CONCEALED BY ACOUSTICAL PANELS. MATERIALS, OF THIS TYPE MAY CONTAIN
1 FT X 2 FT WHITE CELLULOSE MEDIUM FISSURE PATTERN.	4 FT X 10 FT BROWN CELLULOSE WOOD FIBER PANELS W/MASTIC.	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	GRAY TROWELED-ON METAL LATH W/OUT SCRATCH COAT, SMOOTH.
ACOUSTICAL (PANELS) [M25]	BUILDING INSULATION (ACOUSTIC) [M64]	FINISH PLASTER [M20]	FINISH PLASTER [M31]

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification. NOTE:

MEZZANINE 1

Page: 21

SIS Bldg #: 3617

Division		
Real Estate Services I	ogram	ø.
Estate	bestos Program	ev. 07/30/98
Real	Asb	Rev

Room/Area Assessment Report

D01 66/80/90 Date: Dept:

Nev. 07/30/30					
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Ad DISTRICT 11 OFFICE 283	Address. City 2829 JUAN ST SAN DIEGO	MEGO	Zip County 92110 SAN D	County. SAN DIEGO
Room/Area Name [R#]	Room Notes		Survey	Est.	ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	riority Status
,		ASBESTOS.			
OTHER SUSPECT MATERIALS [M65]	4 FT X 8 FT BROWN CORK PANEL W/WHITE CLOTH FACING &		-T S 9/1996 NWE	128 SF 1	- ASSUMED POS.
	MAGIN	OORN & CLOTH ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	Q		
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	ITE FLOOR.	9/1996 NWE	1407 SF	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	ECOVE 9/1996 TC NWE	416 LF	ASSUMED POS.
BUILDING 3, CEILING SPACE 4 [R165]	UNABLE TO PHYSICALL	TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	MEASURES. LIM	ITED VISUAL A	CCESS ONLY.
DUCT INSULATION [M12]	YELLOW FIBERGLASS WRAP.	EXTERIOR SURFACE OF AIR DUCT.	3 9/1996 NWE	3904 SF	NONE DETECTED
BUILDING 3, PIPECHASE 3 [R230]	UNABLE TO PHYSICALLY OR VISUALL PLANS. ROOM/AREA NOT ACCESSED.	E TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM ROOM/AREA NOT ACCESSED.	DESTRUCTIVE M	EASURES. IDE!	VTIFIED FROM

4 [R231]	
IPECHASE	
BUILDING 3, P	

PIPE INSULATION (HIGH TEMP) [M66]

VERTICAL DOMESTIC HOT WATER RUN. MATERIAL OBSERVED PREFORMED FIBERGLASS 1/2 TO 1 1/2 DIA YELLOW

W/CANVAS WRAP.

USUALLY CONTAINS NO ASBESTOS.

ASSUMED NEG.

9/1996

MEZZANINE 1

Page: 22

Homogeneous Material Summary Report for a listing of suspect Data audited and substandard records removed. See the

NOTE:

materials observed. Data requires periodic verification.

SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report	er e	۵۵	Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DI	County SAN DIEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM ority Status
BUILDING 3, PIPECHASE 5 [R227]					
GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	60 SF L	ASSUMED POS.
PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	VERTICAL DOMESTIC HOT WATER RUN. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	8 LF L	POSITIVE
BUILDING 3, PIPECHASE 6 [R228]					
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOW ON DOMESTIC HOT WATER RUNS. DAMAGE BY PREVIOUS MAINTENANCE ACTIVITY.	9/1996 NWE	1 EA .	POSITIVE
PIPE INSULATION (HIGH TEMP) [M66]	1/2 TO 1 1/2 DIA YELLOW PREFORMED FIBERGLASS W/CANVAS WRAP.	VERTICAL & HORIZONTAL DOMESTIC HOT WATER RUNS. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE		ASSUMED NEG.
BUILDING 3, MENS RESTROOM 2 [R229]			· · · · · · · · · · · · · · · · · · ·		
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H WALLS & CEILING. PARTIALLY CONCEALED. LOWER 4 FT OF WALLS COVERED W/CERAMIC TILE. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	115 SY	NONE DETECTED
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the or a listing of suspect verification.		MEZZANINE 2		SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report	• •		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		ZID ZID 92110 S/	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM
BUILDING 3, PENTHOUSE STAIRWELL [R232]	32]					
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E LOWER LANDING FLOOR.	9/1996 NWE	30 SF	_	POSITIVE
WALL BASE [M22]	4 IN BLACK VINYL W/MASTIC.	ON LANDING WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	51 LF	L AS	ASSUMED POS.
BUILDING 3, ROOM 233 & CLOSET [R233]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	648 SF	S AS	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	120 SY		NONE
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	BUILD-OUT CLOSET WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	240 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR. CONCEALED BY CARPET.	9/1996 NWE	648 SF	ပ	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	108 LF	L AS	ASSUMED POS.

SIS BIdg #: 3617

MEZZANINE 2

N

Page:

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JUAN ST	JAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority		ACM Status
BUILDING 3, ROOM 233A [R234]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	270 SF	S ASSUMI	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	N, E & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	53 SY	NO	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR, CONCEALED BY CARPET.	9/1996 NWE	270 SF	C POS	POSITIVE
WALL BASE [M55] BIJILDING 3. NETWORK SWITCH BOOM (R235)	6 IN BROWN VINYL W/MASTIC.	ON N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	48 LF	L ASSUM	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	WALLS. INSTÂLLED IN BUILDING 3 ONLY.	3 9/1996 NWE	33 SY	NO	NONE
BUILDING 3, JANITOR CLOSET 1 [R236]	PAINTED.					
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	WALLS. INSTALLED IN BUILDING 3 ONLY.	3 9/1996 NWE	27 SY	NOETE	NONE DETECTED

SIS Bldg #: 3617.

MEZZANINE 2

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name	Facility Address	City		Zip	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 2829 JU	2829 JUAN ST SAN DIEGO		10	SAN DIEGO	OS
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priorit	ACM / Status
BUILDING 3, ROOM 235 [R237]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	2568 SF	S	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	W 20 FT OF N WALL, E & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 3 NWE	191 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	. 9/1996 NWE	2568 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	224 LF	Г <i>У</i>	ASSUMED POS.
BUILDING 3, ROOM 235A [R238]		,				
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	168 SF	S	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH, W/SCRATCH COAT, SMOOTH, PAINTED.	W WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	16 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	. 9/1996 NWE	168 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	E 9/1996 NWE	52 LF	7	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	ved. See the a listing of suspect artification.		MEZZANINE 2	8	SIS	SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report		Dept: Date:	Dept: DOT Date: 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Ac DISTRICT 11 OFFICE 28	Address City 2829 JUAN ST SAI	Oity SAN DIEGO	ZID County 92110 SAN DIEGO	IEGO
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM ority Status
BUILDING 3, CONCEALED SPACE [R239]	UNABLE TO PHYSICALLY OR VISUALI PLANS. ROOM/AREA NOT ACCESSED	UNABLE TO PHYSICALLY OR VISUALLY ACCESS W/OUT DESTRUCTIVE MEASURES. IDENTIFIED FROM PLANS. ROOM/AREA NOT ACCESSED.	UT DESTRUCTIVE MI	EASURES. IDENT	IFIED FROM
BUILDING 3, WOMENS RESTROOM 2 & CLOSET [R240]	SET [R240]				
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	ATH E WALL. INSTALLED IN BUILDING 3 ONLY.	BUILDING 9/1996 NWE	11 SY	NONE
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	N, S & W WALLS & CEILING. PARTIALLY CONCEALED. LOWER 4 FT OF N & W WALLS COVERED W/SHEET. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	NG. 9/1996 D. LOWER NWE OVERED OF THIS SESTOS.	700 SF L	ASSUMED POS.
OTHER SUSPECT MATERIALS [M67]	4 FT X 8 FT OFF-WHITE FIBERGLASS SHEET W/MASTIC.	LOWER 4 FT OF N & W WALLS. SHEET ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	VALLS. 9/1996 TIVE. NWE TIVE.	120 SF L	ASSUMED POS.
RESILIENT FLOORING (SHEETS) [M76]	6 FT ROLLED CREAM W/BROWN VINYL IN 4 IN X 4 IN PATTERN & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS	THIS 9/1996 BESTOS. NWE	22 SY L	ASSUMED POS.
BUILDING 3, PIPECHASE 7 [R241]	UNABLE TO PHYSICAL	TO PHYSICALLY ACCESS W/OUT DESTRUCTIVE MEASURES. LIMITED VISUAL ACCESS ONLY.	TIVE MEASURES. LIM	ITED VISUAL ACC	SESS ONLY.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	ATH N WALL. INSTALLED IN BUILDING 3 ONLY.	BUILDING 9/1996 NWE	16 SY	NONE DETECTED
			-		

SIS Bldg #: 3617

MEZZANINE 2

Page:

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect

NOTE:

materials observed. Data requires periodic verification.

Real Estate Services Division	
Asbestos Program	
Rev. 07/30/98	

Room/Area Assessment Report

Dept: **DOT**Date: 06/08/99

# bp				1	County	
3617 DISTRICT OFFICE	DISTRICT 11 OFFICE 282	2829 JUAN ST SAN DIEGO		92110 S/	SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	Priority	ACM Status
BUILDING 3, ROOM 234 [R242]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF	s AS	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL & E 6 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	220 SF	L A8	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S 3 FT OF W WALL & S WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	270 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	TE FLOOR.	9/1996 NWE	360 SF	_	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL WMASTIC.	ON E WALL, E 6 FT OF N WALL, S 3 FT OF W WALL & S WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	3 · 9/1996 NWE	49 LF	L A§	L ASSUMED POS.
BUILDING 3, ROOM 230A [R243]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	. · 9/1996 NWE	459 SF	S A	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	TH N & E WALLS. PARTIALLY CONCEALED. E WALL COVERED W/CORK PANELS. INSTALLED IN	9/1996 NWE	181 SY		NONE DETECTED .

NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

MEZZANINE 2 SIS BIdg #: 3617

u		
Real Estate Services Divisior	Asbestos Program	Rev. 07/30/98

Room/Area Assessment Report

DOT

Dept: Date:

			_		
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Add DISTRICT 11 OFFICE 282	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	
Doom/Assa Name (D#1					
	HOOM NOTES		Survey	Est.	ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Oty. Units Priority Status	Status
		BUILDING 3 ONLY.			
OTHER SUSPECT MATERIALS [M65]	4 FT X 8 FT BROWN CORK PANEL	S & E WALLS & N 18 FT OF W	9/1996	630 SF S ASS	ASSUMED POS.

[R244]
230
300M
რ

ASSUMED POS.

88 LF

9/1996

ON WALLS AT FLOOR. BASECOVE

6 IN BROWN VINYL W/MASTIC.

WALL BASE [M55]

ASSUMED NEGATIVE. MASTIC

ASSUMED POSITIVE.

NWE

NWE

WALL. CORK & CLOTH ASSUMED

W/WHITE CLOTH FACING &

MASTIC.

NEGATIVE. MASTIC ASSUMED

POSITIVE.

ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	2450 SF	Ø	S ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	N, W & S WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	156 SY		NONE DETECTED
GYPSUM WALLBOARD [M41]	4.FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S 7 FT OF E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	70 SF		ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	9/1996 NWE	2450 SF	O	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC	9/1996 NWE	210 LF	_	ASSUMED POS.

Page: 7

ASSUMED POSITIVE.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/A	rea Asses	Area Assessment Report		and the second of the second o		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility DISTRICT 11 OFFICE	Address 2829 JUAN ST	AN ST	City SAN DIEGO		Zip Co	County SAN DIEGO	09
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description		ACM Location/Notes		Survey Date/Firm	Est. Qty. Units Priority	Priorit	ACM y Status
BUILDING 3, ROOM 230 OFFICE [R245]	E, S & W W	WALLS ARE 7 FT PARTITION WALLS.	RTITION WALLS.	<u> </u>				
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CE W/MEDIUM FISSURE.	E CELLULOSE JRE.	CEILING. SUSPENDED BY T-BA MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	SUSPENDED BY T-BAR. LS OF THIS TYPE MAY ASBESTOS.	9/1996 NWE	208 SF	s s	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	ON METAL LATH SMOOTH,	N WALL. INSTALLED 3 ONLY.	INSTALLED IN BUILDING	9/1996 NWE	14 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/E STREAKS & MASTIC.	W/BLACK & WHITE TIC.	FLOOR. CONCEALED BY CARPET	BY CARPET.	9/1996 NWE	208 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	A. BASECOVE E. MASTIC	9/1996 NWE	58 LF	<u></u>	ASSUMED POS
BUILDING 3, ROOM 236A [R246]								
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	E CELLULOSE JRE.	CEILING. SUSPENDED BY T-BAR MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	ED BY T-BAR. TYPE MAY	9/1996 NWE	288 SF	S	ASSUMED POS.
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	AB WALL ACING.	N & E WALLS & N 6 FT OF W WAL MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	T OF W WALL. TYPE MAY 3.	9/1996 NWE	480 SF		ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	/BLACK & WHITE	FLOOR.		9/1996 NWE	288 SF	٠	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	W/MASTIC.	ON N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	AT FLOOR. :D NEGATIVE. OSITIVE.	9/1996 NWE	48 LF		ASSUMED POS
NOTE: Homogeneous Material Summary Report for a listing of suspect	moved. See the for a listing of suspect	ć				•	Č	

SIS Bldg #: 3617

MEZZANINE 2

materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Eacility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cot 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Otty. Units Priority		ACM Status
BUILDING 3, ROOM 236 [R247]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	252 SF	S ASSUM	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H E WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	13 SY	NG DETE	NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	330 SF	L ASSUM	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	252 SF	L POS	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	N, E & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	45 LF	L ASSUM	ASSUMED POS.
BUILDING 3, ROOM 238 [R248]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 .NWE	4879 SF	s ASSUM	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H E, W & S WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	310 SY	NC DETE	NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	BUILD-OUT WALLS AROUND OFFICES. MATERIALS OF THIS	9/1996 NWE	940 SF	L ASSUM	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect c verification.		MEZZANINE 2	Q	SIS Bldg #:	3617

ij

The state of the s	ing Name Facility Add
l	SIS Bldg # Building Name

3617

Zip County 92110 SAN DIEGO Dept: Date: City SAN DIEGO Room/Area Assessment Report **2829 JUAN ST** ddress DISTRICT 11 OFFICE **DISTRICT OFFICE** Real Estate Services Division Asbestos Program

DOT 66/80/90

Room/Area Name [R#]	Room Notes		Survey	T to		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	Priori	0,
		TYPE MAY CONTAIN ASBESTOS.	aller ser silves de ser			
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	9/1996 NWE	4879 SF	O	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	320 LF	- ⊒	ASSUMED POS.
BUILDING 3, ROOM 238 OFFICE A [R249]			, deservation experience of a new			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	192 SF	S	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	W WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	18 SY		NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N, S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	400 SF	_	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	9/1996 NWE	192 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	16 LF	_	ASSUMED POS.
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON N, S & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE.	9/1996 NWE	40 LF		ASSUMED POS.

Homogeneous Material Summary Report for a listing of suspect Data audited and substandard records removed. See the materials observed. Data requires periodic verification. NOTE:

Page: 10

MASTIC ASSUMED POSITIVE.

SIS Bldg #: 3617

MEZZANINE 2

			in Section			
Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report	- comit versamina versa		Dept: Date:	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Co 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units	Units Priority S	ACM
BUILDING 3, ROOM 238 OFFICE B [R250]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	190 SF	s ASSUN	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	W WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	18 SY	DET	NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N, S & E WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	400 SF	L ASSUN	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	9/1996 NWE	192 SF	C PO	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIG.	ON W WALL AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	16 LF	L ASSUN	ASSUMED POS.
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON N, S & E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	40 LF	L ASSUN	ASSUMED POS.
BUILDING 3, ROOM 238 OFFICE C [R251]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	208 SF	S ASSUN	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH,	E WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	14 SY	DET	NONE DETECTED
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the tor a listing of suspect ic verification.		MEZZANINE 2	Ø	SIS Bldg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility. Ac DISTRICT 11 OFFICE 28	Address City. 2829 JUAN ST SAN DIEGO		Zip Cc 92110 SA	County SAN DIEGO	0
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
	PAINTED.					
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	N, S & W WALLS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	420 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	HITE FLOOR. CONCEALED BY CARPET	F. 9/1996 NWE	208 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON E WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	, 9/1996 . NWE	13 LF	L AS	ASSUMED POS.
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON N, S & W WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE MASTIC ASSUMED POSITIVE.	9/1996 NWE	42 LF	L AS	ASSUMED POS.
BUILDING 3, ROOM 237 [R252]						
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	2886 SF	s AS	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	ATH WALLS. INSTALLED IN BUILDING 3 ONLY.	3 9/1996 NWE	256 SY		NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	HITE FLOOR. CONCEALED BY CARPET	F. 9/1996 NWE	2886 SF	O	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE , ASSUMED NEGATIVE. MASTIC . ASSUMED POSITIVE.	/E 9/1996 NWE	230 LF	L AS	ASSUMED POS.

SIS Bidg #: 3617

MEZZANINE 2

Data audited and substandard records removed. See the NOTE: ' Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asses	Area Assessment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip Cou	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 3, ROOM 237A [R253]			<u> </u>			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	210 SF	s ASS	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	N & W WALLS. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	32 SY	Ω	NONE DETECTED
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR. CONCEALED BY CARPET.	9/1996 NWE	210 SF	<u>-</u> ن	POSITIVE
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	58 LF	L ASS	ASSUMED POS.
BUILDING 3, CORRIDOR 2 [R254]				•		
ACOUSTICAL (TILES) [M49]	1 FT X 1 FT WHITE W/SMALL FISSURES & RANDOM PERFORATIONS W/MASTIC.	CEILING. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	, 9/1996 NWE	1336 SF	S ASS	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	WALLS. INSTALLED IN BUILDING 3 ONLY.	3 9/1996 NWE	396 SY		NONE DETECTED
GYPSUM WALLBOARD [M73]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND UNPAINTED.	CEILING. CONCEALED BY CEILING TILES. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	1336 SF	C AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	1336 SF	_	POSITIVE .
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	roved. See the or a listing of suspect verification.		MEZZANINE 2		SIS Bldg #:	j#: 3617

Real Estate Services Division	Boom/Area Asse	Area Assessment Report			Dept:	DOT
Asbestos Frogram Rev. 07/30/98					Date:	66/80/90
# bp		Gity City Can		1	County	
361/ DISTRICT OFFICE	DISTRICT 11 OFFICE 2823	2829 JUAN SI	<u></u>	92110 SA		
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM
WALL BASE [M42]	4 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	403 LF	L AS	ASSUMED POS.
BUILDING 3, VESTIBULE 2 [R255]			· · · · · · · · · · · · · · · · · · ·			
ACOUSTICAL (PANELS) [M28]	2 FT X 4 FT WHITE CELLULOSE W/MEDIUM FISSURE.	CEILING. SUSPENDED BY T-BAR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	180 SF	s AS	ASSUMED POS.
FINISH PLASTER [M20]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, SMOOTH, PAINTED.	H E WALL. INSTALLED IN BUILDING 3 ONLY.	9/1996 NWE	4 SY		NONE DETECTED
GYPSUM WALLBOARD [M41]	4 FT X 10 FT PREFAB WALL SYSTEM W/VINYL FACING.	S & W WALLS & W 24 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	730 SF	L AS	ASSUMED POS.
GYPSUM WALLBOARD [M75]	4 FT X 8 FT SHEETS W/JOINT COMPOUND & TAPE, TEXTURED, PAINTED.	E 21 FT OF N WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	210 SF	L AS	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	E FLOOR.	9/1996 NWE	180 SF	_1	POSITIVE
WALL BASE [M55]	6 IN BROWN VINYL W/MASTIC.	ON WALLS AT FLOOR. BASECOVE ASSUMED NEGATIVE. MASTIC ASSUMED POSITIVE.	9/1996 NWE	98 LF	L AS	ASSUMED POS.

7

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Ass	Room/Area Assessment Report			Dept: D	DOT
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Ao DISTRICT 11 OFFICE 28	Address 2829 JUAN ST SAN DIEGO		Zip Cor 92110 SA	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Priority Status	
BUILDING 2, PENTHOUSE FAN ROOM [R262]	52]				,	
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	NTH E WALL & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	201 SY	L ASSUMED POS.	POS.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	178 LF	L AŠŠUMED POS.	POS.
PIPE INSULATION (LOW TEMP) [M3]	1 TO 4 IN DIA BROWN CORK W/BLACK FELT WRAP PAINTED GRAY.	CHILLED WATER RUN. MATERIA INSULATES FITTINGS ON THIS SYSTEM ALSO. CORK ASSUMED ND.	L 9/1996 NWE	105 LF	NONE	G
BUILDING 2, PENTHOUSE WATER HEATER ROOM	R ROOM					
EQUIPMENT INSULATION (HIGH TEMP) [M79] YELLOW FIBERGI JACKET.) [M79] YELLOW FIBERGLASS W/VINYL JACKET.	ON WATER HEATERS. MATERIAL OBSERVED USUALLY CONTAINS NO ASBESTOS.	9/1996 NWE		ASSUMED NEG.	NEG
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	ATH N, E & W WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	70 SY	L ASSUMED POS.	POS
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & TEES ON HOT WATER HEATING RUNS.	9/1996 NWE	20 EA	L POSITIVE	Ш
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	HOT WATER HEATING RUNS.	9/1996 NWE	100 LF	L POSITIVE	Ę,
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	moved. See the for a listing of suspect ic verification.		PENTHOUSE	. ш	SIS Bldg #: 36	3617

Heal Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report	ा केवाना व नीविकास्त्रीयां है है	Dept: Date:	.: 06/8999
SIS Bldg # Building Name	Facility Address	Address City SAN DIEGO		Zip County	09
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units Priority	ACM ty Status
BUILDING 2, PENTHOUSE VESTIBULE [R264]	[264]				
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	S & W WALLS & CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	48 SY L	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	E WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	168 SF L	ASSUMED POS.
BUILDING 2, PENTHOUSE SWITCH ROOM [R265]	M [R265]				
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	33 SY L	ASSUMED POS.
GYPSUM WALLBOARD [M24]	4 FT X 8 FT SHEETS W/TAPE & JOINT COMPOUND PAINTED.	W WALL. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	360 SF L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M1]	9 IN X 9 IN GRAY W/BLACK & WHITE STREAKS & MASTIC.	FLOOR.	9/1996 NWE	300 SF L	POSITIVE
BUILDING 2, PENTHOUSE MEZZANINE [R266]	7266]		and proposed frager to have the		
FINISH PLASTER [M39]	GRAY TROWELED-ON METAL LATH W/SCRATCH COAT, PAINTED, SMOOTH.	CEILING. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	17 SY L	ASSUMED POS.

SIS BIdg #: 3617

PENTHOUSE

N

Page:

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect

NOTE:

materials observed. Data requires periodic verification.

DOT

Dept:

Real Estate Services Division

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	sment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE 2829 JUAN ST	JAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority		ACM Status
BUILDING 1, PENTHOUSE BOILER ROOM [R267]				•		
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	N & W WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	95 SY	L ASSUMED POS.	ED POS.
OTHER SUSPECT MATERIALS [M19]	3 IN WHITE DUCT TAPE.	DUCT JOINTS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	35 LF	L ASSUM	ASSUMED POS.
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & TEES ON DOMESTIC HOT WATER RUNS.	9/1996 NWE	15 EA	L POS	POSITIVE
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	DOMESTIC HOT WATER RUNS.	9/1996 NWE	62 LF	L POS	POSITIVE
PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	HOT WATER HEATING RUNS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	120 LF	L POS	POSITIVE
BUILDING 1, PENTHOUSE FAN ROOM [R268]						
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	BUILD-OUT WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	300 SY	L ASSUM	ASSUMED POS.
PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	HOT WATER HEATING RUNS. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	88 LF	-1 -1	POSITIVE
PIPE INSULATION (LOW TEMP) [M3]	1 TO 4 IN DIA BROWN CORK	CHILLED WATER RUN. MATERIAL	1 9/1996	52 LF	Ž	NONE
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	oved. See the or a listing of suspect verification.		PENTHOUSE	36	SIS BIdg #:	3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification Name IM #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
BUILDING 1, PLENUM 1 FAN ROOM [R269]	W/BLACK FELT WRAP PAINTED GRAY.	INSULATES FITTINGS ON THIS SYSTEM ALSO. CORK ASSUMED ND.	NWE	30	DETECTED
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H S & E WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	125 SY L ASS	ASSUMED POS.
BUILDING 1, PLENOW 2 FAN ROOM [REFO]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	THE WALL & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	100 SY L ASS	ASSUMED POS.
BUILDING 1, PLENUM 3 FAN ROOM [R271]			erre virtue and established		
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	IH N, S & E WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	125 SY L ASS	ASSUMED POS.

DOT

SIS Bldg #: 3617

PENTHOUSE

Page: 4

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Asse	Area Assessment Report	·	Dept: Date:	E DOT ::
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility Addi	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN DIEGO	093
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM ity Status
BUILDING 1, PENTHOUSE COOLING WATER ROOM	MOOF				
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H S & W WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	, 9/1996 NWE	130 SY L	ASSUMED POS.
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS ON DOMESTIC HOT WATER RUN.	9/1996 NWE	8 EA L	POSITIVE
PIPE INSULATION (HIGH TEMP) [M13]	1/2 TO 4 IN DIA GRAY & WHITE AIRCELL W/CANVAS WRAP.	DOMESTIC HOT WATER RUN. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	45 LF L	POSITIVE
PIPE INSULATION (LOW TEMP) [M3]	1 TO 4 IN DIA BROWN CORK W/BLACK FELT WRAP PAINTED GRAY.	CHILLED WATER RUN. MATERIAI INSULATES FITTINGS ON THIS SYSTEM ALSO. CORK ASSUMED ND.	9/1996 NWE	20 LF	NONE
BUILDING 1, PENTHOUSE SWITCH ROOM [R273]	73]				
FINISH PLASTER [M45]	GRAY TROWELED-ON METAL LATH W/SMOOTH SCRATCH COAT, PAINTED.	H N, S & W WALLS & CEILING. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	114 SY L	ASSUMED POS.
RESILIENT FLOORING (TILES) [M80]	9 IN X 9 IN GREEN W/WHITE & BLACK STREAKS & MASTIC.	FLOOR. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	231 SF L	ASSUMED POS.
					•
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	ις.	PENTHOUSE		SIS Bldg #: 3617

Real Estate Services Division Asbestos Program Rev 07/30/98	Room/Area Ass	Room/Area Assessment Report			Dept: Date:	DOT
SIS Bldg # Building Name	Facility Ado	Address City SAN DIEGO		Zip Co	County SAN DIEGO	
		•				
Room/Area Name [R#]	Room Notes		Survey	Est.		ACM
Material Specification Name [M #]	Material Description	ACM Location/Notes	Date/Firm	Qty. Units Priority	Priority	Status
BUILDING 3, PENTHOUSE FAN ROOM [R274]						
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & TEES ON DOMESTIC HOT WATER RUNS.	9/1996 NWE	50 EA	_	POSITIVE
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WAAP.	DOMESTIC HOT WATER RUNS.	9/1996 NWE	150 LF		POSITIVE
PIPE INSULATION (LOW TEMP) [M2]	1 TO 3 IN DIA WHITE STYROFOAM W/CANVAS WRAP.	CHILLED WATER. MATERIAL INSULATES FITTINGS ON SYSTEM ALSO. CHILLED WATER IN BUILDING 3 ONLY.	9/1996 NWE	100 LF	_	POSITIVE
BUILDING 3, PENTHOUSE HOT WATER HEATER ROOM	ER ROOM		-			
PIPE FITTINGS (HIGH TEMP) [M6]	1/2 TO 4 IN DIA GRAY MUDDED W/CANVAS WRAP.	ELBOWS & TEES ON DOMESTIC HOT WATER RUN.	9/1996 NWE	20 EA	ب	POSITIVE
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	DOMESTIĊ HOT WATER RUN.	9/1996 NWE	79 LF	-	POSITIVE
BUILDING 3, PENTHOUSE SHOP [R276]	·					
PIPE INSULATION (HIGH TEMP) [M5]	1/2 TO 4 IN DIA WHITE FIBROUS PREFORMED W/CANVAS WRAP.	DOMESTIC HOT WATER RUNS.	9/1996 NWE	30 LF		POSITIVE
	•					

SIS Bldg #: 3617

PENTHOUSE

Page: **6***

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room	om/Area As	/Area Assessment Report		nantina	Dept: Date:	DOT	
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	FFICE	Address 2829 JUAN ST	City SAN DIEGO		Zip County 92110 SAN DIEGO		
Room/Area Name [R#] Material Specification Name [M #]	Room Note Material Description	Room Notes Description	ACM Location/Notes		Survey Date/Firm	Est. Qty. Units Priority	ACM Status	
BUILDING 1, PENTHOUSE EXTERIOR WALLS [R282]		SUSPECT MATER	NO SUSPECT MATERIALS OBSERVED IN ROOM.					
BUILDING 2, PENTHOUSE EXTERIOR WALLS [R283]		SUSPECT MATER	NO SUSPECT MATERIALS OBSERVED IN ROOM.		eri e menor metarranina arti			
BUILDING 3, PENTHOUSE EXTERIOR WALLS [R284]		SUSPECT MATER	NO SUSPECT MATERIALS OBSERVED IN ROOM.		erane e ere e e estávolad da estávolad esta			
				mare a - a				

Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.

NOTE:

SIS Bldg #: 3617

PENTHOUSE

Real Estate Services Division Asbestos Program Rev. 07/30/98		Room/Area Assessment Report	ssment Report	eine - <u>alle konsilvansk</u>		Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name 3617 DISTRICT OFFICE		Facility Address DISTRICT 11 OFFICE 2829 JU	Address 2829 JUAN ST SAN DIEGO		Zip Cou 92110 SAI	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]		Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	Priority	ACM Status
BUILDING 1, ROOF 1 [R278]							•
BUILTUP ROOFING [M81]		FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 1.	THROUGHOUT. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	206 SQ	L ASS	ASSUMED POS.
BUILDING 2, ROOF [R279]							
BUILTUP ROOFING [M82]		FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 2.	THROUGHOUT. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	114 SQ	L ASS	ASSUMED POS.
BUILDING 3, ROOF 1 [R280]				<u> </u>			
BUILTUP ROOFING [M83]		FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 3.	THROUGHOUT. INSTALLED IN BUILDING 3 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	177 SQ	L ASS	ASSUMED POS.
BUILDING 1, ROOF 2 [R281]	~						
BUILTUP ROOFING [M81]		FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 1.	THROUGHOUT. INSTALLED IN BUILDING 1 ONLY. MATERIALS THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 OF NWE	08 9 08 9	L ASS	ASSUMED POS.
Data audited and substandard records removed. See the Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	ds remo	oved. See the r a listing of suspect verification.		ROOF		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program Rev. 07/30/98	Room/Area Assessment Report	ssment Report			Dept: Date:	DOT 06/08/99
SIS Bldg # Building Name_3617 DISTRICT OFFICE	Facility Address DISTRICT 11 OFFICE 2829 JU.	Address City 2829 JUAN ST SAN DIEGO		Zip County 92110 SAN D	County SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Oty. Units F	Priority	ACM Status
BUILTUP ROOFING [M81]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 1.		9/1996 NWE	31 SQ	L ASSU	ASSUMED POS.
BUILDING 2, PENTHOUSE ROOF [R286]		ASBESTOS.	•			
BUILTUP ROOFING [M82]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 2.	D THROUGHOUT. INSTALLED IN BUILDING 2 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	20 SQ	L ASSU	ASSUMED POS.
BUILDING 3, PENTHOUSE ROOF [R287]					•	
BUILTUP ROOFING [M83]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 3.	D THROUGHOUT. INSTALLED IN BUILDING 3 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 NWE	30 SQ	L ASSI	ASSUMED POS.
BUILDING 1, ROOF 3 [R288]						
BUILTUP ROOFING [M81]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 1.	ED THROUGHOUT. INSTALLED IN BUILDING 1 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 - NWE	30 SO	L ASSI	ASSUMED POS.
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.	Page:	N	R00F		SIS Bldg #:	#: 3617

Real Estate Services Division Asbestos Program	Room/Area A	Room/Area Assessment Report		Dept: Date:	66/80/90
SIS Bldg # Building Name 3617 DISTRICT OFFICE	Facility DISTRICT 11 OFFICE	Address City 2829 JUAN ST SAN DIEGO		Zip County. 92110 SAN DIEGO	
Room/Area Name [R#] Material Specification Name [M #]	Room Notes Material Description	ACM Location/Notes	Survey Date/Firm	Est. Qty. Units Priority	ACM Status
EXTERIOR WALKWAY EYEBROW ROOF [R289]	NO SUSPI	ECT MATERIALS OBSERVED IN ROOM.			
BUILDING 3, ROOF 2 [R290]					
BUILTUP ROOFING [M83]	FELT, TAR, GRAVEL & 3 FT ROLLED CAP SHEET W/GRAY MINERAL SURFACING, BLDG 3.	ROLLED THROUGHOUT. INSTALLED IN BUILDING 3 ONLY. MATERIALS OF THIS TYPE MAY CONTAIN ASBESTOS.	9/1996 F NWE	32 SQ L AS	ASSUMED POS.
			- 12 0.11 2000 000 000		
		-			-
			-		
Data audited and substandard records removed. See the NOTE: Homogeneous Material Summary Report for a listing of suspect materials observed. Data requires periodic verification.		Page: 3	R00F	SIS Bldg #:	dg #: 3617

rict: 11
building: District Office, Basement
Building Function: Administrative
Surveyor: Molley and Garrett
Bulk Sampling Date: 17 March 1986
Total Area of Fireproofing: 0 S.F.
Corrective Cost: Deferred Action
Hazard Assessment: 4
Paccommendation: 08M Plan

Recommendation: O&M Plan

_Sample			Asbestos Presence	Non-asbestos Content
I.D. No.	Material Description	Location	Using PLM	Using PLM
SD-45	Typical floor tile	R-20 Dist.Off. Basement	5% Amosite	2% Cellulose
SD-46	\mathcal{M} - \mathcal{A} Mech. room, C.W. ret. joint	(1966) R-14 R-14	S-1 NAD ,	Cellulose Mineral wool
SD-47	Mech. room, C.W. ret. pipe	" R-0	NAD 8-1	Cellulose
-48	A/C unit joint mud over styrofoam	R-14	7% Amosite 16% Chrysotile	4% Cellulose 23% Mineral wool
SD-49	Hot water pipe M-6	R-14	46% Amosite 2% Chrysotile 5-1	2% Cellulose
SD-50	Hot water elbow $M-35$	" R-19	21% Amosite 10% Chrysotile	10% Mineral wool
SD-51	Typical ceiling tile	Н	NAD '	Mineral wool

istrict: 11
ilding: District Office, First Floor
Building Function: Administrative
Surveyor: Molley and Garrett
Bulk Sampling Date: 17 March 1986
Total Area of Fireproofing: 0 S.F.
Corrective Cost: Deferred Action
Hazard Assessment: 4
Recommendation: 0&M Plan

Sample I.D. No.	Material Description	Location	Asbestos Presence Using PLM	Non-asbestos Using PLM	Content
SD-36	M-8 Floor tile	R-30 Dist.Off. First Floor	5-1 8% Chrysotile	NFD	
SD-37	M-T Ceiling tile $M-9$	(1951) R -30	S-1 NAD S-1	Cellulose Mineral wool	
SD-38	Steam pipe in chase	R-74 " (1958)	16% Chrysotile	Cellulose	
SD-39	Elbow in chase $M-8$	R-74 R-97	38% Amosite 8% Chrysotile	NFD	
7-40	Floor tile	" R-82	5% Amosite	NFD	
SD-4.1	Ceiling tile	" R-165	NAD S-1	Cellulose	
SD-42	Sprayed-on material fiberglass duct	" (1966) R - 169	NAD 5-1	Cellulose Mineral wool	
SD-43	M- 35 Typical ceiling tile	Dist. Off First Floor	NAD S-2	Cellulose Mineral wool	
SD-44	Typical floor tile	" (1966) 5 4	9% Chrysotile	NFD	

jstrict: 11
uilding: District Office, Second Floor
Building Function: Administrative
Surveyor: Molley and Garrett
Bulk Sampling Date: 17 March 1986
Total Area of Fireproofing: 0 S.F.
Corrective Cost: Deferred Action
Hazard Assessment: 4
Recommendation: 0&M Plan

Sample I.D. No.	Material Description	Location	Asbestos Presence Using PLM	Non-asbestos Content Using PLM
SD-22	Hot water pipe	R-207+ Dist. Off. Second Floor	17% Chrysotile	50% Cellulose
SD-23 SD-24	M-lo Hot water elbow $M-lH$ Typical batt above	(1958) - 207 $R - 207$	S-7 34% Amosite 15% Chrysotile NAD S-1	NFD Mineral wool
SD-25	Contaminated batt	R-0 " R-206	3% Amosite 21% Chrysotile 5-↓ NAD	15% Mineral wool Cellulose
SD-26 SD-27	Linoleum M-444 Ceiling tile M-44	R-214 R-217	NAD C 3	Cellulose Cellulose
SD-28	Ceiling tile	2-31	NAD * 🍱	Cellulose
SD-29	Linoleum M - 49	" R-25"	A	Cellulose
SD-31	Typical ceiling tile $\mathcal{M} - 1$	R-23	· ·	Mineral wool
SD-32	Typical floor tile	" R-16	Q NAD	NFD
SD-34	Typical floor tile	(1951) RIT	6% Amosite O 5-4	Cellulose
SD-35	Typical ceiling tile	,,,	NAD	Cellulose Mineral wool

Building: District Office, Second Floor Building Function: Administrative Surveyor: Molley and Garrett Bulk Sampling Date: 17 March 1986 Total Area of Fireproofing: 30,000 S.F. Corrective Cost: \$489,000 Hazard Assessment: 1

Recommendation: Removal

Sample I.D. No.	Material Description	Location	Asbestos Presence Using PLM	Non-asbestos Content Using PLM
SD-30	M-18 Sprayed-on material	R-O Dist. Off. Second Floor	15% Chrysotile	Cellulose
SD-33	M-18 Sprayed-on material metal deck/steel	(1966) P-O	15% Chrysotile	NFD

istrict: 11
Luilding: District Office, Penthouse (1966)
Building Function: Administrative
Surveyor: Molley and Garrett
Bulk Sampling Date: 17 March 1986
Total Area of Fireproofing: 0 S.F.
Corrective Cost: Deferred Action
Hazard Assessment: 4
Recommendation: 0&M Plan

Sample I.D. No.	Material Description	Location	Asbestos Presence Using PLM	Non-asbestos Content Using PLM
. SD-1	M-2 C.W. pipe	Dist. Off. Penthouse	S-3 No asbestos detected (NAD)	No fibers detected (NFD)
SD-2 SD-3	M-5 Hot water pipe M-6 Hot water elbow	(1966) R-274 R-274	S-5 35% Chrysotile S-10 8% Amosite	NFD
SD-4	Hot water return pipe	R-274 R-274	20% Chrysotile S-Lo 40% Amosite 12% Chrysotile	9% Mineral Wool
7-5	C.W. elbow M-2	R-274	30% Amosite 14% Chrysotile	NFD
SD-6 SD-7	C.W. elbow M-5 Dom. hot water pipe	2-275	30% Amosite 12% Chrysotile 36% Amosite	NFD
SD-8	Dom. hot water elbow	R-275	10% Chrysotile 5-\\ 18% Amosite 16% Chrysotile	NFD 3% Mineral wool
SD-9	Hot water elbow boiler	R-275	S-12 NAD	Cellulose Other fibers

District: 11

District: II
Building: District Office, Penthouse (1958)
Building Function: Administrative
Surveyor: Molley and Garrett
Bulk Sampling Date: 17 March 1986
Total Area of Fireproofing: 0 S.F.
Corrective Cost: Deferred Action

Hazard Assessment: 4
Recommendation: O&M Plan

Sample I.D. No. Ma	terial Description	Location	Asbestos Presence Using PLM	Non-asbestos Content
SD-10 H	M-5 Not water return pipe M-6	Penthouse	32% Amosite 13% Chrysotile	NFD
SD-11 H	Not water elbow	R-263 R-243	5% Amosite 7% Chrysotile	21% Mineral wool
SD-12 D	Oom. hot water pipe M-6	" R-263	38% Amosite 8% Chrysotile	NFD
	Dom. hot water elbow	" R-262	22% Chrysotile	16% Mineral wool
SD-14 C	M-3 C.W. pipe $M-3$	" R-262	NAD	NFD
SD-15 (C.W. elbow	" n-dod	NAD S- \	NFD

LEGEND

NFD	NO FIBERS DETECTED
NAD	NO ASBESTOS DETECTED
HW	HOT WATER
 HWS	HOT WATER SUPPLY
HWR	HOT WATER RETURN
CW	CHILLED WATER
CWR	CHILLED WATER RETURN
DHWS	DOMESTIC HOT WATER SUPPLY
DHW	DOMESTIC HOT WATER
A/C	AIR CONDITIONING
Ret.	RETURN
Insul.	INSULATION
Dom.	DOMESTIC
Off.	OFFICE
Br.	BRIDGE
Dist.	DISTRIBUTION
Typ.	TYPICAL

ASBESTECH
6825 Fair Oaks Blvd., Suite 103
Carmichael, California 95608
Tel.(916) 481-8902 Fax (916) 481-3975

Client:

Northwest Envirocon, Inc. 1828 Tribute Road Suite A Sacramento, CA 95815 Job:

050-000729 DOT District 11

BULK ASBESTOS ANALYSIS REPORT

LAB JOB # 25 Date Received:			NVLAP # 101442 DOHS # 1153 Date Reported: 7/14/97		
Sample No.	Color/Description	% Type Asbestos	Other Materials		
729-11-001	Homogeneous light gray trowelled-on metal lath, light weight rough finish w/out scratch (finish plaster) E wall, 6ft S of N wall, 2ft above floor DSA #3617	NONE DETECTED	Granular Mins. Gypsum Binder		
729-11-002	Homogeneous light gray trowelled-on metal lath, light weight rough finish w/out scratch (finish plaster) E wall, 4ft S of N wall, 3ft above floor DSA #3617	NONE DETECTED	Granular Mins. Gypsum Binder		
729-11-003	Homogeneous light gray trowelled-on metal lath, light weight rough finish w/out scratch (finish plaster) E wall, 3ft S of N wall, 4ft above floor DSA #3617	NONE DETECTED	Granular Mins. Gypsum Binder		
729-11-004	Homogeneous gray 1/2in to 4in dia mudded w/canvas wrap pipe fittings (high temp) elbow on domestic hot water run, 6ft above floor, 15ft N of S wall DSA #3617	15-20 CHRYSOTILE	Fibrous Glass Binder		
729-11-005	Homogeneous gray 1 1/2 to 2 in dia aircell w/canvas wrap pipe insulation (high temp) vertical domestic hot water run 5ft S of N wall, 1 ft W of E wall, 3ft A DSA #3617	15-20 CHRYSOTILE	Cellulose Binder		

THE ANALYSIS USES POLARIZED LIGHT MICROSCOPY AND DISPERSION STAINING FOLLOWING E.P.A. METHOD #600M482020. NON-FRIABLE MATERIALS WERE ANALYZED APPLYING THE SAME METHOD. SAMPLES WERE NOT COLLECTED BY ASBESTECH. THIS REPORT MUST NOT BE REPRODUCED EXCEPT IN FULL WITH THE APPROVAL OF ASBESTECH. THIS REPORT RELATES ONLY TO THE ITEMS TESTED. THIS REPORT MUST NOT BE USED TO CLAIM PRODUCT ENDORSEMENT BY N.V.L.A.P. OR ANY AGENCY OF THE U.S. GOVERNMENT. ASBESTECH ACCEPTS TECHNICAL RESPONSIBILITY FOR THIS REPORT AND DATE OF ISSUE.

NVLAP

ANALYST SIGNATURE:

Florin

ASBESTECH
6825 Fair Oaks Blvd., Suite 103
Carmichael, California 95608
Tel (916) 481-8902 Fax (916) 481-3975

Client:
Northwest Envirocon, Inc.
1828 Tribute Road Suite A

Sacramento, CA 95815

Job:

050-000729 DOT District 11

BULK ASBESTOS ANALYSIS REPORT

LAB JOB # 25167-2 NVLAP # 101442 DOHS # 1153

Date Received: 7/11/97 Date Reported: 7/14/97

Date Received.	, //11///	Date Reported. 1/14/7/				
Sample No.	Color/Description	% Type Asbestos	Other Materials			
729-11-006	Homogeneous gray trowlled-on metal lath ceiling, 2ft W of E wall, at S wall DSA #3617	NONE DETECTED	Granular Mins. Gypsum Binder			
729-11-007	Homogeneous gray trowlled-on metal lath S wall, 50ft W of E wall, 2ft above floor DSA #3617	NONE DETECTED	Granular Mins. Binder			
	Homogeneous white smooth painted painted scratch coat (finish plaster)	NONE DETECTED	Granular Mins. Binder			
٠.						
729-11-008	Homogeneous gray trowlled-on metal lath N wall, 2ft E of W wall, 4 1/2ft above floor DSA #3617	NONE DETECTED	Granular Mins. Binder			
	Homogeneous white smooth painted painted scratch coat (finish plaster)	NONE DETECTED	Granular Mins. Binder			
729-11-009	Homogeneous gray trowlled-on metal lath S wall, 1 1/2 ft E of W wall, 1ft above floor DSA #3617	NONE DETECTED	Granular Mins. Binder			
	Homogeneous white smooth painted painted scratch coat (finish plaster)	NONE DETECTED	Granular Mins. Binder			

THE ANALYSIS USES POLARIZED LIGHT MICROSCOPY AND DISPERSION STAINING FOLLOWING E.P.A. METHOD #600M482020. NON-FRIABLE MATERIALS WERE ANALYZED APPLYING THE SAME METHOD. SAMPLES WERE NOT COLLECTED BY ASBESTECH. THIS REPORT MUST NOT BE REPRODUCED EXCEPT IN FULL WITH THE APPROVAL OF ASBESTECH. THIS REPORT RELATES ONLY TO THE ITEMS TESTED. THIS REPORT MUST NOT BE USED TO CLAIM PRODUCT ENDORSEMENT BY N.V.L.A.P. OR ANY AGENCY OF THE U.S. GOVERNMENT. ASBESTECH ACCEPTS TECHNICAL RESPONSIBILITY FOR THIS REPORT AND DATE OF ISSUE.

NVLAP

ANALYST SIGNATURE:

ASBESTECH
6825 Fair Oaks Blvd., Suite 103
Carmichael, California 95608
Tel. (916) 481-8902 Fax (916) 481-3975

Client:

Northwest Envirocon, Inc. 1828 Tribute Road Suite A Sacramento, CA 95815 Job:

050-000729 DOT District 11

BULK ASBESTOS ANALYSIS REPORT

LAB JOB # 25167-3

Date Received: 7/11/97

NVLAP # 101442

DOHS # 1153

Date Reported: 7/14/97

•			
Sample No.	Color/Description	% Type Asbestos	Other Materials
729-11-010	Homogeneous gray trowlled-on metal lath E wall, 10ft S of N wall, 1ft above floor DSA #3617	NONE DETECTED	Granular Mins. Binder
	Homogeneous white smooth painted painted scratch coat (finish plaster)	NONE DETECTED	Granular Mins. Binder
729-11-011	Homogeneous gray trowlled-on metal lath E wall, 2ft N of S wall, 1 1/2ft above floor DSA #3617	NONE DETECTED	Granular Mins. Binder
	Homogeneous white smooth painted painted scratch coat (finish plaster)	NONE DETECTED	Granular Mins. Binder
729-11-012	Homogeneous gray trowlled-on metal lath S wall, 4 1/2ft E of W wall, 4 1/2ft above floor DSA #3617	NONE DETECTED	Granular Mins. Binder
729-11-013	Homogeneous black/gray roofing debris (other suspect materials) floor, 30ft S of N wall, 100ft W of E wall DSA #3617	NONE DETECTED	Tar Binder Granular Mins.

THE ANALYSIS USES POLARIZED LIGHT MICROSCOPY AND DISPERSION STAINING FOLLOWING E.P.A. METHOD #600M482020. NON-FRIABLE MATERIALS WERE ANALYZED APPLYING THE SAME METHOD. SAMPLES WERE NOT COLLECTED BY ASBESTECH. THIS REPORT MUST NOT BE REPRODUCED EXCEPT IN FULL WITH THE APPROVAL OF ASBESTECH. THIS REPORT RELATES ONLY TO THE ITEMS TESTED. THIS REPORT MUST NOT BE USED TO CLAIM PRODUCT ENDORSEMENT BY N.V.L.A.P. OR ANY AGENCY OF THE U.S. GOVERNMENT. ASBESTECH ACCEPTS TECHNICAL RESPONSIBILITY FOR THIS REPORT AND DATE OF ISSUE.

NVLAP

ANALYST SIGNATURE:__

Real Estate Services Division Asbestos Program Rev. 07/30/98

Bulk Samples Summary Report

Date: 06/08/99

SIS Bldg# Building Name

Sample #

Consultant Sample #

Lab 1 Type 1 Lab 2 Type 2 Lab 3 Type 3 Survey Date Firm Code

DISTRICT 11 OFFICE
3617 DISTRICT OFFICE

B3617-M1-R20-S1	SD-45	5	AMO	•				11/1986	EMI
B3617-M1-R159-S2	SD-44	9	CHR					11/1986	EMI
B3617-M1-R236-S3	SD-32	ND-						11/1986	EMI.
B3617-M2-R14-S1	SD-46	ND						11/1986	EMI
B3617-M2-R14-S2	SD-47	ND						11/1986	EMI
B3617-M2-R274-S3	SD-1	ND						11/1986	EMI
B3617-M2-R274-S4	SD-5	30	AMO	14	CHR			11/1986	EMI
B3617-M2-R274-S5	SD-6	30	AMO	12	CHR			11/1986	EMI ·
B3617-M3-R262-S1	SD-15	ND						11/1986	EMI
B3617-M3-R262-S2	SD-14	ND						11/1986	EMI
B3617-M5-R14-S1	SD-49	. 46	AMO	2	CHR			11/1986	EMI
B3617-M5-R263-S2	SD-10	32	AMO	13	CHR			11/1986	EMI
B3617-M5-R263-S4	SD-12	38	AMO	8	CHR			11/1986	EMI
B3617-M5-R267-S3	SD-16	25	AMO	20	CHR			11/1986	EMI
B3617-M5-R274-S5	SD-2	ND	AMO	35	CHR			11/1986	EMI
B3617-M5-R274-S6	SD-4	40	AMO	12	CHR			11/1986	EMI
B3617-M5-R275-S7	SD-7	36	AMO	10	CHR ·			11/1986	EMI
B3617-M6-R14-S1	SD-50	21	AMO	10	CHR			11/1986	EMI
B3617-M6-R74-S6	SD-39	38	AMO	8	CHR	•		11/1986	EMI
B3617-M6-R207-S7	SD-23	34	AMO	15	CHR			11/1986	EMI
B3617-M6-R228-S9	729-11-004	20	CHR					9/1996	NWE
B3617-M6-R263-S2	SD-11	7	CHR	5	AMO			11/1986	EMI
B3617-M6-R263-S8	SD-13	22	ĊHR					11/1986	EMI
B3617-M6-R267-S3	SD-17	39	AMO	11	CHR			11/1986	EMI
B3617-M6-R267-S4	SD-19	39	AMO	9	CHR			11/1986	EMI
B3617-M6-R272-S5	SD-21	28	AMO	20	CHR		٠	11/1986	EMI
B3617-M6-R274-S10	SD-3	20	AMO	8	CHR			11/1986	EMI
B3617-M6-R275-S11	SD-8	18	AMO	16	CHR			11/1986	EMI
B3617-M6-R275-S12	SD-9	ND						11/1986	EMI
B3617-M7-R30-S1	SD-37	ND						11/1986	EMI
B3617-M7-R170-S4	SD-35	ND						11/1986	EMI
B3617-M8-R30-S1	SD-36	. 8	CHR					11/1986	EMI
B3617-M8-R97-S2	SD-40	5	AMO					11/1986	EMI
B3617-M8-R168-S3	SD-34	· · · · · · · · · · 6	AMO	÷				11/1986	EMI
B3617-M9-R74-S1	SD-38	16	CHR					11/1986	EMI
B3617-M9-R74-S3	729-11-005	20	CHR			٠.		9/1996	NWE
B3617-M9-R207-S2	SD-22	17	CHR					11/1986	EMI
B3617-M12-R165-S1	SD-42	ND						11/1986	EMI
B3617-M13-R267-S1	SD-18	21	AMO					11/1986	EMI
B3617-M13-R272-S2	SD-20	11	AMO					11/1986	EMI
B3617-M14-R207-S1	SD-24	ND						11/1986	EMI
B3617-M16-R206-S1	SD-26	ND						11/1986	EMI
B3617-M20-R2-S3	729-11-008	ND						9/1996	NWE
B3617-M20-R19-S2	729-11-007	ND						9/1996	NWE
B3617-M20-R19-S5	729-11-010	ND						9/1996	NWE
B3617-M20-R117-S7	729-11-012	ND						9/1996	NWE
B3617-M20-R121-S1	729-11-006	ND						9/1996	NWE

LEGEND: ND = NONE DETECTED, TR = TRACE, CHR = CHRYSOTILE, AMO = AMOSITE, AND FIBROUS FORMS OF ACT = ACTINOLITE, ANT = ANTHOPHYLLITE, CRO = CROCIDOLITE AND TRE = TREMOLITE

Real Estate Services Division Asbestos Program Rev. 07/30/98

Bulk Samples Summary Report

Date: 06/08/99


SIS Bldg# Building N	lame						•	
Sample #	Consultant Sample #	Lab 1	Type 1 Lab 2	Type 2	Lab 3	Type 3	Survêy Date	Firm Code
DISTRICT 11 OFFICE								
3617 DISTRICT OFFI	CE							
B3617-M20-R154-S4	729-11-009	ND					9/1996	NWE
B3617-M20-R235-S6	729-11-011	ND					9/1996	NWE
B3617-M25-R19-S1	SD-51	ND					11/1986	EMI
B3617-M25-R169-S2	SD-43	ND_					11/1986	EMI
B3617-M44-R82-S1	SD-41	ND					11/1986	ĖΜΙ
B3617-M44-R214-S2	SD-27	ND					11/1986	EMI
B3617-M44-R217-S3	SD-28	ND					11/1986	ĖMI
B3617-M49-R254-S3	- SD-31	ND					11/1986	EMI
B3617-M50-R74-S1	729-11-001	ND					9/1996	NWE.
B3617-M50-R74-S2	729-11-002	ND					9/1996	NWE
B3617-M50-R74-S3	729-11-003	ND					9/1996	NWE
B3617-M71-R217-S1	SD-29	ND					11/1986	EMI
B3617-M77-R259-S1	729-11-013	ND					9/1996	NWE





Day and the

B3617-M20-R19-S2


B3617-M9-R74-S3 B3617-M50-R74-S3

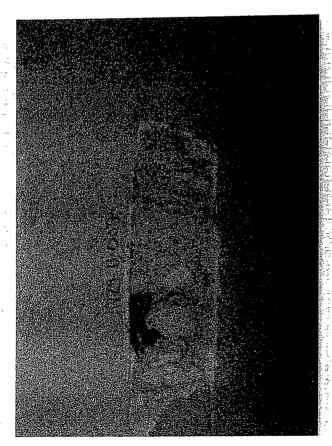

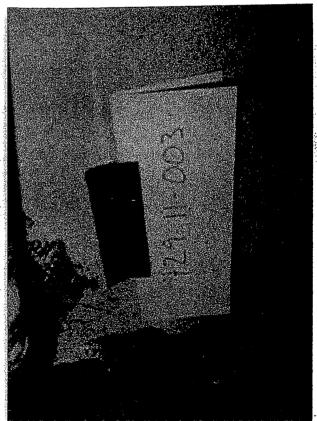


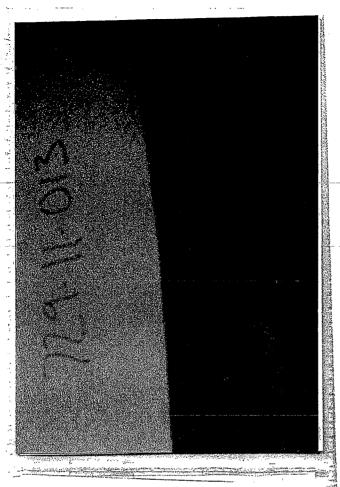



B3617-M77-R259-S1

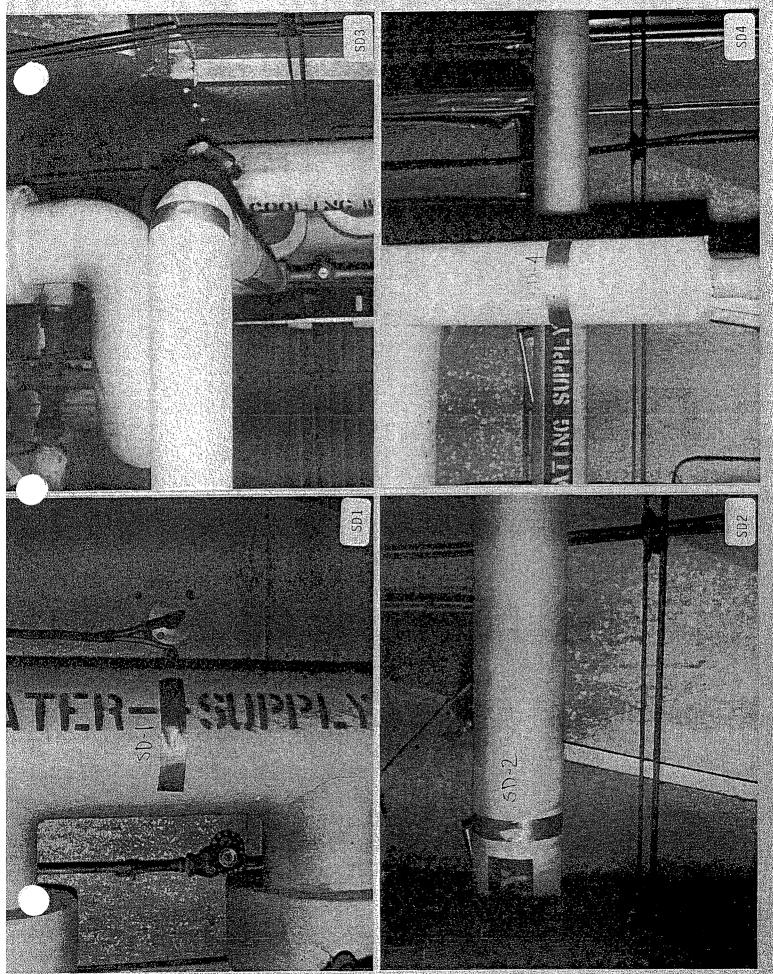



A-16

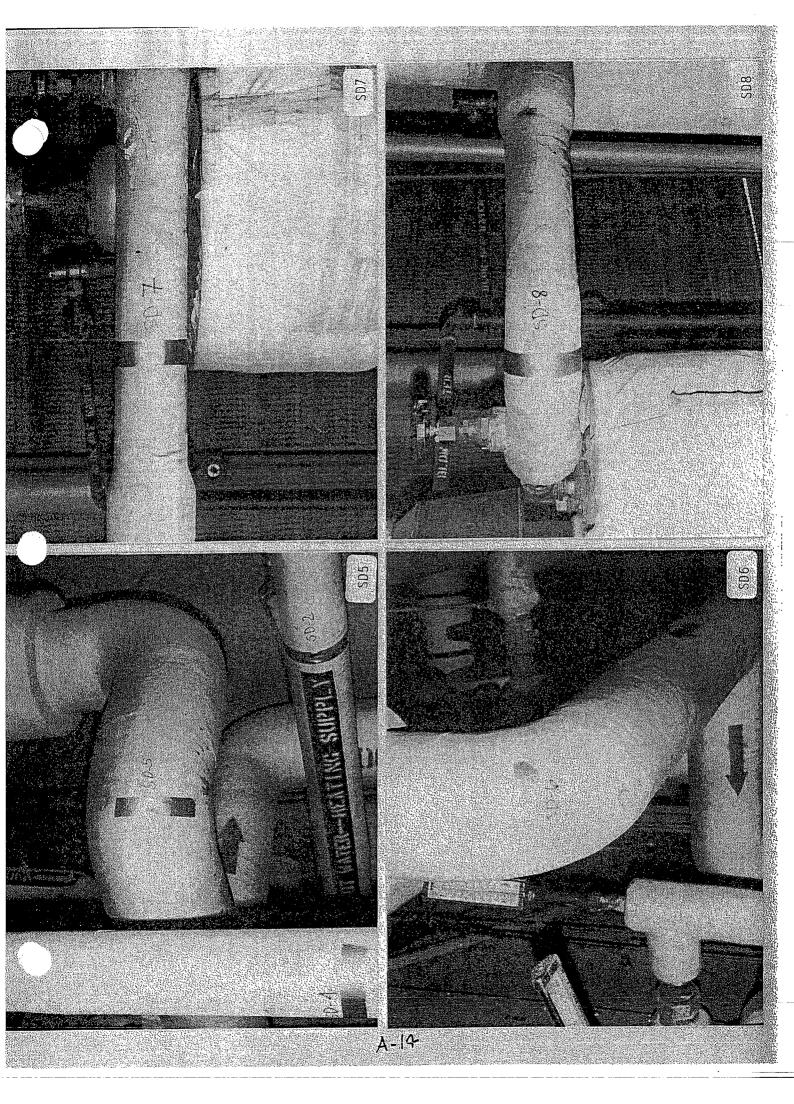


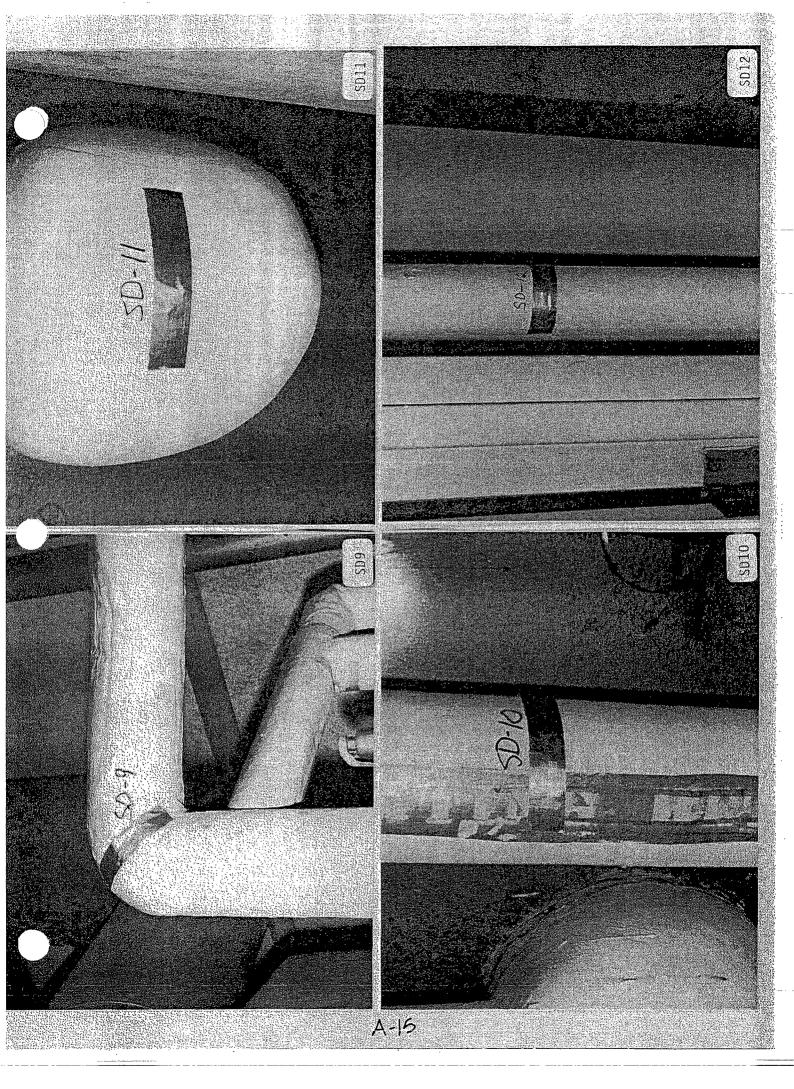


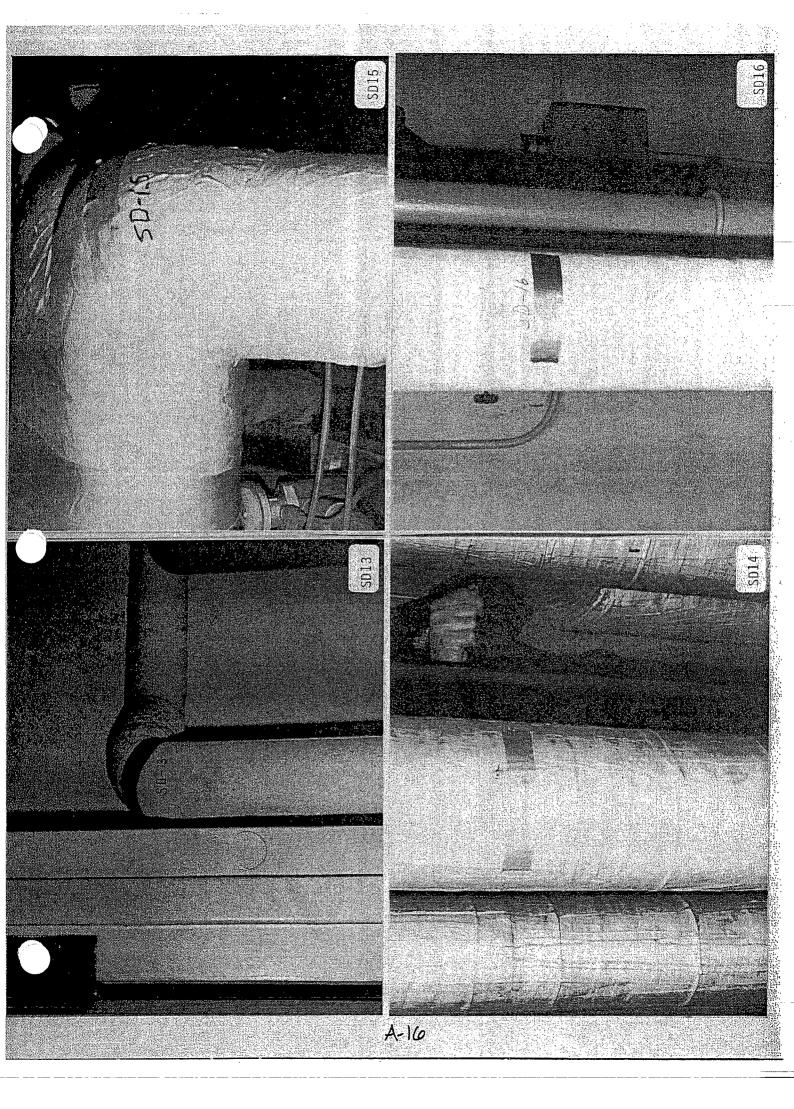


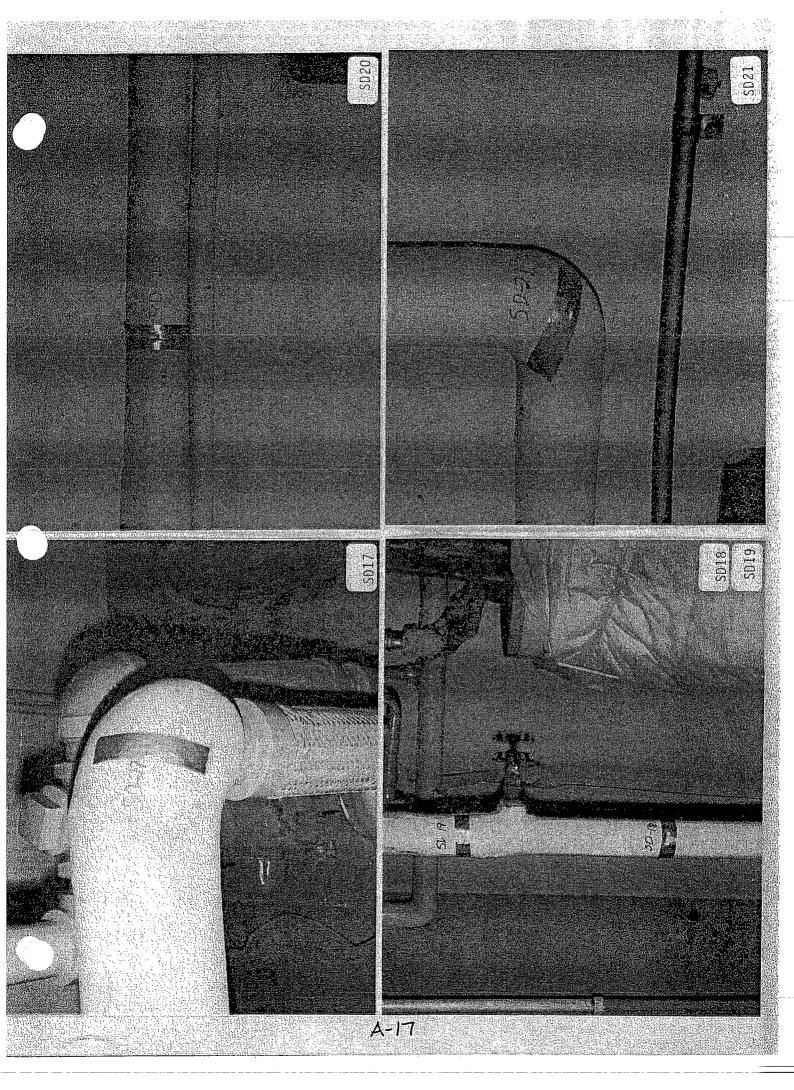


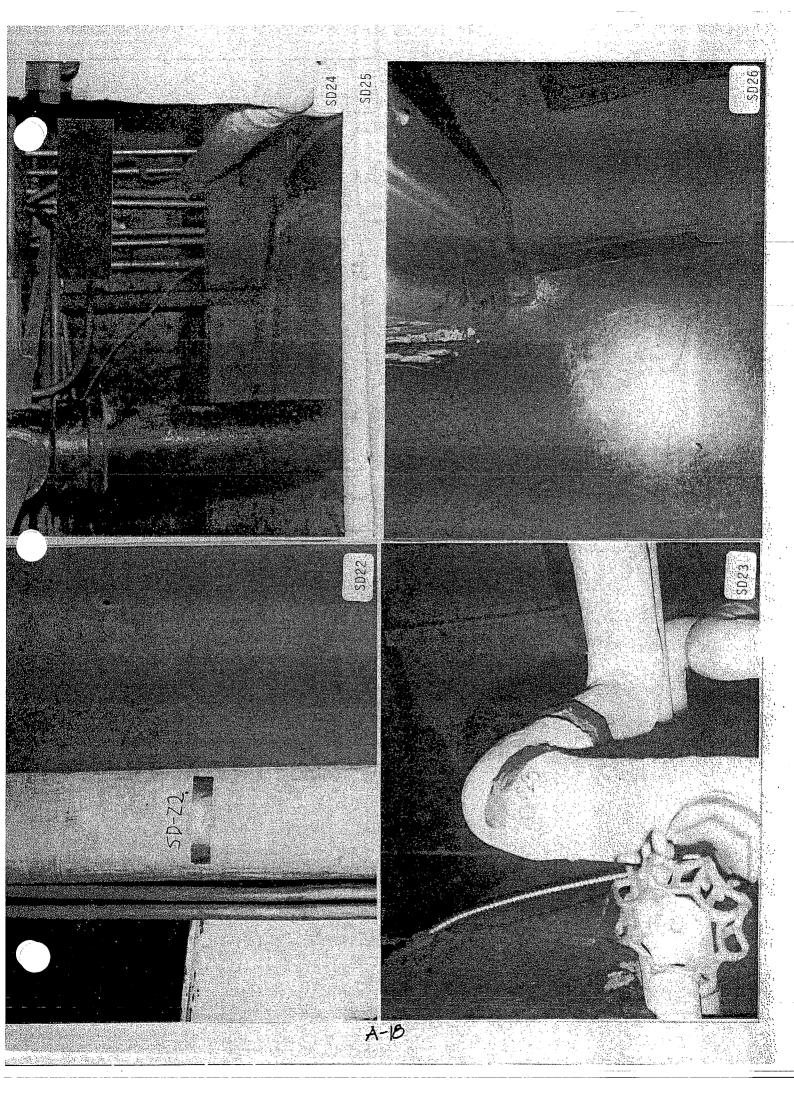


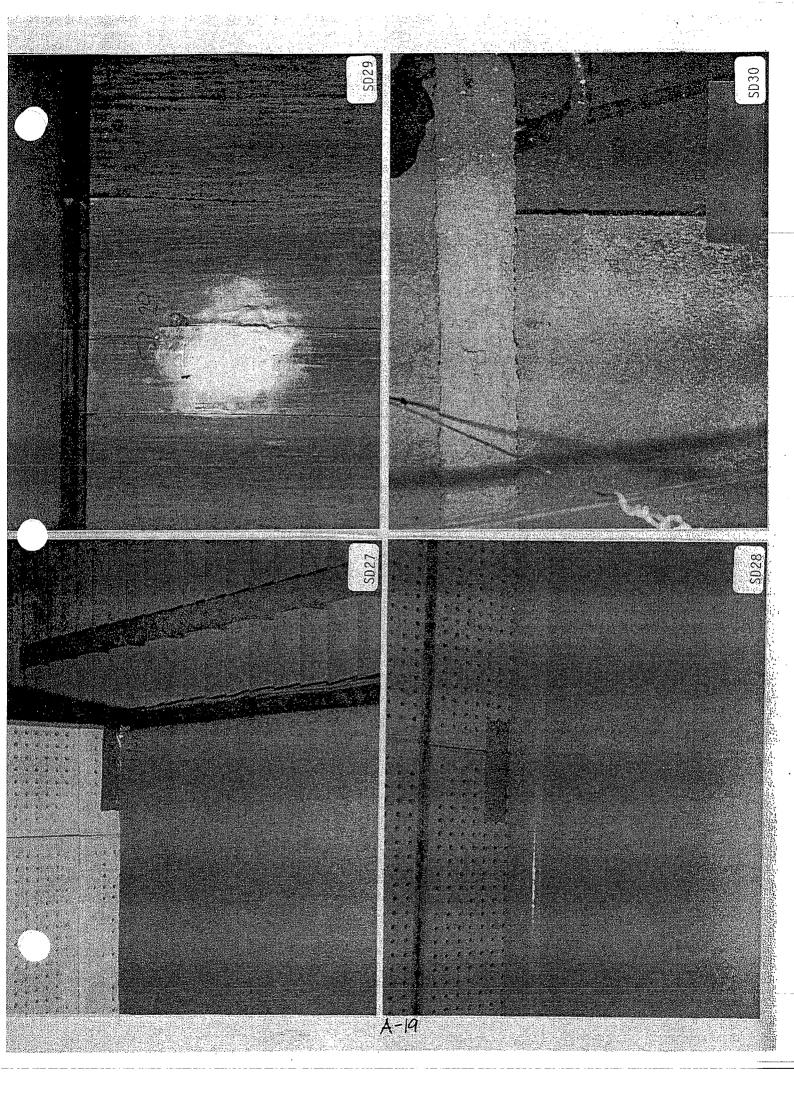


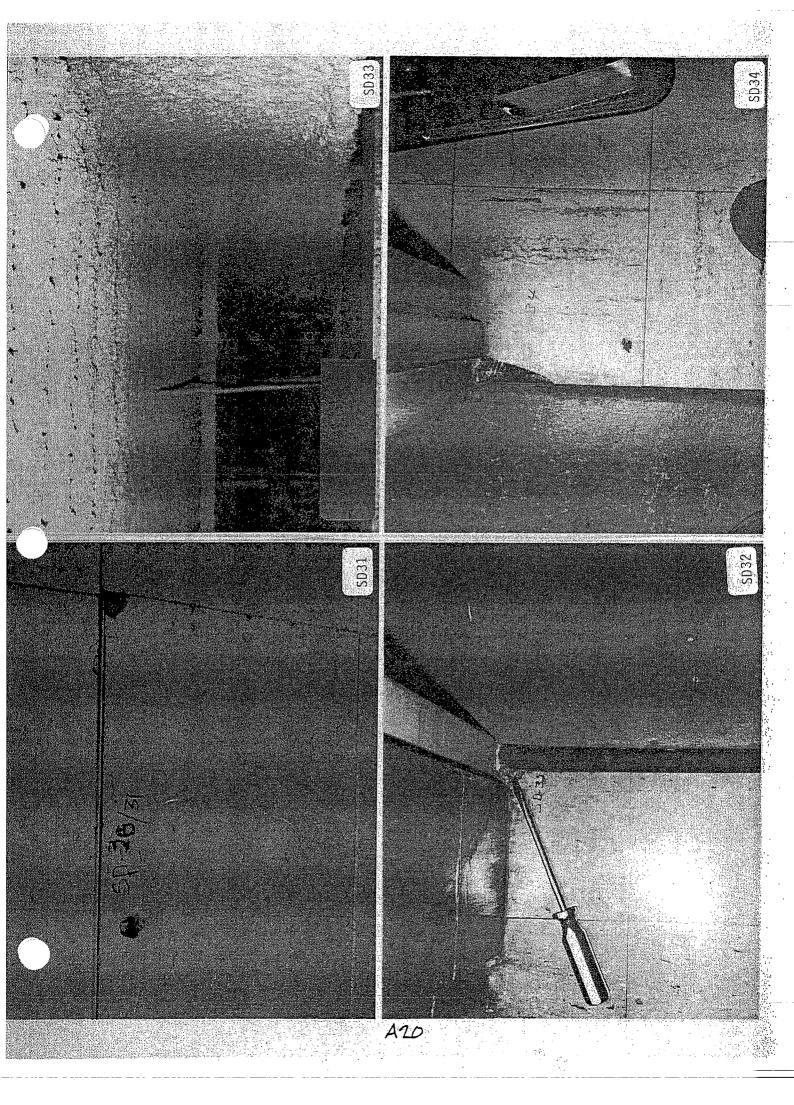


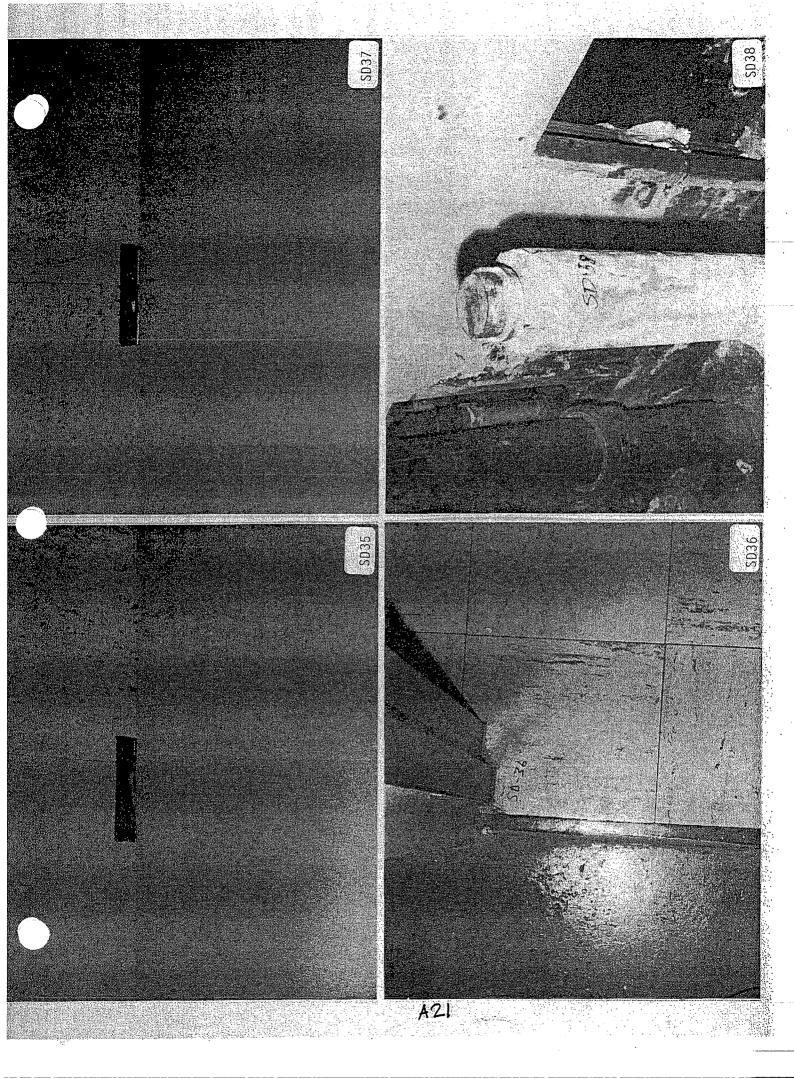


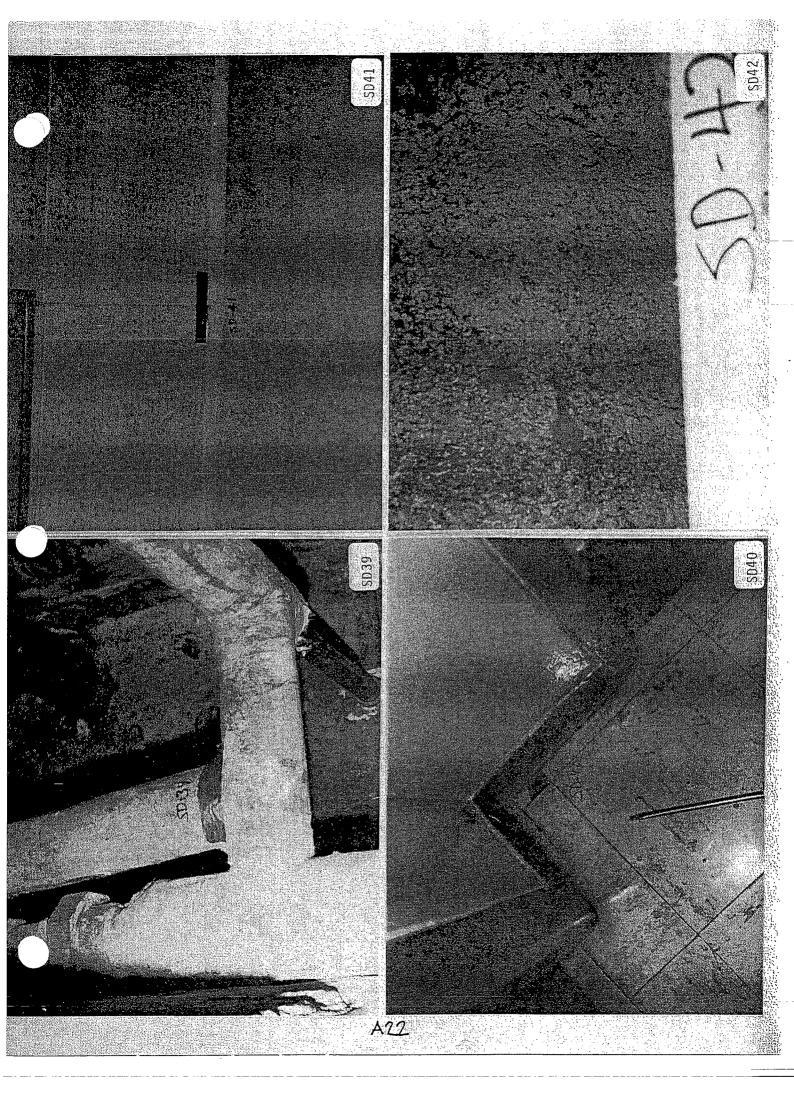


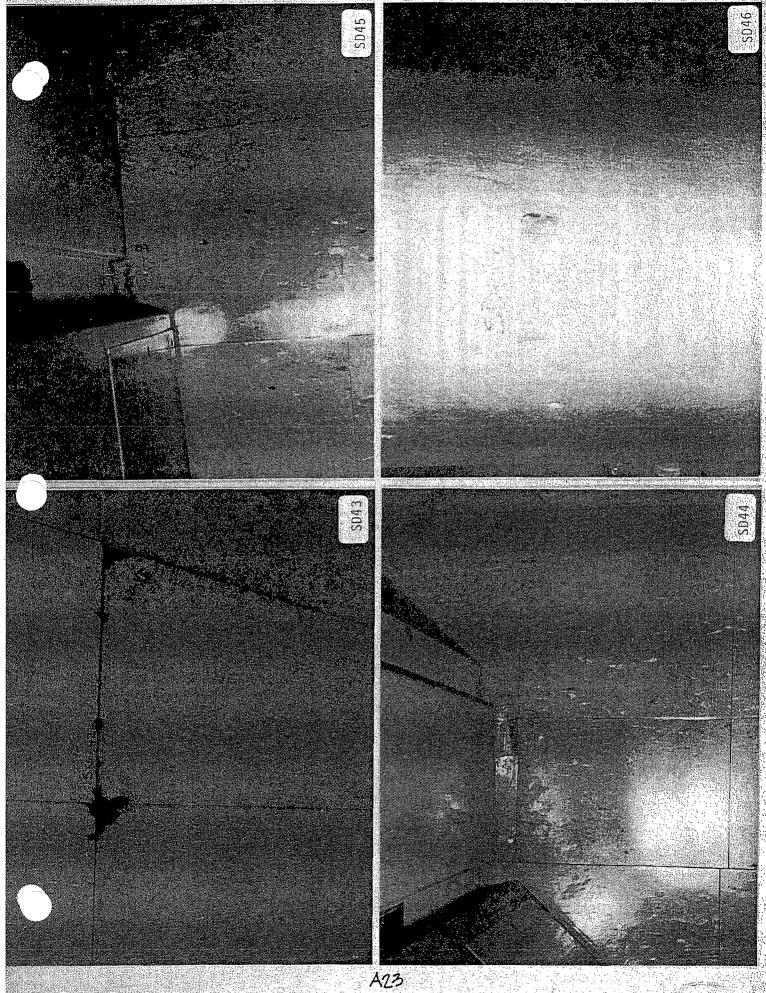


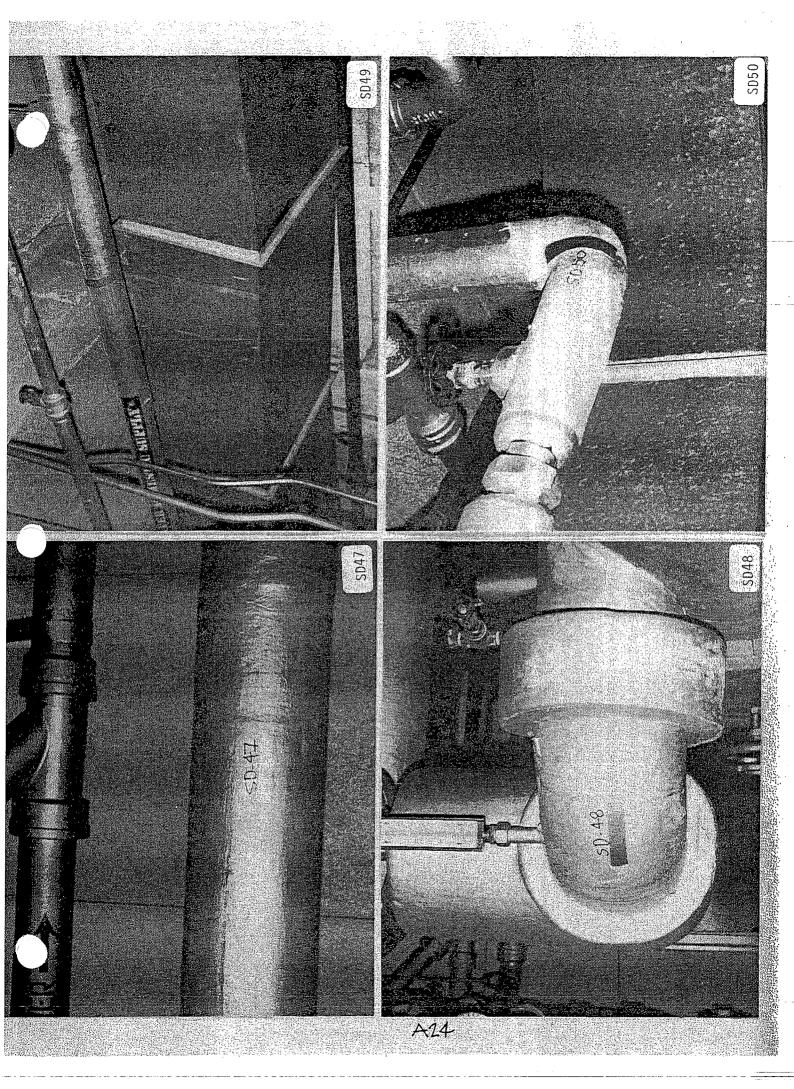


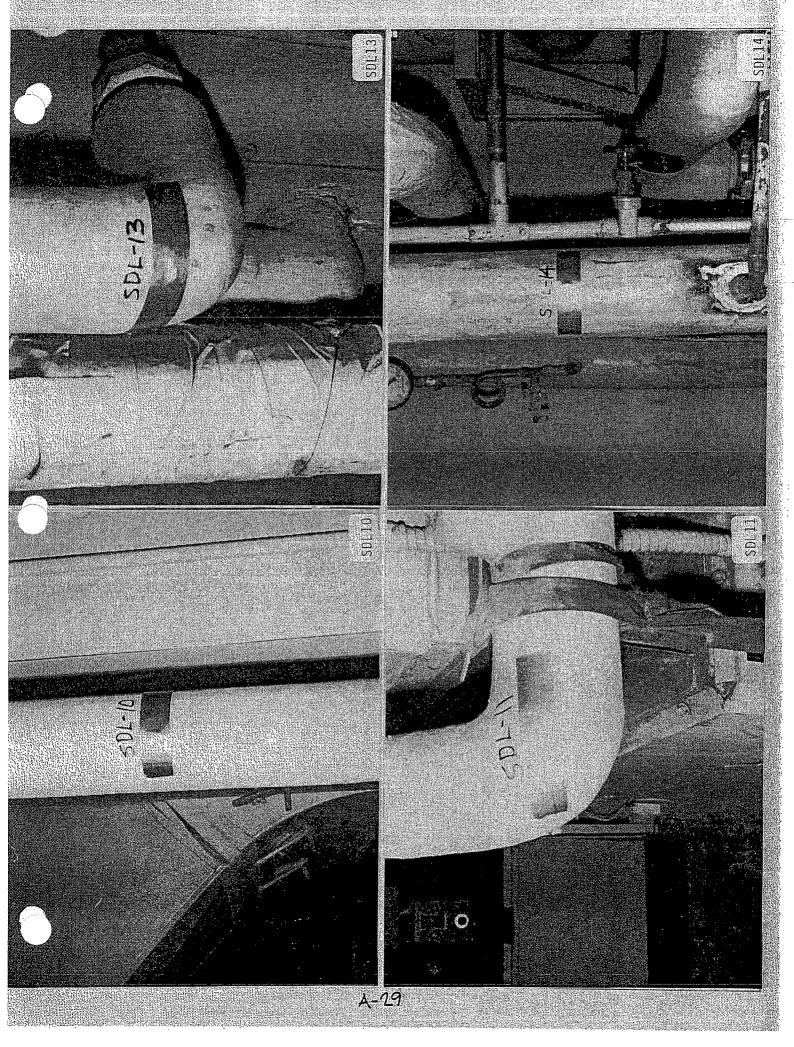

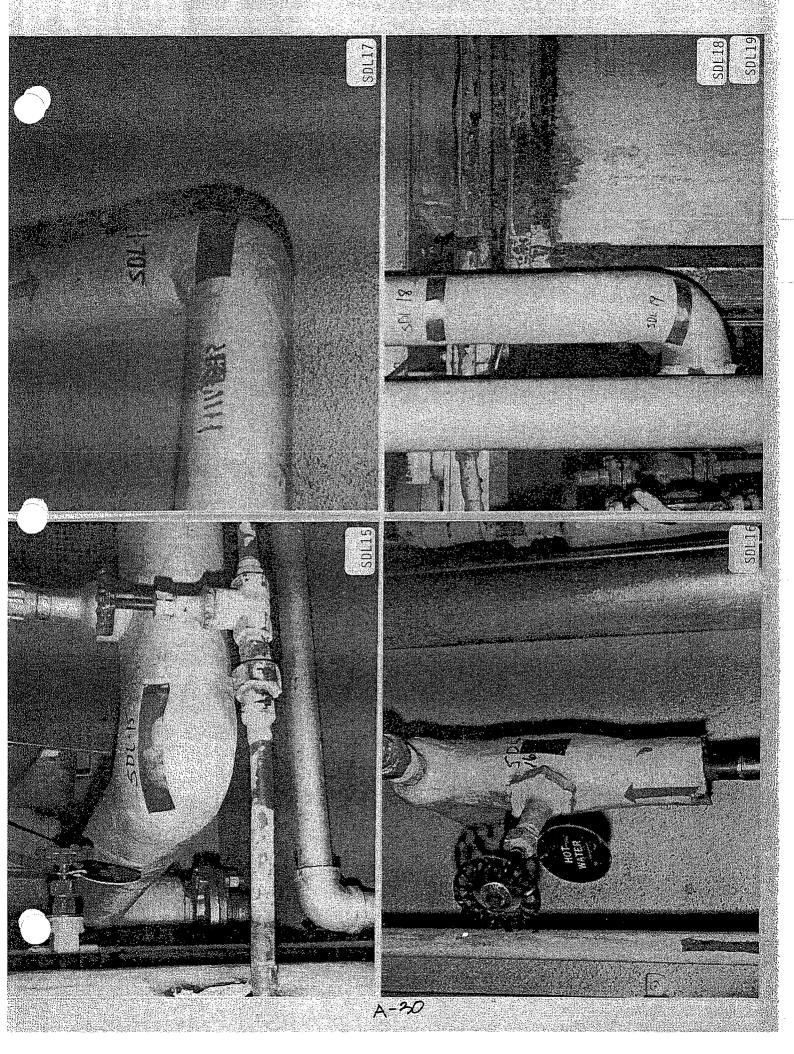

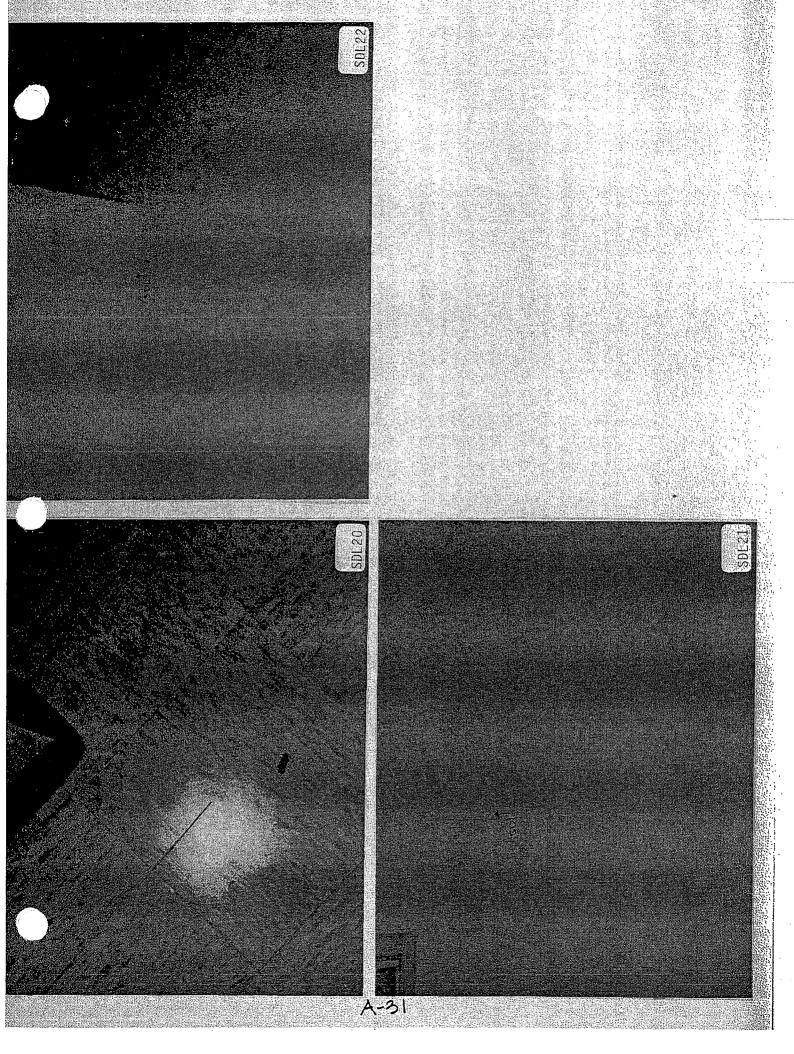

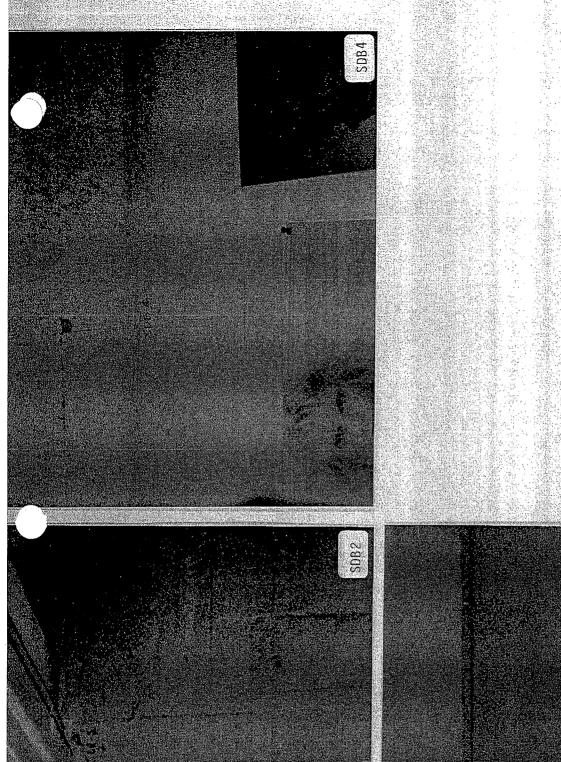

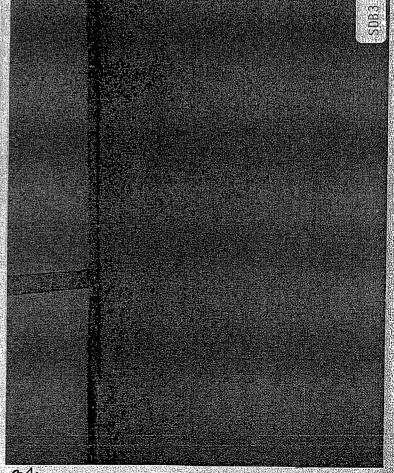

A-24

